

Virtual Services Platform 8600 Release Notes 6.2.0.2

1. Release Summary

Release Date: December 2018

Purpose: Software release to address customer found software issues.

2. Important Notes before Upgrading to This Release

3. Platforms Supported

Virtual Services Platform 8600 Series

Virtual Services Platform VSP 8608

4. Special Instructions for Upgrade from previous releases

5. Notes for Upgrade

Please see “Release Notes for VSP 8600” for software release 6.2.0 available at <https://www.extremenetworks.com/support/documentation> for details on how to upgrade your Switch.

File Names For This Release

Virtual Services Platform 8600 Series

File Name	Module or File Type	File Size (bytes)
VOSS8600.6.2.0.2.tgz	Release 6.2.0.2 archived software distribution	149524494
VOSS8600.6.2.0.2_mib.zip	Archive of all MIB files	1086882
VOSS8600.6.2.0.2_mib.txt	MIB file	7208517
VOSS8600.6.2.0.2_mib_sup.txt	MIB file	998391
VOSS86v620_HELP_EDM_gzip.zip	EDM Help file	3968230
VOSS86v6.2.0.0.zip	EDM plug-in for COM	5841647
VOSS8600.6.2.0.2.md5	MD5 Checksums	545
VOSS8600.6.2.0.2.sha512	SHA512 Checksums	1409

Note about image download:

Ensure images are downloaded using the binary file transfer. Perform MD5 checksum check on downloaded files to ensure file integrity.

Check that the file type suffix is “.tgz” and the image names after download to device match those shown in the above table. Some download utilities have been observed to append “.tar” to the file name or change the filename extension from “.tgz” to “.tar”. If file type suffix is “.tar” or file name does not exactly match the names shown in above table, rename the downloaded file to the name shown in the table above so that the activation procedures will operate properly.

Load activation procedures:

```
software add VOSS8600.6.2.0.2.tgz
software activate VOSS8600.6.2.0.2.GA
```

6. Version of Previous Release

Virtual Services Platform 8608 Series

Software Version 4.5.0.0, 4.5.0.1, 6.1.0.0, 6.1.0.1, 6.1.0.2, 6.2.0.0, 6.2.0.1 for VSP 8608 platforms

7. Compatibility

8. Changes in 6.2.0.2

New Features in This Release

Old Features Removed from This Release

Problems Resolved in This Release

ID	Description
VOSS-11954	SMLTs on VSP8600 VIST pair remain down after reboot of remote edge switch.
VOSS-12163	Remove show io l2-tables and l3-tables from show fulltech
VOSS-12172	VLAN delete or port removal from VLAN may cause sluggish response or CPU utilization spike when ieee-vlan-aging is enabled.
VOSS-12221	During node bootup with ISIS enabled a reset may occur.
VOSS-12259	40Gig BiDiMMF not operating correctly
VOSS-12303	pluggable-optical-modules detail showing incorrect data for 40GbBiDiMMF
VOSS-12305	SMLT up causes ports that have same port number on other slots to go to blocking state

9. Outstanding Issues

Please see “Release Notes for VSP 8600” for software release 6.2.0 available at <https://www.extremenetworks.com/support/release-notes> for details regarding Known Issues.

ID	Description	Workaround
VOSS-12399	VSP8600 with LACP MLT ports configured as SMLT and no VIST configured may cause LACP link state instability.	Fix configuration error.

10. Known Limitations

Please see “Release Notes for VSP 8600” for software release 6.2.0 available at <https://www.extremenetworks.com/support/release-notes> for details regarding Known Limitations.

11. Documentation Corrections

For other known issues, please refer to the product release notes and technical documentation available at: <https://www.extremenetworks.com/support/documentation>.

Copyright © 2018 Extreme Networks, Inc. - All Rights Reserved.

Legal Notice

Extreme Networks, Inc. reserves the right to make changes in specifications and other information contained in this document and its website without prior notice. The reader should in all cases consult representatives of Extreme Networks to determine whether any such changes have been made.

The hardware, firmware, software or any specifications described or referred to in this document are subject to change without notice.

Trademarks

Extreme Networks and the Extreme Networks logo are trademarks or registered trademarks of Extreme Networks, Inc. in the United States and/or other countries. All other names (including any product names) mentioned in this document are the property of their respective owners and may be trademarks or registered trademarks of their respective companies/owners.

For additional information on Extreme Networks trademarks, please see:

www.extremenetworks.com/company/legal/trademarks