

Fixed Anomalies for Site Manager 15.4.2.0

Q00583465-01: X25

X25 service records created on an MCE1 logical line are not displayed by Site Manager.

Q00586103-01: ATM

Site Manager 15.x can not configure an ATM adjacent host on BayRS 14.x router.

Q00598254-01: Protocol Priority

Editing a filter on an interface that has both Datalink and IP filters defined will result in the filters being corrupted such that opening a Datalink filter will display the IP filter and opening the IP filter will display the Datalink filter.

Q00607054-01: FTI/FE1

wfSyncMediaType is not set for FT1 and FE1 interfaces when configured using Site Manager.

Q00630942: DLSw

When configuring DLSw/SDLC on the Quad Serial of the PP5430, the slot IP address is applied to the PCI slot (2) instead of the routing slot (1) causing DLSw to not work.

Q00640508: GRE_IPX

An IPX GRE circuit with RIP enabled stops sending RIP updates after bouncing the remote-endpoint using Site Manager.

Q00640252: GRE_IP

An IP GRE circuit with RIP enabled stops sending RIP updates after bouncing the remote-endpoint using Site Manager.

Q00645601: IPX

When configuring IPX on a PPP circuit using a WAN interface (SDB) on a PP5430 router, the configured encapsulation should be PPP instead of Ethernet and there is no option to change it.

Q00648685: WCP

WCP is not available as a configurable WAN protocol option when configuring a serial interface on the PP5430 router.

Q00649440: Compression

Configuring Stac compression and ILCCP on a PPP circuit will disable compression.