

=====
REVISION NOTES FOR BAYRS VERSION 15.4.2.2
=====

Site Manager compatibility:

BayRS version	is managed by	Site Manager version
15.4.2.2	----->	15.4.2.0
15.4.2.1	----->	15.4.2.0
15.4.2.0	----->	15.4.2.0

=====
BayRS and BCC Version 15.4.2.2 corrects the following problems:
=====

Q00719724-01: PP5430_Quad Serial

The Quad Serial module on the PP5430 router will hang if the processor experiences an unexpected error or fault.

=====
REVISION NOTES FOR BAYRS VERSION 15.4.2.1
=====

Site Manager compatibility:

BayRS version	is managed by	Site Manager version
15.4.2.1	----->	15.4.2.0
15.4.2.0	----->	15.4.2.0

=====
BayRS and BCC Version 15.4.2.1 corrects the following problems:
=====

Q00615210-02: BGP

BGP may fail to mark an route as unreachable after it's next hop interface is no longer valid.

Q00678439-02: RIP

If there is a default route known to the router it will be advertised every 5 seconds regardless of the broadcast timer value when the router is configured with RIP triggered updates enabled and RIP supply disabled.

Q00678552-02: RIP

If the router is configured to generate a default route and a default route is learned the router will advertise the generated default route with the learned cost instead of the configured cost.

Q00686517-02: OSPF

If the wfIpOspfMaximumPath parameter is configured for a value greater than 1, then after one of the paths goes down causing the routes to be imported into OSPF through another interface, the routes may disappear from the LSDB when the original interface comes back.