

## **Fixed Anomalies for Site Manager 15.4.1.0**

### **Q00046404-02: Configuration Manager**

Unable to view or modify a large configuration file in remote or cache mode over a slow dial up line using the Windows 2000 platform.

### **Q00421532-01: MCT1**

When configuring MCT1 circuits on HP/UX 10.20, the time slot screen is incorrectly formatted resulting in the inability to distinguish the time slots.

### **Q00518916-01: IP**

When Diffserv is configured against one of the multinetted IP addresses on a circuit, if that IP address is deleted, the IP protocol information under Diffserv is not removed.

### **Q00536853-01: ATM**

When configuring the E3 interface on the PP5430 router with Site Manager for the first time it will automatically add virtual circuit 0/16, ILMI even when static PVCs are configured. The state will be seen as absent and appears to have no negative effect on the router but there is no way to remove this virtual circuit.

### **Q00542785-01: Image Builder**

Image builder is unable to open a router image on Solaris 2.8.

### **Q00552275: Trap Monitor**

Trap monitor is unable to trap generic Authentication traps.