

# Customer Release Notes

## ExtremeCloud IQ Controller

Firmware Version V.10.05.04.0006

September 1, 2023

### INTRODUCTION:

The ExtremeCloud IQ Controller is a next generation orchestration application offering all the mobility services required for modern unified access deployments. The ExtremeCloud IQ Controller includes comprehensive critical network services for wireless and wired connectivity, wireless device secure onboarding, distributed and centralized data paths, role-based access control through the Application Layer (Layer 7), integrated location services, and IoT device onboarding through a single platform. Built on field proven architectures with the latest technology, the embedded operating system supports containerization of applications enabling future expansion of value-added applications for the unified access edge.

The E3120 is a large application appliance meeting the needs of high-density and mission critical deployments with support for up to 20,000 APs/Defenders, 2000 switches, and 100,000 mobility sessions in high-availability mode. An optional redundant power supply is available for ordering separately.

The E2120 is an application appliance meeting the needs of medium sized high-density and mission critical deployments with support for up to 4,000 APs/Defenders, 800 switches and 32,000 mobility sessions in high-availability mode. An optional redundant power supply is available for ordering separately.

The E2122 is an application appliance meeting the needs of medium sized high-density and mission critical deployments with support for up to 4,000 APs/Defenders, 800 switches and 32,000 mobility sessions in high-availability mode. An optional redundant power supply is available for ordering separately.

The E1120 is an entry to mid-level platform expandable to 250 APs/Defenders, 100 switches, and 4,000 mobility sessions in high-availability mode.

The VE6120 is an elastic virtual appliance that supports up to 1,000 APs/Defenders, up to 400 switches and 16,000 mobility sessions in high-availability mode depending on the hosting hardware.

The VE6120 VE6120H and VE6120K offer elastic capacities to cover the full range of offering as VMWare/MS Hyper-V/Linux KVM, ranging from VE6120/VE6120H/VE6120K-Small to VE6120/VE6120H/VE6120K-Large.

The VE6125/VE6125K XL are virtual appliances that support up to 4,000 APs/Defenders, up to 400 switches and 32,000 mobility sessions in high-availability mode, depending on the hosting hardware.

The ExtremeCloud IQ Controller offers the ability to expand capacity to meet any growing business needs. The hardware and virtual packages are available for purchase. The customer purchases adoption capacity as a Right-To-Use Subscription model, supporting flexible quantities (per managed device) and term (multiple-year extended term) option.

<b>Changes in 10.05.04.0006</b>	<b>I.D</b>
Hardened Historian database by preventing overloading and ensuring that purging of old statistics is done in a timely manner.	CFD-9620
Increased the supported resolution of the SVG image in Ekahau models to have floor maps loaded properly and displayed clearly.	CFD-9300
Adjusted background processing logic to remove UI performance impact of external connection timeouts for isolated/Air Gap installations.	CFD-9092
Improved the sorting mechanism for the Access Point Reports List, to better handle changes in sorting criteria for Radio Power columns.	CFD-9560
Updated User Agent streams to improve support of Auto-Login detection of Captive Portal for Apple devices.	CFD-9398
Improved telemetry component to handle memory resources more efficiently.	CFD-9381

<b>Changes in 10.5.4.0-002R</b>	<b>I.D</b>
Corrected compliance table for missing FCC 5GHz 40MHz entries for some external antenna models	CFD-9681

<b>Changes in 10.05.03.0005</b>	<b>I.D</b>
Improved the accuracy in reporting of connected wireless clients on the dashboard.	CFD-8247
Corrected the encapsulation process by removing unneeded AP information from the content of the ICMP packet sent back to the server.	CFD-9095
Adjusted data protection mechanism to address potential lockup situations of Smart RF.	CFD-9283
Corrected an issue where the Aeroscout engine could not parse the AP status data when the 6 GHz radio was enabled.	CFD-9386
Corrected import issue for Ekahau floor plans by adding missing wall types.	CFD-9409

<b>Changes in 10.5.3.0-001R</b>	<b>I.D</b>
Adjusted an issue with connection descriptor management that could lead to the inability to connect to SSIDs.	CFD-9073
Refreshed captive portal certificate on access points to extend validity to June 2024.	WOS-5310

<b>Enhancements in 10.05.02.0019</b>	
Enhanced the controller authentication options and solution deployment simplification by introducing support for user authentication through RADSEC (TCP/TLS based connectivity).	XCC-2977

<b>Enhancements in 10.05.02.0019</b>	
Improved certificate management by providing a centralized facility that allows system administrators to upload custom certificates to the system and allows them to designate usage of such certificates.	XCC-2976
Enhanced physical interface representation by providing widgets for visualization of Throughput and Utilization performance statistics.	XCC-3184
Introduced support for AP4000-IL Note: The controller recognizes the AP as a Worldwide (AP4000-WW) model, with regulatory region set to IL (Israel). The AP4000-IL will only onboard to a Site defined for country "Israel".	XCC-3124
Introduced support for AP5010-IL Note: The controller recognizes the AP as a Worldwide (WW) model, with regulatory region set to IL (Israel). The AP5010-IL will only onboard to a Site defined for country "Israel".	XCC-3126
Updated AP5050U/D compliance power table for Japan.	XCC-3378
Added support for external antenna *AIO-DQ15021-N* (15 dBi In/Out Sector 21 Degree N type) for AP460e.	XCC-3228

<b>Changes in 10.05.02.0019</b>	<b>I.D</b>
Adjusted enforcement of learnt path minimum transmit unit (MTU) between access points and controllers to enforce a minimum size of 1024.	XCC-3361
Adjusted the logic to only deliver channel neighborhood reports to the controller for APs on which the Channel Inspector is explicitly enabled.	XCC-3483
Rectified encapsulation logic for calculation of checksums for tunneled IPv6 traffic that could result in packet discards.	XCC-3482
Improved logic for statistics processing (Historian) to protect against edge conditions where no-data events could stall cleanup operations.	XCC-3423
Improved recovery of initialization for the QSFP28 interfaces on the E3120 controller family.	XCC-3072
Corrected an issue with WPA3-Compatibility mode to improve support for H2E on AP5010 that could cause WPA3 capable clients from being able to associate.	WOS-4940

<b>Enhancements in 10.05.01.0025</b>	
Added support for external antenna *AIO-DQ15021-RPSMA* (15 dBi In/Out Sector 21 Deg RPSMA) for AP510e	XCC-3197
Extended connectivity options to allow for direct tunneling over GRE between APs and a generic termination point. Current restrictions: * Internal Captive Portal (ICP) not supported	XCC-2840
Extended Admin interface settings to support the DHCP client function.	XCC-3003

<b>Enhancements in 10.05.01.0025</b>	
Added Japan country support for AP4000-WW and AP5010-WW models.	XCC-3195
Improved reporting of controller Locking ID (Serial Number) for virtual instances (VE6120 HK/R, VE6125/K) in the System Information Manufacturing Information report.	XCC-2790
Improved external services connectivity (license management) that requires a web proxy in a customer installation.	XCC-2916
Added support for new region specific AP302W-EG. Requires an Egypt specific activation: XIQ-CACT-VT-EG (virtual controller editions) or XIQ-CACT-HW-EG (hardware controller appliances).	XCC-3112
<p>Upgraded RADIUS server package to extend support for TLS 1.2 and TLS 1.3 for Captive Portal authentication via integrated Onboard Engine. Support for TLS 1.0 and TLS 1.1 has been deprecated.</p> <p>Note: Deprecation of obsolete TLS 1.0 and TLS1.1 may affect some legacy clients (Windows 7 and Windows 8). Please refer to the following article as an industry recommended example on how to enhance such clients to support higher levels of TLS.</p> <p>PEAP is supported up to TLS1.2. Support for TLS 1.3 for PEAP configurations will be addressed in a future release.</p>	XCC-2982
Introduced the ability for an access point to emulate client access to the network. This feature facilitates testing end-to-end network connectivity and internet services. The access point represents a synthetic client that allows for a suite of connectivity tests (Ping, Traceroute, IPerf) on the user policy path. Tests can be run for wired or wireless clients. A wired client test accesses the quality of client connectivity through an AP to the infrastructure. A wireless client test accesses the quality of connectivity through the neighboring access points.	XCC-2969
Improved visualization of performance metrics related to RADIUS server interactions in support of user authentication.	XCC-2172
Enabled DFS support on the 5GHz band (outdoor) for AP5050.	WOS-4925

<b>Changes in 10.05.01.0025</b>	<b>I.D</b>
Improved the retention of the IPv6 deny filter configuration that was getting lost after upgrades.	XCC-3182
Corrected the configuration handover between ExtremeCloud IQ Controller and access points where the access points rejected a FQDN address that was longer than 32 characters.	XCC-3180
Corrected the issue where following an upgrade of the ExtremeCloud IQ Controller firmware, the Fast-Transition setting was lost for WPA3-Enterprise networks (resulting in Fast-Transition being disabled).	XCC-3172

Changes in 10.05.01.0025	I.D
Corrected a timing problem with the ExtremeCloud IQ Pilot feature and prevented stale licenses that could obstruct proper licensing.	XCC-3170
Introduced more intuitive transitioning between different user account Admin roles.	XCC-3164
Corrected the floor map display where a portion of a wall was disappearing after saving a change.	XCC-3032
Corrected an AP issue with reporting the current operational channel to Smart RF.	WOS-4844
Corrected the IP header checksum when CoS is used.	WOS-4841

**Extreme Networks recommends that you thoroughly review this document prior to installing or upgrading this product.**

**For the latest firmware versions, visit the download site at:**  
[www.extremenetworks.com/support/](http://www.extremenetworks.com/support/)

**FIRMWARE SPECIFICATION:**

Status	Version No.	Type	Release Date
Current Version	V.10.05.04.0006	Maintenance Release	September 1, 2023
Previous Version	V.10.05.03.0005	Maintenance Release	July 5, 2023
Previous Version	V.10.05.02.0019	Feature Release	April 27, 2023
Previous Version	V.10.05.01.0025	Feature Release	March 06, 2023

**SUPPORTED APPLIANCES, ACCESS POINTS AND SWITCHES:**

Product Name	Image
ExtremeCloud IQ Controller VE6120 VMware Min Supported ESXi version 5.1 or later, (tested 7.0)	XIQC-10.05.04.0006-1.dle
ExtremeCloud IQ Controller VE6120H (Windows server 2016 or later)	XIQC-10.05.04.0006-1.spe
ExtremeCloud IQ Controller VE6120K Linux KVM	XIQC-10.05.04.0006-1.dve
ExtremeCloud IQ Controller VE6125 Min Supported ESXi version 5.5 or later, (tested 7.0)	XIQC-10.05.04.0006-1.rse
ExtremeCloud IQ Controller VE6125K Linux KVM	XIQC-10.05.04.0006-1.mfe
ExtremeCloud IQ Controller E1120	XIQC-10.05.04.0006-1.sme
ExtremeCloud IQ Controller E2120	XIQC-10.05.04.0006-1.jse
ExtremeCloud IQ Controller E2122	XIQC-10.05.04.0006-1.wze
ExtremeCloud IQ Controller E3120	XIQC-10.05.04.0006-1.ose
AP302W-CAN AP302W-FCC	AP302W-LEAN-10.5.4.0-002R.img

Product Name	Image
AP302W-IL AP302W-WR	
AP305C-1-CAN AP305C-1-FCC AP305C-1-IL AP305C-1-WR AP305C-CAN AP305C-FCC AP305C-IL AP305C-WR AP305CX-CAN AP305CX-FCC AP305CX-IL AP305CX-WR	AP3xxC-LEAN-10.5.4.0-002R.img
AP310e-1-WR AP310e-CAN AP310e-FCC AP310e-IL AP310e-WR AP310i-1-WR AP310i-CAN AP310i-FCC AP310i-IL AP310i-WR	AP3xx-LEAN-10.5.4.0-002R.img
AP360e-CAN AP360e-FCC AP360e-IL AP360e-WR AP360i-CAN AP360i-FCC AP360i-IL AP360i-WR	AP3xx-LEAN-10.5.4.0-002R.img
AP3912i-FCC AP3912i-ROW	AP391x-10.51.24.0003.img
AP3915e-FCC AP3915e-ROW AP3915i-FCC AP3915i-ROW	AP391x-10.51.24.0003.img
AP3916ic-FCC AP3916ic-ROW	AP391x-10.51.24.0003.img
AP3916-camera	AP3916IC-V1-0-14-1.dlf
AP3917e-FCC AP3917e-ROW AP3917i-FCC AP3917i-ROW AP3917k-FCC AP3917k-ROW	AP391x-10.51.24.0003.img
AP3935e-FCC AP3935e-ROW AP3935i-FCC	AP3935-10.51.24.0003.img

Product Name	Image
AP3935i-IL AP3935i-ROW	
AP3965e-FCC AP3965e-ROW AP3965i-FCC AP3965i-ROW	AP3935-10.51.24.0003.img
AP4000-1-WW AP4000-WW	AP4000x-LEAN-10.5.4.0-002R.img
AP410C-1-CAN AP410C-1-FCC AP410C-1-IL AP410C-1-WR AP410C-CAN AP410C-FCC AP410C-IL AP410C-WR	AP4xxC-LEAN-10.5.4.0-002R.img
AP410e-CAN AP410e-FCC AP410e-IL AP410e-WR AP410i-1-FCC AP410i-1-WR AP410i-CAN AP410i-FCC AP410i-IL AP410i-WR	AP4xx-LEAN-10.5.4.0-002R.img
AP460C-CAN AP460C-FCC AP460C-IL AP460C-WR AP460S12C-CAN AP460S12C-FCC AP460S12C-IL AP460S12C-WR AP460S6C-CAN AP460S6C-FCC AP460S6C-IL AP460S6C-WR	AP4xxC-LEAN-10.5.4.0-002R.img
AP460e-CAN AP460e-FCC AP460e-IL AP460e-WR AP460i-CAN AP460i-FCC AP460i-IL AP460i-WR	AP4xx-LEAN-10.5.4.0-002R.img
AP5010-WW	AP5xxx-LEAN-10.5.4.0-002R.img
AP5050D-WW	AP5xxx-LEAN-10.5.4.0-002R.img
AP5050U-WW	AP5xxx-LEAN-10.5.4.0-002R.img

Product Name	Image
AP505i-FCC AP505i-WR	AP5xx-LEAN-10.5.4.0-002R.img
AP510e-FCC AP510e-WR AP510i-1-FCC AP510i-1-WR AP510i-FCC AP510i-WR	AP5xx-LEAN-10.5.4.0-002R.img
AP560h-FCC AP560h-WR AP560i-FCC AP560i-WR	AP5xx-LEAN-10.5.4.0-002R.img
SA201	AP391x-10.51.24.0003.img
Switches	
210-12p-10GE2 210-24p-10GE2 210-48p-10GE2 210-12p-10GE2 POE 210-24p-10GE2 POE 210-48p-10GE2 POE	210-series_V1.02.05.0013.stk fp-connector-3.3.0.4.pyz (cloud connector)
220-12p-10GE2 220-24p-10GE2 220-48p-10GE2 220-12p-10GE2 POE 220-24p-10GE2 POE 220-48p-10GE2 POE	220-series_V1.02.05.0013.stk fp-connector-3.3.0.4.pyz (cloud connector)
X435-24P/T-4S	summitlite_arm-30.7.1.1.xos summitlite_arm-30.5.0.259-cloud_connector-3.4.2.6.xmod
X440G2-12t-10G4 X440G2-24t-10G4 X440G2-48t-10G4 X440G2-12t-10G4 POE X440G2-24t-10G4 POE X440G2-48t-10G4 POE	summitX-30.2.1.8-patch2-5.xos summitX-30.2.1.8-cloud_connector-3.4.1.8.xmod (cloud connector)
X465_24W X465_48T X465_48P X465_48W X465_24MU X465_24MU_24W	onie-30.2.1.8-patch2-5-vpex_controlling_bridge.lst onie-30.2.1.8-cloud_connector-3.4.1.20.xmod
X620-16x	summitX-30.2.1.8-patch2-5.xos summitX-30.2.1.8-cloud_connector-3.4.1.8.xmod (cloud connector)



**NETWORK MANAGEMENT SOFTWARE SUPPORT**

Network Management	Version
ExtremeControl™	22.3 or higher
ExtremeAnalytics™	22.3 or higher
ExtremeCloud™ A3	4.0
ExtremeCloud™ IQ-Site Engine	22.3 or higher

Air Defense	Version
ExtremeAirDefense™	10.5
ExtremeGuest	Version
ExtremeGuest™	6.0.1.0-001

**Note:**

Platform and AP Configuration functions are not supported by ExtremeManagement™. ExtremeCloud™ IQ Site Engine v21.9 or greater is required.

**INSTALLATION INFORMATION:**

Appliance Installations	
E1120	<a href="#">Extreme Campus Controller E1120 Installation Guide</a>
E2120	<a href="#">Extreme Campus Controller E2120 Installation Guide</a>
E2122	<a href="#">Extreme Campus Controller E2122 Installation Guide</a>
E3120	<a href="#">Extreme Campus Controller E3120 Installation Guide</a>
VE6120/VE6125	<a href="#">Extreme Campus Controller VE6120/VE6125 Installation Guide</a>
VE6120H	<a href="#">Extreme Campus Controller VE6120H Installation Guide</a>
VE6120K/VE6125K	<a href="#">Extreme Campus Controller VE6120K/VE6125K Installation Guide</a>

**Known Restrictions and Limitations:**

Known Restriction or Limitation	I.D
<p>Certain wireless clients (such as Qualcomm Killer Wireless 1535 and Intel 7265D/8260/8265) have been known to not complete the 4-way handshake in order to fulfill the association process in networks that have both PMF/MFP (802.11w) and Fast-Transition (802.11r [FT]) enabled.</p> <p>The currently recommended workaround is to not enable PMF/MFP configuration on a service that is also using 802.11r. Such clients have been demonstrated to work correctly on services with just 802.11r (FT) enabled.</p>	nse0003416

Known Restriction or Limitation	I.D
Will improve accuracy of radio statistics representation by addressing issue with counter encodings.	XCC-3480
The Smart RF channel change event may not be reported in the user interface. This issue will be addressed in a future release.	XCC-3316
<p>For the Access Point Test feature, when using the wireless client option for the 5GHz band, if the access point is operating in dual-5GHz mode, and radio 1 is set to 5GHz low (not 2.4GHz), the AP as a client will operate on the 5GHz low band. This may limit the test client's capability to connect to the infrastructure APs that operate in the 5GHz high band.</p> <p>Recommendation: Only exercise wireless AP Test on devices that are configured for full-band mode.</p>	XCC-3284
<p>Controller functions, including internal communications and containerized applications, require the usage of reserved address space. Two subnets are reserved internally to the controller:                      # {{172.17.0.0/24}}                      # 172.31.0.16/28</p> <p>The user interface prevents assigning IP addresses to local interfaces (physical or virtual) that conflict with these ranges.</p>	XCC-3121
For ExtremeCloud IQ Controller (v5) systems previously onboarded into an ExtremeCloud IQ account for visibility, following an upgrade to ExtremeCloud IQ Controller (v10), you must remove and redeclare the controller to ExtremeCloud IQ. This will facilitate the re-synchronization of the controller with the ExtremeCloud IQ account.	XCC-2463
<p>Before installing a new ExtremeCloud IQ Controller license, you must configure Network Time Protocol (NTP) Server settings. Licensing management is dependent on accurate NTP configuration. Configure NTP via the ExtremeCloud IQ Controller initial Configuration Wizard, or go to Admin &gt; System &gt; Network Time to configure and verify the NTP settings.</p>	XCC-2353
For ExtremeCloud IQ Controller configured for authentication of administrators over RADIUS server, the GUI responsiveness may be slow, possibly over 30 seconds if the target server(s) are unavailable or unreachable at login time. If the outage is extensive, the system will eventually timeout to validate against local credentials when provisioned.	XCC-2350
ExtremeCloud IQ-Site Engine 22.3.10 is the minimum required revision for representation of ExtremeCloud IQ Controller 10.01.01 or later revisions. Extreme Management Center (8.5.x or later) does NOT recognize a controller running ExtremeCloud IQ Controller 10.01.01 or later.	XCC-2348
<p>To improve stability of mesh when Smart RF is used with a mesh root AP:</p> <ul style="list-style-type: none"> <li>* Use fixed channel width.</li> <li>* Set Smart RF sensitivity to "Low" to decrease the time that the AP will abandon the channel for scanning.</li> </ul>	XCC-1684
When an infrastructure WLAN (used for connecting client bridge APs) has Quiet IE enable, the client bridge link becomes unstable. It	XCC-1570

Known Restriction or Limitation	I.D
is a best practice to disable Quiet IE when a WLAN is used for a client bridge connection.	
The ADSP spectral analysis function may not work on AP5010x models. This issue will be addressed in a future release.	WOS-4694
With 11r enabled on an 802.1x network, a Windows 10 PC with an Intel Wi-Fi card (ax200, ax210), running driver version 22.170.0.3 cannot reconnect automatically after an MU is disconnected. The workaround is to toggle the Wi-Fi off and on from the PC.	WOS-4480
Allow UTF-8 characters in JSON payload for all Rest API so non-ASCII / Unicode characters are accepted in Rest API requests to comply with current Rest API standards.	ECA-321
Upgrade failure will occur when using special characters (escape back slash) in topology.	ECA-466
In Smart RF mode, the AP510 power may temporarily drop to 0dBm and returns to 4dBm.	ECA-469
With on-air-busy channel conditions, it is possible for the ACS not to produce the expected results. In this instance, perform manual channel selection.	ECA-528
Widgets do not show tooltips for lower and upper values. This issue will be addressed in a future release.	ECA-567
Firmware for ExtremeWireless AP3900 series access points does not currently support Smart RF. No Smart RF data is displayed.	ECA-1484
Default router/gateway should be configured with a next-hop associated with one of the physical interfaces. Pointing the default route to the Admin interface will lead to issues because access points will not get the correct services from the data plane. We recommend setting the default route via data ports, and if necessary, configuring static routes on the Admin port for administration level access.	Info
<p>For AP deployments in remote locations where access points and controllers may need to be discovered and connected over firewalls, a best practice is to leverage DNS or DHCP Option 60/43 methods for zero-touch-provisioning discovery. These methods provide direct connectivity to the defined IP address. DHCP Option 78, which refers to the controller as a Service Location Protocol – Directory Agent (SLP- DA), requires the exchange of SLP protocol between the AP and the appliance at the core, necessitating that UDP 427 be allowed by any firewall in the path. For such installations, discovery over DHCP Option 78 assist is not recommended.</p> <p>When using SLP, for an AP to establish connection with a controller, it must first exchange SLP Directory Agent registration before IPSEC establishment with the eventual controller. That means that SLP UDP 427 must be open along the path.</p> <p>Further issues can occur if Network Address Translation (NAT) is involved. While this method is popular and widely deployed within a homogenous campus, it may result in inadvertent complications for remote connections. Therefore, it should not be used in favor of an alternate method (DHCP 60/43, DNS, or static override).</p>	Info

Known Restriction or Limitation	I.D
When configuring system for NTP time assignment, ensure that the NTP server is properly configured. Incorrect time settings (like timestamps far in the future) may adversely affect system operation, such as certificate expiration that may trigger failures in device registration or system instability.	Info nse0003696
Appliances in a High-Availability pair must be of the same model and at the same exact software revision (and time synched) for configuration synchronization to propagate to the peer. During the upgrade process of a High-Availability pair, any configuration changes made while only one appliance has been upgraded (and therefore resulting in a version mismatch) will not be propagated until the peer is correspondingly upgraded to the same revision. We recommend that you NOT perform configuration changes to one of the members of a High-Availability pair while the peer has a different software revision.	Info nse0005086
For High-Availability configurations, during upgrade phases or configuration restore operations, wait until the availability link is established and synchronized before attempting to make any new configuration changes. The Availability status will only re-establish to Synched status when both appliances are running the exact same firmware revision. During upgrade periods, the Availability link will only re-establish when both the appliance status of availability link and synchronization status can be found. Go to: · "Network Health" widget on the Dashboard, or · Administration -> System -> Availability	Info ECA-776
Recommendation settings for setup of redundant RADIUS server authentication: · Response Window to 5s [Default: 20s] · Revival Interval to 10s [Default: 60s]	Info ECA-875

**SUPPORTED WEB BROWSERS**

For ExtremeCloud IQ Controller management GUI, the following Web browsers were tested for interoperability:

- Firefox 81.0
- Google Chrome 86.0

Note: Microsoft IE browser is not supported for UI management.

The Wireless Clients (Captive Portal, AAA):

Browsers	Version	OS
Chrome	75.0.37770.142	Windows 7 Windows 10

Browsers	Version	OS
Microsoft IE	11	Windows 7 Windows 8.1 Windows 10
Microsoft Edge	42.17134	Windows 10
Firefox	68.0	Windows 10
Safari	Preinstalled with iOS 12.2	iOS 12.2
Safari	Preinstalled with iOS 9.3.5	iOS 9.3.5

**PORT LIST**

The following list of ports may need to remain open so that the Appliances and APs will function properly on a network that includes protection equipment like a firewall.

**ExtremeCloud IQ Controller TCP/UDP Port Assignment Reference**

Comp. Source	Comp. Dest	Protocol (TCP/UDP)	Src Port	Dest Port	Service	Remark	Open Firewall Req'd
<b>Ports for AP/Appliance Communication</b>							
Appliance	Access Point	UDP	Any	13910	WASSP	Management and Data Tunnel between AP and Appliance	Yes
Access Point	Appliance	UDP	Any	13910	WASSP	Management and Data Tunnel between AP and Appliance	Yes
Appliance	Access Point	UDP	4500	Any	Secured WASSP	Management Tunnel between AP and Appliance	Optional
Access Point	Appliance	UDP	Any	4500	Secured WASSP	Management Tunnel between AP and Appliance	Optional
Access Point	Appliance	UDP	Any	13907	WASSP	AP Registration to Appliance	Yes
Access Point	Appliance	UDP	Any	67	DHCP Server	If Appliance is DHCP Server for AP	Optional
Access Point	Appliance	UDP	Any	68	DHCP Server	If Appliance is DHCP Server for AP	Optional

Comp. Source	Comp. Dest	Protocol (TCP/UDP)	Src Port	Dest Port	Service	Remark	Open Firewall Req'd
Access Point	Appliance	UDP	Any	427	SLP	AP Registration to Appliance	Optional
Appliance	Access Point	TCP/UDP	Any	69	TFTP	AP image transfer	Yes
Access Point	Appliance	TCP/UDP	Any	69	TFTP	AP image transfer	Yes
Appliance	Access Point	TCP/UDP	Any	22	SCP	AP traces	Yes
Any	Access Point	TCP	Any	2002, 2003	RCAPD	AP Real Capture (if enabled)	Optional
Any	Access Point	TCP/UDP	Any	22	SSH	Remote AP login (if enabled)	Optional
Any	Access Point	TCP/UDP	Any	445	Microsoft CIFS	LDAP support	Optional
Any	Access Point	TCP/UDP	Any	137, 138, 139	NetBIOS	LDAP support	Optional
<b>Ports for Appliance Management</b>							
Any	Appliance	TCP/UDP	Any	22	SSH	Appliance CLI access	Yes
Any	Appliance	TCP/UDP	Any	5825	HTTPS	Appliance GUI access	Yes
Any	Appliance	TCP/UDP	Any	161	SNMP	Appliance SNMP access	Yes
Any	Appliance	TCP/UDP	Any	162	SNMP Trap	Appliance SNMP access	Yes
Any	Appliance	TCP	Any	80	HTTP	Appliance SNMP access ICP Self Registration	Yes
Any	Appliance	TCP	Any	443	HTTPS	ICP Self Registration	Yes
Any	Appliance	UDP	500	500	IKE	IKE phase 1	Yes
Any	Appliance	TCP/UDP	Any	69	TFTP	TFTP support	Yes
Any	Appliance	UDP	Any	4500	IPSec	IPSec NAT traversal	Yes
Any	Appliance	UDP	Any	13907	Discovery	Used by Discovery	Yes
Any	Appliance	UDP	Any	13910	WASSP	Used by L3 WASSP	Yes

Comp. Source	Comp. Dest	Protocol (TCP/UDP)	Src Port	Dest Port	Service	Remark	Open Firewall Req'd
<b>Ports for Inter Controller Mobility<sup>1</sup> and Availability</b>							
Appliance	Appliance	UDP	Any	13911	WASSP	Mobility and Availability Tunnel	Yes
Appliance	Appliance	TCP	Any	427	SLP	SLP Directory	Yes
Appliance	Appliance	TCP	Any	20506	Langley	Remote Langley Secure	Yes
Appliance	Appliance	TCP	Any	60606	Mobility	VN MGR	Yes
Appliance	Appliance	TCP	Any	123	NTP	Availability time sync	Yes
Appliance	DHCP Server	UDP	Any	67	SLP	Asking DHCP Server for SLP DA	Yes
DHCP Server	Appliance	UDP	Any	68	SLP	RespoECA from DHCP Server for SLP DA request	Yes
<b>Core Back-End Communication</b>							
Appliance	DNS Server	UDP	Any	53	DNS	If using DNS	Optional
Appliance	Syslog Server	UDP	Any	514	Syslog	If Appliance logs to external syslog server	Optional
Appliance	RADIUS Server	UDP	Any	1812	RADIUS Authentication and Authorization	If using RADIUS AAA	Optional
Appliance	RADIUS Server	UDP	Any	1813	RADIUS Accounting	If enabled RADIUS accounting	Optional
Appliance	RADIUS server	UDP	Any	1814	RADIUS Authentication and Authorization	If using RADIUS AAA	Optional
Appliance	RADIUS server	UDP	Any	1815	RADIUS Accounting	If enabled RADIUS Accounting	Optional
Dynamic Auth. Server (NAC)	Appliance	UDP	Any	3799	DAS	Request from DAS client to disconnect a specific client	Optional

<sup>1</sup>For extension of ExtremeWireless deployment via Inter Controller Mobility.

Comp. Source	Comp. Dest	Protocol (TCP/UDP)	Src Port	Dest Port	Service	Remark	Open Firewall Req'd
Appliance	AeroScout Server	UDP	1144	12092	Location Based Service Proxy	Aeroscout Location-Based Service	Optional
AeroScout Server	Appliance	UDP	12092	1144	Location Based Service Proxy	Aeroscout Location-Based Service	Optional
Appliance	Extreme Cloud IQ	TCP	Any	443	NSight	Statistics Report into ExtremeCloud IQ	Yes

**IETF STANDARDS MIB SUPPORT:**

RFC No.	Title	Groups Supported
Draft version of 802.11	IEEE802dot11-MIB	
1213	RFC1213-MIB	Most of the objects supported
1573	IF-MIB	ifTable and interface scalar supported
1907	SNMPv2-MIB	System scalars supported
1493	BRIDGE-MIB	EWC supports relevant subset of the MIB
2674	P-BRIDGE-MIB	EWC supports relevant subset of the MIB
2674	Q-BRIDGE-MIB	EWC supports relevant subset of the MIB

**EXTREME NETWORKS PRIVATE ENTERPRISE MIB SUPPORT**

Extreme Networks Private Enterprise MIBs are available in ASN.1 format from the Extreme Networks website at: <https://extremeportal.force.com/>.

**Standard MIBs**

Title	Description
IEEE802dot11-MIB	Standard MIB for wireless devices
RFC1213-MIB.my	Standard MIB for system information
IF-MIB	Interface MIB
SNMPv2-MIB	Standard MIB for system information
BRIDGE-MIB	VLAN configuration information that pertains to EWC
P-BRIDGE-MIB	VLAN configuration information that pertains to EWC



Title	Description
Q-BRIDGE-MIB	VLAN configuration information that pertains to EWC

**Siemens Proprietary MIB**

Title	Description
HIPATH-WIRELESS-HWC-MIB.my	Configuration and statistics related to EWC and associated objects
HIPATH-WIRELESS-PRODUCTS-MIB.my	Defines product classes
HIPATH-WIRELESS-DOT11-EXTNS-MIB.my	Extension to IEEE802dot11-MIB that complements standard MIB
HIPATH-WIRELESS-SMI.my	Root for Chantry/Siemens MIB

**802.11AC AND 802.11N CLIENTS**

Please refer to the latest release notes for ExtremeWireless™ 10.41.09 or later and/or ExtremeWireless WiNG 5.9.02 or later for the list of compatibility test devices.

**RADIUS SERVERS AND SUPPLICANTS**

**RADIUS Servers Used During Testing**

Vendor	Model OS	Version
FreeRADIUS	1.1.6	FreeRADIUS
FreeRADIUS IAS	1.0.1	FreeRADIUS
	5.2.3790.3959	Microsoft Server 2003 IAS
SBR50	6.1.6	SBR Enterprise edition
NPS	6.0.6002.18005	Microsoft Server 2008 NPS

**802.1x Supplicants Supported**

Vendor	Model OS	Version
Juniper Networks® / Funk	Odyssey client	Version 5.10.14353.0
		Version 5.00.12709.0
		Version 4.60.49335.0
Microsoft®	Wireless Zero Configuration	Version Windows XP-4K-891859-Beta1

Vendor	Model OS	Version
	Wireless Network Connection Configuration	Version Microsoft Window Server 2003, Enterprise Edition R2 SP2
	Wi-Fi Protected Access 2 (WPA2)/Wireless Provisioning Services Information Element (WPS IE) update for Windows XP with Service Pack 2	Version WindowsXP-KB893357-v2-x86-ENU.exe
Intel®	Intel PRO Set/Wireless	Version 13.0.0.x (with Windows® Intel® driver version 13.0.0.x)
Microsoft® Wireless Zero	Windows 7, 8, 8.1 Pro, 10 Pro Windows Phone 8.1, Windows Mobile 10	Provided with Windows®

**Appliance LAN Switch Verification**

Vendor	Model OS	Version	Role
Extreme	X-460-G2	12.5.4.5	XIQC connection
Extreme	X440G2-48p-10G4	21.1.1.4	XIQC connectivity
Extreme	Summit 300-48	7.6e1.4	XIQC connection
Extreme	VSP-4850GTS-PWR	(6.0.1.1_B003) (PRIVATE) HW Base: ERS 4850	XIQC connection
Extreme	K6	08.63.02.0004	XIQC connection
Extreme	K6	08.42.03.0006	XIQC connection
Extreme	X440G2-48p-10GE4	21.1.5.2	XIQC connection
Extreme	X440-G2-12p	21.1.1.4	XIQC connection
Extreme	X460-48p	12.5.4.5	XIQC connection
Cisco	Catalyst 3550	12.1(19)EA1c	XIQC connection

**CERTIFICATION AUTHORITY**

Server Vendor	Model OS	Version
Microsoft CA	Windows Server 2003 Enterprise Edition	5.2.3790.1830
Microsoft CA	Windows Server 2008 Enterprise Edition	6.0
OpenSSL	Linux	1.1.1g

**RADIUS ATTRIBUTES SUPPORT****RADIUS Authentication and Authorization Attributes**

Attribute	RFC Source
Called-Station-Id	RFC 2865, RFC 3580
Calling-Station-Id	RFC 2865, RFC 3580
Class	RFC 2865
EAP-Message	RFC 3579
Event-Timestamp	RFC 2869
Filter-Id	RFC 2865, RFC 3580
Framed-IPv6-Pool	RFC 3162
Framed-MTU	RFC 2865, RFC 3580
Framed-Pool	RFC 2869
Idle-Timeout	RFC 2865, RFC 3580
Message-Authenticator	RFC 3579
NAS-Identifier	RFC 2865, RFC 3580
NAS-IP-Address	RFC 2865, RFC 3580
NAS-IPv6-Address	RFC 3162
NAS-Port	RFC 2865, RFC 3580
NAS-Port-Id	RFC 2865, RFC 3580
NAS-Port-Type	RFC 2865, RFC 3580
Password-Retry	RFC 2869
Service-Type	RFC 2865, RFC 3580
Session-Timeout	RFC 2865
State	RFC 2865
Termination-Action	RFC 2865, RFC 3580
Tunnel Attributes	RFC 2867, RFC 2868, RFC 3580
User-Name	RFC 2865, RFC 3580
Vendor-Specific	RFC 2865

**RADIUS Accounting Attributes**

Attribute	RFC Source
Acct-Authentic	RFC 2866
Acct-Delay-Time	RFC 2866

Attribute	RFC Source
Acct-Input-Octets	RFC 2866
Acct-Input-Packets	RFC 2866
Acct-Interim-Interval	RFC 2869
Acct-Output-Octets	RFC 2866
Acct-Output-Packets	RFC 2866
Acct-Session-Id	RFC 2866
Acct-Session-Time	RFC 2866
Acct-Status-Type	RFC 2866
Acct-Terminate-Cause	RFC 2866

**GLOBAL SUPPORT:**

By Phone: +1 800-998-2408 (toll-free in U.S. and Canada)

For the toll-free support number in your country:  
<https://extremeportal.force.com/>

By Email: [support@extremenetworks.com](mailto:support@extremenetworks.com)

By Web: <https://extremeportal.force.com/>

For information regarding the latest software release, recent release note revisions and documentation, or if you require additional assistance, please visit the Extreme Networks Support website.

Extreme Networks and the Extreme Networks logo are trademarks or registered trademarks of Extreme Networks, Inc. in the United States and/or other countries. All other names (including any product names) mentioned in this document are the property of their respective owners and may be trademarks or registered trademarks of their respective companies/owners. Extreme Networks IPS includes software whose copyright is licensed from MySQL AB.

For additional information on Extreme Networks trademarks, please see: [www.extremenetworks.com/company/legal/trademarks/](http://www.extremenetworks.com/company/legal/trademarks/)