

VSP Operating System Software Release 5.0.1.0

1. Release Summary

Release Date: March 2016

Purpose: Software release to address customer found software issues.

2. Important Notes before Upgrading to This Release

If upgrading systems from either release 4.2.1.0 or release 4.2.1.1 that have ISIS enabled link(s) configured with HMAC-MD5 authentication then you need to perform the procedure described in section (4) below in order to avoid potential network connectivity loss.

3. Platforms Supported

Virtual Services Platform 4000 Series

- Virtual Services Platform VSP 4850GTS
- Virtual Services Platform VSP 4850GTS-PWR+
- Virtual Services Platform VSP 4450GSX-PWR+
- Virtual Services Platform VSP 4450GSX-DC
- Virtual Services Platform VSP 4450GTS-DC
- Virtual Services Platform VSP 4450GTX-HT-PWR+

Virtual Services Platform 7200 Series

- Virtual Services Platform VSP 7254XSQ
- Virtual Services Platform VSP 7254XTQ

Virtual Services Platform 8000 Series

- Virtual Services Platform 8200
- Virtual Services Platform 8400

4. Special Instructions for Upgrade from previous releases

The following procedure should be followed when upgrading systems running one of the following two releases, 4.2.1.0 or 4.2.1.1 which also have ISIS enabled links with HMAC-MD5 authentication on:

Disable ISIS authentication throughout the network a system at a time, a link at a time by disabling it on either side of each link, ensuring the link is stable before moving to the next. When a system has been reconfigured free of ISIS HMAC-MD5 authentication in all of its links, save the configuration file and perform the upgrade to release 4.2.3.0 or greater. After all these systems have been upgraded to release 4.2.3.0 or greater, you may re-enable authentication a system at a time, a link at a time and save the configuration file in each of the involved systems.

Example:

```
VSP:1(config)#interface gigabitethernet x/y
VSP:1(config-if)#no isis hello-auth
VSP:1(config-if)#save config
VSP:1(config-if)# PERFORM THE UPGRADE
VSP:1(config)#interface gigabitethernet x/y
VSP:1(config-if)# isis hello-auth type hmac-md5 key <keyname> [key-id <keyed>]
VSP:1(config-if)#save config
```

5. Notes for Upgrade

Please see “Release Notes for VSP Operating System” for software release 5.0 (NN47227-401, 07.02) available at <http://www.avaya.com/support> for details on how to upgrade your Switch.

File Names For This Release

Virtual Services Platform 4000 Series

File Name	Module or File Type	File Size (bytes)
VOSS4K.5.0.1.0.tgz	Release 5.0.1.0 archived software distribution	95221848
VOSS4K.5.0.1.0_mib.zip	Archive of all MIB files	975311
VOSS4K.5.0.1.0_mib.txt	MIB file	6538777
VOSS4K.5.0.1.0_mib_sup.txt	MIB file	943502
VSP4000v500_HELP_EDM_gzip.zip	EDM Help file	2815973
VSP4000v5.0.0.0.zip	EDM plug-in for v5.0.0.0/vsp4000	4234180
VOSS4K.5.0.1.0.md5	MD5 Checksums	533

Virtual Services Platform 7200 Series

File Name	Module or File Type	File Size (bytes)
VOSS7K.5.0.1.0.tgz	Release 5.0.1.0 archived software distribution	61576380
VOSS7K.5.0.1.0_mib.zip	Archive of all MIB files	975311
VOSS7K.5.0.1.0_mib.txt	MIB file	6538777
VOSS7K.5.0.1.0_mib_sup.txt	MIB file	937561
VOSSv500_HELP_EDM_gzip.zip	EDM Help file	2839094
VOSSv5.0.0.0.zip	EDM plug-in for v5.0.0.0/vsp7200	4323622
VSP7K.5.0.1.0.md5	MD5 Checksums	527

Virtual Services Platform 8000 Series

File Name	Module or File Type	File Size (bytes)
VOSS8K.5.0.1.0.tgz	Release 5.0.1.0 archived software distribution	61575337
VOSS8K.5.0.1.0_mib.zip	Archive of all MIB files	975311
VOSS8K.5.0.1.0_mib.txt	MIB file	6538777
VOSS8K.5.0.1.0_mib_sup.txt	MIB file	937561
VOSSv500_HELP_EDM_gzip.zip	EDM Help file	2839094
VOSSv5.0.0.0.zip	EDM plug-in for v5.0.0.0/vsp8000	4323622
VSP8K.5.0.1.0.md5	MD5 Checksums	527

Note about image download:

Ensure images are downloaded using the binary file transfer. Perform MD5 checksum check on downloaded files to ensure file integrity.

Check that the file type suffix is “.tgz” and the image names after download to device match those shown in the above table. Some download utilities have been observed to append “.tar” to the file name or change the filename extension from “.tgz” to “.tar”. If file type suffix is “.tar” or file name does not exactly match the names shown in above table, rename the downloaded file to the name shown in the table above so that the activation procedures will operate properly.

Load activation procedures:

```
software add VOSS4K.5.0.1.0.tgz
software activate VOSS4K.5.0.1.0.GA
```

or

```
software add VOSS7K.5.0.1.0.tgz
software activate VOSS7K.5.0.1.0.GA
```

or

```
software add VOSS8K.5.0.1.0.tgz
software activate VOSS8K.5.0.1.0.GA
```

6. Version of Previous Release

Virtual Services Platform 4000 Series

Software Version 3.0.0.0, 3.0.1.0, 3.1.0.0, 3.1.0.2, 3.1.0.3, 4.0.0.0, 4.0.0.1, 4.0.0.2, 4.0.0.3, 4.1.0.0, 4.1.0.1, 4.2.0.0, 4.2.0.1, 4.2.1.0, 4.2.1.1, 4.2.2.0, 4.2.3.0, and 5.0.0.0 for VSP 4850GTS platforms

Software version 4.0.0.0, 4.0.0.1, 4.0.0.2, 4.0.0.3, 4.1.0.0, 4.1.0.1, 4.2.0.0, 4.2.0.1, 4.2.1.0, 4.2.1.1, 4.2.2.0, 4.2.3.0, and 5.0.0.0 for VSP 4450GSX platform

Software Version 4.0.50.0 4.2.1.1, 4.2.2.0, 4.2.3.0, and 5.0.0.0 for VSP 4450GSX DC and VSP 4450GTS DC platforms

Software Version 4.0.40.0, 4.1.0.0, 4.1.0.1, 4.2.0.0, 4.2.0.1, 4.2.1.0 4.2.1.1, 4.2.2.0, 4.2.3.0 and 5.0.0.0 for VSP 4450GTX-HT-PWR+ platform

Virtual Services Platform 7200 Series

Software Version 4.2.1.0, 4.2.1.1, 4.2.2.0, 4.2.3.0 and 5.0.0.0

Virtual Services Platform 8000 Series

Software Version 4.0.0.0, 4.0.1.0, 4.0.1.1, 4.0.1.2, 4.0.1.3, 4.0.1.4, 4.1.0.0, 4.1.0.1, 4.2.0.0, 4.2.0.1, 4.2.1.0, 4.2.1.1, 4.2.2.0, 4.2.3.0 and 5.0.0.0 for VSP8200 platform

Software Version, 4.2.0.0, 4.2.0.1, 4.2.1.0, 4.2.1.1, 4.2.2.0, 4.2.3.0 and 5.0.0.0 for VSP8400 platform

7. Compatibility

8. Changes in 5.0.1.0

New Features in This Release

Old Features Removed From This Release

Problems Resolved in This Release

ID	Description
VSP8000-82 VSP8000-74	RX flow control was not honored by the VSP.
VSP4000-75	Saving config breaks the config file when adding an access port to VLAN 1 if VLAN 1 is also associated with an I-SID
VSP8000-86	VLAN-ISID association was performed after ISIS was enabled. ISIS LSPs were advertising the wrong BVID port membership for the ISID-VLAN.

VSP4000-74	When ISIS is globally disabled (or multicast is disabled from SPB), Multicast over SPB resources are not cleared properly which may prevent multicast from working over SPB. Multicast to local UNI ports are not affected.
VSP8000-70 VSP8000-81	System resets when MD5 command is given invalid syntax.
VSP4000-72	EDM fails to connect when using the Fully Qualified Domain Name (FQDN)
VSP4000-46 VSP4000-54 VSP4000-68	Raise alarm when internal access to USB is lost. In combination with expanding the application file system into RAMFS and logging a message to indicate that the system has lost internal access to the USB, the user can now monitor the condition. For this log to be useful, the user has to enable syslog server, as when the internal access to the USB is lost, there is no local file system for the log to be written to. PSN004703 also describes this. It is advisable to practice good housekeeping on the USB file system. Delete unwanted, out-of-date files and superseded software images to avoid susceptibility to USB drive corruption.
VSP8000-88	Multicast and Broadcast traffic on port 1/1 is getting looped back out the port.
VSP4000-81	VSP4850GTS can crash when HW failure of USB access occurs. With this change, the application file system is expanded into a RAMFS on the VSP4850GTS so that even when the USB fails, the executable images are still available thereby preventing the crash.
VSP4000-86	VSP4000 may experience High CPU utilization when no impacting events are occurring
VOSS-2114	SCP is allowed to non RWA/Admin users when authenticated through Radius/TACACS

9. Outstanding Issues

Please see “Release Notes for VSP Operating System” for software release 5.0 (NN47227-401, 07.02) available at <http://www.avaya.com/support> for details regarding Known Issues.

In addition, the following issues have been identified:

ID	Problem Description	Workaround
VOSS-1393	On VSP 8000 Series platforms IPv4 Filters with redirect next hop action is not forwarding when a default route is not present or a VLAN common to ingress VLAN of the filtered packet is not present.	Configure a default route if possible.
VSP8000-84	In a square vIST setup, if VLAN 1 has been previously configured with an i-sid and it has now been removed, traffic that needs to be forwarded across the vIST may be dropped silently causing connectivity issues between its two adjacent nodes. The issue has been fixed in release VOSS 5.1.0.0 and later.	An otherwise non used i-sid maybe configured on VLAN 1 to restore the dropped traffic across the vIST.

10. Known Limitations

Please see “Release Notes for VSP Operating System” for software release 5.0 (NN47227-401, 07.02) available at <http://www.avaya.com/support> for details regarding Known Limitations.

The VSP8284XSQ platform may experience a watchdog timeout induced reset when a momentary power loss to the system occurs. In this situation the datapath has been reinitialized even though there is enough power left in the system for the Control Plane to generate a core dump. The reset is needed for the system to be fully functional again. Using a UPS is recommended to mitigate momentary power interruption.

Regular cleanup of unneeded files on USB drives is recommended to minimize possibility of USB corruption when a system is reset, shutdown or power is lost.

11. Documentation Corrections

For other known issues, please refer to the product release notes and technical documentation available from the Avaya Technical Support web site at: <http://www.avaya.com/support>.

Copyright © 2016 Avaya Inc - All Rights Reserved.

The information in this document is subject to change without notice. The statements, configurations, technical data, and recommendations in this document are believed to be accurate and reliable, but are presented without express or implied warranty. Users must take full responsibility for their applications of any products specified in this document. The information in this document is proprietary to Avaya.

To access more technical documentation, search our knowledge base, or open a service request online, please visit Avaya Technical Support on the web at: <http://www.avaya.com/support>