

June 2023



Extreme SLX-OS 20.4.1e

Release Notes

Supporting ExtremeRouting and ExtremeSwitching
SLX 9740, SLX 9640, SLX 9540, SLX 9250, SLX 9150,
Extreme 8720, and Extreme 8520

© 2023, Extreme Networks, Inc. All Rights Reserved.

Extreme Networks and the Extreme Networks logo are trademarks or registered trademarks of Extreme Networks, Inc. in the United States and/or other countries. All other names (including any product names) mentioned in this document are the property of their respective owners and may be trademarks or registered trademarks of their respective companies/owners. For additional information on Extreme Networks Trademarks, see www.extremenetworks.com/company/legal/trademarks/. The hardware, firmware, software or any specifications described or referred to in this document are subject to change without notice.

Contents

Release Overview	7
Behavior Changes.....	7
Software Features	8
CLI Commands	10
Hardware Support.....	13
Supported FEC modes.....	17
Software Download and Upgrade	18
Limitations and Restrictions.....	37
Known Issues.....	41
Open Defects.....	42
Defects Closed with Code Changes	70
Defects Closed without Code Changes	96

Document History

Version	Summary of changes	Publication date
1.0	Initial version for 20.4.1e	June 2023

Preface

Getting Help

If you require assistance, contact Extreme Networks using one of the following methods:

- **Extreme Portal:** Search the GTAC (Global Technical Assistance Center) knowledge base; manage support cases and service contracts; download software; and obtain product licensing, training and certifications.
- **The Hub:** A forum for Extreme Networks customers to connect with one another, answer questions, and share ideas and feedback. This community is monitored by Extreme Networks employees but is not intended to replace specific guidance from GTAC.
- **Call GTAC:** For immediate support, call (800) 998 2408 (toll-free in U.S. and Canada) or 1 (408) 579 2826. For the support phone number in your country, visit www.extremenetworks.com/support/contact.

Before contacting Extreme Networks for technical support, have the following information ready:

- Your Extreme Networks service contract number or serial numbers for all involved Extreme Networks products
- A description of the failure
- A description of any actions already taken to resolve the problem
- A description of your network environment (such as layout, cable type, other relevant environmental information)
- Network load at the time of trouble (if known)
- The device history (for example, if you have returned the device before, or if this is a recurring problem)
- Any related RMA (Return Material Authorization) numbers

Subscribe to Service Notifications

You can subscribe to email notifications for product and software release announcements, Vulnerability Notices, and Service Notifications.

1. Go to www.extremenetworks.com/support/service-notification-form.
2. Complete the form. All fields are required.
3. Select the products for which you want to receive notifications.
Note: You can change your product selections or unsubscribe at any time.
4. Select **Submit**.

Extreme Resources

Visit the Extreme website to locate related documentation for your product and additional Extreme resources.

White papers, data sheets, and the most recent versions of Extreme software and hardware manuals are available at <https://www.extremenetworks.com/>. Product documentation for all supported releases is available to registered users at <https://www.extremenetworks.com/support/documentation/>.

Document Feedback

The Information Development team at Extreme Networks has made every effort to ensure the accuracy and completeness of this document. We are always striving to improve our documentation and help you work better, so we want to hear from you. We welcome all feedback, but we especially want to know about:

- Content errors, or confusing or conflicting information
- Improvements that would help you find relevant information in the document
- Broken links or usability issues

You can provide feedback in the following ways:

- In a web browser, select the feedback icon and complete the online feedback form.
- Access the feedback form at <http://www.extremenetworks.com/documentation-feedback-pdf/>.
- Email us at documentation@extremenetworks.com.

Provide the publication title, part number, and as much detail as possible, including the topic heading and page number if applicable, as well as your suggestions for improvement.

Release Overview

Release SLX-OS 20.4.1e provides the following features:

- Critical defect fixes

Release SLX-OS 20.4.1d provides the following features:

- Ability to control service bindings for SNMP listening services
- Critical defect fixes

Release SLX-OS 20.4.1c provides the following features:

- Critical defect fixes

Release SLX-OS 20.4.1b provides the following features:

- Critical defect fixes
- TPVM security patches till May 09, 2022 are included in TPVM 4.5.1

Release SLX-OS 20.4.1a provides the following features:

- Critical defect fixes

Release SLX-OS 20.4.1 provides the following features:

- SLX based TPVM upgrade optimization
- Additional SNMP notification event support
- SE Linux based IMA policy
- MAC (Mandatory Access Control) policy for user space binaries
- Ability to upgrade ONIE/GRUB
- Force port 1G speed/duplex via constrained advertised capabilities
- Processing ACL rule for Tunneled traffic
- BGP Dynamic Peering Scale Enhancement
- IPV6 configuration support in TPVM
- IPv6 Support for Peer-Address in a Route Map for BGP
- BGP dampening for peer flaps
- TPVM security patches till April 03, 2022 are included in TPVM 4.5.0

Behavior Changes

The following are the behavioral changes for SLX-OS 20.4.1e

- No behavioral changes were introduced in this release.

The following are the behavioral changes for SLX-OS 20.4.1d

- Default VRF bindings for SNMP listening services on SLX-OS are Management VRF and Default VRF.
- SNMP SET operation is completely unsupported.
- SNMP server view command does not take effect for the “write view” option
- SNMPv3 user delete operation requires SNMP agent to be stopped to take effect post reload.

- Boot up time for SNMP agent is delayed.
- The variable binding for 'InetAddress' type variables in Enterprise MIBs related traps – BFD and MCT, is changed from 'IpAddress' to 'InetAddress'.
- In SNMP traps, snmpTrapAddress is moved to the end of varbinds.

The following are the behavioral changes for SLX-OS 20.4.1c

- No behavioral changes were introduced in this release.

The following are the behavioral changes for SLX-OS 20.4.1b

- No behavioral changes were introduced in this release.
- TPVM security patches till May 09, 2022 are included in TPVM 4.5.1

The following are the behavioral changes for SLX-OS 20.4.1a

- No behavioral changes were introduced in this release.

The following are the behavioral changes for SLX-OS 20.4.1

- CLI `threshold-monitor` is modified as follows:
 - o Default action is changed from RASlog to RASlog and SNMP Trap.
 - o `threshold-monitor Memory` has removed parameters – limit and low-limit.
 - o Default values for `threshold-monitor Cpu` and `threshold-monitor Memory` are changed.
- SNMP trap for BFD module contains additional info and is implemented via Enterprise BFD MIB. BFD Enterprise MIB is the default option. This means, `snmp-server trap` needs to be specifically configured for BFD standard MIB via newly added CLI in this release.
- TPVM patch upgrade (incremental upgrade) that helps upgrading only the patches without stopping the running TPVM instance. Use the command `tpvm upgrade incremental`.
- TPVM IPv6 support
- Added security patches till April 03, 2022, in TPVM 4.5.0

Software Features

The following key software features are added in the SLX-OS 20.4.1e release

- No new feature is added in this release.

The following key software features are added in the SLX-OS 20.4.1d release

Feature Name	Supported SLX Platforms	Description
Ability to control service bindings for SNMP listening services	All	Allows user to enable SNMP services listening on a specific VRF, including default and Management VRFs. Users can configure up to 32 VRFs.

The following key software features are added in the SLX-OS 20.4.1c release

- No new feature is added in this release.

The following key software features are added in the SLX-OS 20.4.1b release

- No new feature is added in this release.

The following key software features are added in the SLX-OS 20.4.1a release

- No new feature is added in this release.

The following key software features are added in the SLX-OS 20.4.1 release

Feature Name	Supported SLX Platforms	Description
SLX based TPVM upgrade optimization	All	<p><code>tpvm upgrade incremental</code> command is introduced.</p> <ul style="list-style-type: none"> • avoids reinstallation of TPVM and EFA during upgrade • 2 Debian files for each installation type <ul style="list-style-type: none"> ○ One for full installation ○ One for upgrade installation
Additional SNMP Notification Event support	All	<p>New and enhanced SNMP notifications are added:</p> <ul style="list-style-type: none"> • BFD enterprise notifications with BFD session specific information • Cluster up and down notifications for MCT cluster • Maintenance mode traps for entry and exit transitions • CPU and memory threshold monitoring traps. • NTP status change trap • Enhanced BGP IPv6 notifications - Established & BackwardTransition traps • Enhanced Fan failure / recovery traps • Enhanced Power Supply failure / recovery traps
SE Linux based IMA policy	All	<p>Security Enhanced Linux is added as an additional layer of system security for access controls for the applications, processes, and files on the SLXOS system.</p>
MAC policy for user space binaries	All	<p>Security Enhanced Linux (SE Linux) implements Mandatory Access Control (MAC). Every process and system resource is issued a special security label called an SE Linux context.</p>
Ability to upgrade ONIE/GRUB	SLX 9150, SLX 9250, Extreme 8720 and Extreme 8520	<p>Provides the ability to install <i>onie</i>, <i>diag</i> and <i>onie-grub</i> images from SLXOS</p>

Feature Name	Supported SLX Platforms	Description
Force port 1G speed/duplex via constrained advertised capabilities	SLX 9150, Extreme 8520	Adds the support of 10G port in 1G forced mode in full duplex with clock parameter to auto negotiate based on peer capabilities
Processing ACL rule for Tunneled traffic	SLX 9740	Supports ingress ACL on tunnels to match the inner headers for VxLAN, GRE and MPLS tunnels
BGP Dynamic Peering Scale Enhancement	All	Increases the number of BGP peers for Dynamic BGP Peers
IPv6 protocol support on TPVM	All	Introduces the initial support of IPv6 protocol for TPVM
IPv6 Support for Peer-Address in a Route Map for BGP	All	Supports of <code>set ipv6 next-hop peer-address</code> in route-map for BGP
BGP dampening for peer flaps	All	Adds the BGP peer dampening capability for unusable BGP peers

CLI Commands

The following commands were added, modified, or deprecated for the 20.4.1e program

New commands for 20.4.1e

No commands were added in this release.

Modified commands for 20.4.1e

No commands are modified in this release

Deprecated commands for 20.4.1e

No commands are deprecated in this release

The following commands were added, modified, or deprecated for the 20.4.1d program

New commands for 20.4.1d

- `show snmp-server status`
- `snmp-server use-vrf`

Modified commands for 20.4.1d

No commands are modified in this release

Deprecated commands for 20.4.1d

No commands are deprecated in this release

The following commands were added, modified, or deprecated for the 20.4.1c program

New commands for 20.4.1c

No commands were added in this release.

Modified commands for 20.4.1c

No commands were modified in this release.

Deprecated commands for 20.4.1c

No commands were deprecated in this release.

The following commands were added, modified, or deprecated for the 20.4.1b program

New commands for 20.4.1b

No commands were added in this release.

Modified commands for 20.4.1b

No commands were modified in this release.

Deprecated commands for 20.4.1b

No commands were deprecated in this release.

The following commands were added, modified, or deprecated for the 20.4.1a program

New commands for 20.4.1a

No commands were added in this release.

Modified commands for 20.4.1a

No commands were modified in this release.

Deprecated commands for 20.4.1a

No commands were deprecated in this release.

The following commands were added, modified, or deprecated for the 20.4.1 program

New commands for 20.4.1

- neighbor peer-dampening
- neighbor peer-dampening (peer-group)
- peer-dampening
- show grubversion
- show [ip|ipv6] bgp peer-dampened
- show onieversion
- show selinux status

- snmp-server trap
- update onie

Modified commands for 20.4.1

- dns (tpvm mode)
- interface management (tpvm mode)
- ntp (tpvm mode)
- set ip next-hop
- set ipv6 next-hop
- speed
- threshold-monitor Cpu
- threshold-monitor Memory
- tpvm download
- tpvm upgrade (tpvm mode)
- vrf-lite-capability

The following show commands were enhanced to show additional information.

- show interface ethernet
- show interface status
- show ipv6 bgp routes

Deprecated commands for 20.4.1

No commands were deprecated in this release.

Hardware Support

Supported devices and software licenses

Supported devices	Description
SLX9740-40C	Extreme SLX 9740-40C Router. Base unit with 40x100GE/40GE capable QSFP28 ports, 2 unpopulated power supply slots, 6 unpopulated fan slots
SLX9740-40C-AC-F	Extreme SLX 9740-40C-AC-F Router. Base unit with 40x100GE/40GE capable QSFP28 ports, 2 AC power supplies, 6 fan modules
SLX9740-80C	Extreme SLX 9740-80C Router. Base unit with 80x100GE/40GE capable QSFP28 ports, 4 unpopulated power supply slots, 4 unpopulated fan slots
SLX9740-80C-AC-F	Extreme SLX 9740-80C-AC-F Router. Base unit with 80x100GE/40GE capable QSFP28 ports, 4AC power supplies, 4 fan modules
SLX9740-ADV-LIC-P	Advanced Feature License for MPLS, BGP-EVPN and Integrated Application Hosting for Extreme SLX 9740
SLX9150-48Y-8C	Extreme SLX 9150-48Y Switch with two empty power supply slots, six empty fan slots. Supports 48x25GE/10GE/1GE + 8x100GE/40GE.
SLX9150-48Y-8C-AC-F	Extreme SLX 9150-48Y Switch AC with Front to Back Airflow. Supports 48x25GE/10GE/1GE + 8x100GE/40GE with dual power supplies, six fans.
SLX9150-48Y-8C-AC-R	Extreme SLX 9150-48Y Switch AC with Back to Front Airflow. Supports 48x25GE/10GE/1GE + 8x100GE/40GE with dual power supplies, six fans.
SLX9150-48XT-6C	Extreme SLX 9150-48XT 10GBaseT Switch with two empty power supply slots, six empty fan slots, Supports 48x10GE/1GE + 6x100GE/40GE.
SLX9150-48XT-6C-AC-F	Extreme SLX 9150-48XT 10GBaseT Switch AC with Front to Back Airflow, Supports 48x10GE/1GE + 6x100GE/40GE with dual power supplies, six fans.
SLX9150-48XT-6C-AC-R	Extreme SLX 9150-48XT 10GBaseT Switch AC with Back to Front Airflow, Supports 48x10GE/1GE + 6x100GE/40GE with dual power supplies, six fans.
SLX9150-ADV-LIC-P	SLX 9150 Advanced Feature License for GuestVM, Analytics Path, PTP, BGP-EVPN.
SLX9250-32C	SLX 9250-32C Switch with two empty power supply slots, six empty fan slots. Supports 32x100/40GE.
SLX9250-32C-AC-F	SLX 9250-32C Switch AC with Front to Back Airflow. Supports 32x100GE/40GE with dual power supplies, six fans.
SLX9250-32C-AC-R	SLX 9250-32C Switch AC with Back to Front Airflow. Supports 32x100GE/40GE with dual power supplies, six fans.
SLX9250-ADV-LIC-P	SLX 9250 Advanced Feature License for GuestVM, Analytics Path, BGP-EVPN.
BR-SLX-9540-48S-AC-R	SLX 9540-48S Switch AC with Back to Front airflow (Non-port Side to port side airflow). Supports 48x10GE/1GE + 6x100GE/40GE. (1+1) redundant power supplies and (4+1) redundant fans included.
BR-SLX-9540-48S-AC-F	SLX 9540-48S Switch AC with Front to Back airflow (Port-side to non-port side airflow). Supports 48x10GE/1GE + 6x100GE/40GE. (1+1) redundant power supplies and (4+1) redundant fans included.
BR-SLX-9540-24S-DC-R	SLX 9540-24S Switch DC with Back to Front airflow (Non-port Side to port side airflow). Supports 24x10GE/1GE + 24x1GE ports.

Supported devices	Description
BR-SLX-9540-24S-DC-F	SLX 9540-24S Switch DC with Front to Back airflow (Port-side to non-port side airflow). Supports 24x10GE/1GE + 24x1GE ports.
BR-SLX-9540-24S-AC-R	SLX 9540-24S Switch AC with Back to Front airflow (Non-port Side to port side airflow). Supports 24x10GE/1GE + 24x1GE ports.
BR-SLX-9540-24S-AC-F	SLX 9540-24S Switch AC with Front to Back airflow (Port-side to non-port side airflow). Supports 24x10GE/1GE + 24x1GE ports.
BR-SLX-9540-48S-DC-R	SLX 9540-48S Switch DC with Back to Front airflow (Non-port Side to port side airflow). Supports 48x10GE/1GE + 6x100GE/40GE. (1+1) redundant power supplies and (4+1) redundant fans included.
BR-SLX-9540-48S-DC-F	SLX 9540-48S Switch DC with Front to Back airflow (Port-side to non-port side airflow). Supports 48x10GE/1GE + 6x100GE/40GE. (1+1) redundant power supplies and (4+1) redundant fans included.
BR-SLX-9540-24S-COD-P	Upgrade 24x1GE to 24x10GE/1GE for SLX 9540
BR-SLX-9540-ADV-LIC-P	Advanced Feature License for SLX 9540
EN-SLX-9640-24S	Extreme SLX 9640-24S Router. Supports 24x10GE/1GE + 4x100GE/40GE. (24S+4C sku no Power supplies or Fans)
EN-SLX-9640-24S-12C	Extreme SLX 9640-24S Router. Supports 24x10GE/1GE + 12x100GE/40GE. (All ports 24S+12C sku with no Power supplies or Fans)
EN-SLX-9640-24S-AC-F	Extreme SLX 9640-24S Router AC with Front to Back airflow. Supports 24x10GE/1GE + 4x100GE/40GE.(1 Power supply 6 Fans)
EN-SLX-9640-24S-12C-AC-F	Extreme SLX 9640-24S Router AC with Front to Back airflow. Supports 24x10GE/1GE + 12x100GE/40GE.(1 Power supply 6 Fans)
EN-SLX-9640-4C-POD-P	Extreme SLX 9640 Ports on Demand License for 4 ports of 100GE/40GE Uplinks
EN-SLX-9640-ADV-LIC-P	Extreme SLX 9640 Advanced Feature License
8720-32C	Extreme 8720-32C Switch with two empty power supply slots, six empty fan slots and a 4-post rack mount kit, Supports 32x100/40GE
8720-32C-AC-F	Extreme 8720-32C Switch with front to back airflow, Supports 32x100/40G with two AC power supplies, six fans and a 4-post rack mount kit
8720-32C-AC-R	Extreme 8720-32C Switch with back to front airflow, Supports 32x100/40G with dual AC power supplies, six fans and a 4-post rack mount kit
8720-32C-DC-F	Extreme 8720-32C Switch with front to back airflow, Supports 32x100/40G with dual DC power supplies, six fans and a 4-post rack mount kit
8720-32C-DC-R	Extreme 8720-32C Switch with back to front airflow, Supports 32x100/40G with dual DC power supplies, six fans and a 4-post rack mount kit
8000-PRMR-LIC-P	Extreme 8000 Premier Feature License (includes Integrated Application Hosting)
8520-48Y-8C	Extreme 8520-48Y Switch with two empty power supply slots, six empty fan slots; Ships with one 4-post rack mount kit; Supports 48x25/10/1G and 8x100/40G ports
8520-48Y-8C-AC-F	Extreme 8520-48Y Switch with front-back airflow; Ships with two AC power supplies, six fans, one 4-post rack mount kit; Supports 48x25/10/1G and 8x100/40G ports

Supported devices	Description
8520-48Y-8C-AC-R	Extreme 8520-48Y Switch with back-front airflow; Ships with two AC power supplies, six fans, one 4-post rack mount kit; Supports 48x25/10/1G and 8x100/40G ports
8520-48Y-8C-DC-F	Extreme 8520-48Y Switch with front-back airflow; Ships with two DC power supplies, six fans, one 4-post rack mount kit; Supports 48x25/10/1G and 8x100/40G ports
8520-48Y-8C-DC-R	Extreme 8520-48Y Switch with back-front airflow; Ships with two DC power supplies, six fans, one 4-post rack mount kit; Supports 48x25/10/1G and 8x100/40G ports
8520-48XT-6C	Extreme 8520-48XT Switch with two empty power supply slots, six empty fan slots; Ships with one 4-post rack mount kit; Supports 48x10/1G copper ports and 6x100/40G fiber ports
8520-48XT-6C-AC-F	Extreme 8520-48XT Switch with front-back airflow; Ships with two AC power supplies, six fans, one 4-post rack mount kit; Supports 48x10/1G copper ports and 6x100/40G fiber ports
8520-48XT-6C-AC-R	Extreme 8520-48XT Switch with back-front airflow; Ships with two AC power supplies, six fans, one 4-post rack mount kit; Supports 48x10/1G copper ports and 6x100/40G fiber ports
8520-48XT-6C-DC-F	Extreme 8520-48XT Switch with front-back airflow; Ships with two DC power supplies, six fans, one 4-post rack mount kit; Supports 48x10/1G copper ports and 6x100/40G fiber ports
8520-48XT-6C-DC-R	Extreme 8520-48XT Switch with back-front airflow; Ships with two DC power supplies, six fans, one 4-post rack mount kit; Supports 48x10/1G copper ports and 6x100/40G fiber ports
8000-PRMR-LIC-P	Extreme 8000 Premier Feature License (includes Integrated Application Hosting)

Supported power supplies, fans, and rack mount kits

XN-ACPWR-1600W-F	SLX 9740 Fixed AC 1600W Power Supply Front to Back. Power cords not included.
XN-ACPWR-1600W-R	SLX 9740 Fixed AC 1600W Power Supply Back to Front. Power cords not included.
XN-DCPWR-1600W-F	SLX 9740 Fixed DC 1600W Power Supply Front to Back. Power cords not included.
XN-ACPWR-1600W-F	SLX 9740 Fixed AC 1600W Power Supply Front to Back. Power cords not included.
XN-FAN-003-F	SLX 9740 FAN Front to Back airflow for SLX9740-40C
XN-FAN-003-R	SLX 9740 FAN Back to Front airflow for SLX9740-40C
XN-FAN-004-F	SLX 9740 FAN Front to Back airflow for SLX9740-80C
XN-FAN-004-R	SLX 9740 FAN Back to Front airflow for SLX9740-80C
XN-4P-RKMT299	2-Post Rail Kit for SLX 9740-40C
XN-2P-RKMT300	2-Post Rail Kit for SLX 9740-80C
XN-4P-RKMT301	4-Post Rail Kit for SLX 9740-80C
XN-4P-RKMT302	4-Post Rail Kit for SLX 9740-40C
XN-ACPWR-750W-F	AC 750W PSU, Front to Back Airflow supported on VSP 7400, SLX 9150, SLX 9250, X695, Extreme 8720, Extreme 8520
XN-ACPWR-750W-R	AC 750W PSU, Back to Front Airflow supported on VSP 7400, SLX 9150, SLX 9250, X695, Extreme 8720, Extreme 8520
XN-DCPWR-750W-F	DC 750W PSU, Front to Back Airflow supported on VSP 7400, SLX 9150, SLX 9250, X695, Extreme 8720, Extreme 8520
XN-DCPWR-750W-R	DC 750W PSU, Back to Front Airflow supported on VSP 7400, SLX 9150, SLX 9250, X695, Extreme 8720, Extreme 8520
XN-FAN-001-F	Front to back Fan for use in VSP 7400, SLX 9150, SLX 9250, X695, Extreme 8720, Extreme 8520
XN-FAN-001-R	Back to Front Fan for use in VSP 7400, SLX 9150, SLX 9250, X695, Extreme 8720, Extreme 8520
XN-4P-RKMT298	Four post rack mount rail kit supported on VSP 7400, SLX 9150, SLX 9250, X695, Extreme 8720, Extreme 8520
XN-2P-RKMT299	Two post rack mount rail kit supported on VSP 7400, SLX 9150, SLX 9250, X695, Extreme 8720, Extreme 8520

Supported Optics and Cables

For a complete list of all supported optics, see **Extreme Optics** at <https://optics.extremenetworks.com/>.

Supported FEC modes

SLX 9250 and Extreme 8720

Port Type	Media Type	Default FEC Mode	Supported FEC Modes
100G	Passive DAC	RS-FEC	RS-FEC Disabled
100G	SR4	RS-FEC	RS-FEC Disabled
100G	LR4	Disabled	RS-FEC Disabled
25G	Breakout DAC SR	Auto-Neg	RS-FEC FC-FEC Auto-Neg Disabled
25G	Breakout SR4	FC-FEC	RS-FEC FC-FEC Disabled

SLX 9740

Port Type	Media Type	Default FEC Mode	Supported FEC Modes
100G	Passive DAC	RS-FEC	RS-FEC Disabled
100G	SR4	RS-FEC	RS-FEC Disabled
100G	LR4	Disabled	RS-FEC Disabled
25G	Breakout DAC SR	FC-FEC	FC-FEC RS-FEC Disabled
25G	Breakout SR4	FC-FEC	FC-FEC RS-FEC Disabled

SLX 9150 and Extreme 8520

Port Type	Media Type	Default FEC Mode	Supported FEC Modes
100G	Passive DAC	RS-FEC	RS-FEC Disabled

Port Type	Media Type	Default FEC Mode	Supported FEC Modes
100G	SR4	RS-FEC	RS-FEC Disabled
100G	LR4	Disabled	RS-FEC Disabled
25G(Native)	DAC	Auto-Neg	RS-FEC FC-FEC Auto-Neg Disabled
25G(Native)	SFP	FC-FEC	RS-FEC FC-FEC Disabled

SLX 9540 and SLX 9640

Port Type	Media Type	Default FEC Mode	Supported FEC Modes
100G	Passive DAC	RS-FEC	RS-FEC Disabled
100G	SR4	RS-FEC	RS-FEC Disabled
100G	LR4	Disabled	RS-FEC Disabled

Software Download and Upgrade

For more information about the various methods of upgrading to SLX-OS 20.4.1e see the *Extreme SLX-OS Software Upgrade Guide*.

Image files

Download the following images from www.extremenetworks.com.

Image file name	Description
SLX-OS_20.4.1e.tar.gz	SLX-OS 20.4.1e software
SLX-OS_20.4.1e_mibs.tar.gz	SLX-OS 20.4.1e MIBS
SLX-OS_20.4.1e.md5	SLX-OS 20.4.1e md5 checksum
SLX-OS_20.4.1e-digests.tar.gz	SLX-OS 20.4.1e sha checksum
SLX-OS_20.4.1e-releasenotes.pdf	Release Notes

Notes:

Upgrade to 20.3.x from earlier releases requires “fullinstall” due to change in glibc for all platforms.

To / From	20.2.3x	20.3.2/a/b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/ac	20.4.1/a/b/c /d	20.4.1e
20.2.3(MFG)	Use the normal Firmware Download / coldboot	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.2.3ab	Use the normal Firmware Download / coldboot	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.2.3x	NA	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.3.2/a/b	Use fullinstall	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.
20.3.2c/d	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.

To / From	20.2.3x	20.3.2/a/b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/ac	20.4.1/a/b/c /d	20.4.1e
20.3.3	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	NA	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot
20.3.4	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	NA	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot
20.3.4a/ac	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot
20.4.1/a/b/c /d	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot
20.4.1e	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	NA

To From	20.2.2x	20.2.3x	20.3.1	20.3.2/a/ b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/a c	20.4.1/a/ b/c/d	20.4.1e
20.2.1a	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.2.2x	Use the normal Firmware Download / coldboot*	Use the normal Firmware Download / coldboot	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.2.3x	Use the normal Firmware Download / coldboot	NA	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.3.1	Use fullinstall	Use fullinstall	NA	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.

To From	20.2.2x	20.2.3x	20.3.1	20.3.2/a/ b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/a c	20.4.1/a/ b/c/d	20.4.1e
20.3.2/a/ b	Use fullinstall	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.
20.3.2c/d	Use fullinstall	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.	Use the normal Firmware Download / coldboot. For downgrade use fullinstall.
20.3.3	Use fullinstall	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	NA	Use the normal Firmware Download / coldboot.	Use the normal Firmware Download / coldboot.	Use the normal Firmware Download / coldboot.	Use the normal Firmware Download / coldboot.
20.3.4	Use fullinstall	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	NA	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot.

To / From	20.2.2x	20.2.3x	20.3.1	20.3.2/a/b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/a/c	20.4.1/a/b/c/d	20.4.1e
20.3.4a/a/c	Use fullinstall	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot.	Use the normal Firmware Download / coldboot.
20.4.1/a/b/c/d	Use fullinstall	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot.
20.4.1e	Use fullinstall	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot.	Use the normal Firmware Download / coldboot.	NA

*within the patches

Note:

For SLX-9740, downgrade to any 20.2.2x version needs to be done in two steps, with an intermediate step for downgrading to 20.2.2c and then to 20.2.x from 20.2.3x or higher.

This restriction is not applicable for upgrade/downgrade between 20.2.3x and 20.3.x releases.

SLX 9540 and SLX 9640

To From	20.2.2a/b/c	20.2.3a to 20.2.3h	20.3.1	20.3.2/a/b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/a/c	20.4.1/a/b/c/d	20.4.1e
18r.2.00, 18r.2.00a/b/c	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.2.2a/b/c using fullinstall. For SLX 9640: 1. First upgrade to 18r.2.00d via fullinstall. 2. Then upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to targeted 20.2.3 version using fullinstall. For SLX 9640: 1. First upgrade to 18r.2.00d via fullinstall. 2. Then upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.1 version using fullinstall. For SLX 9640: 1. First upgrade to 18r.2.00d via fullinstall. 2. Then upgrade to 20.1.2h using fullinstall. 3. Then upgrade	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to targeted 20.3.2 version using fullinstall. For SLX 9640: 1. First upgrade to 18r.2.00d via fullinstall. 2. Then upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.2d version using fullinstall. For SLX 9640: 1. First upgrade to 18r.2.00d via fullinstall. 2. Then upgrade to 20.1.2h using fullinstall. 3. Then upgrade	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.3 version using fullinstall. For SLX 9640: 1. First upgrade to 18r.2.00d via fullinstall. 2. Then upgrade to 20.1.2h using fullinstall. 3. Then upgrade	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.4 version using fullinstall. For SLX 9640: 1. First upgrade to 18r.2.00d via fullinstall. 2. Then upgrade to 20.1.2h using fullinstall. 3. Then upgrade	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.4a version using fullinstall. For SLX 9640: 1. First upgrade to 18r.2.00d via fullinstall. 2. Then upgrade to 20.1.2h using fullinstall. 3. Then upgrade	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.4.1/a/b/c version using fullinstall. For SLX 9640: 1. First upgrade to 18r.2.00d via fullinstall. 2. Then upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.4.1d version using fullinstall. For SLX 9640: 1. First upgrade to 18r.2.00d via fullinstall. 2. Then upgrade to 20.1.2h using fullinstall. 3. Then upgrade

To From	20.2.2a/b/c	20.2.3a to 20.2.3h	20.3.1	20.3.2/a/b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/a/c	20.4.1/a/b/c/d	20.4.1e
	3. Then upgrade to 20.2.2a/b/c using fullinstall.	3. Then upgrade to targeted 20.2.3 version using fullinstall.	to 20.3.1 version using fullinstall.	3. Then upgrade to targeted 20.3.2 version using fullinstall.	to 20.3.2d version using fullinstall.	to 20.3.3 version using fullinstall.	to 20.3.4 version using fullinstall.	to 20.3.4a version using fullinstall.	3. Then upgrade to 20.4.1/a/b/c version using fullinstall.	to 20.4.1d version using fullinstall.
18r.2.00d	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.2.2a/b/c using fullinstall. For SLX 9640: 1. First upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to targeted 20.2.3 version using fullinstall. For SLX 9640: 1. First upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.1 version using fullinstall. For SLX 9640: 1. First upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to targeted 20.3.2 version using fullinstall. For SLX 9640: 1. First upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.2d version using fullinstall. For SLX 9640: 1. First upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.3 version using fullinstall. For SLX 9640: 1. First upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.4 version using fullinstall. For SLX 9640: 1. First upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.4a version using fullinstall. For SLX 9640: 1. First upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.4.1/a/b/c version using fullinstall. For SLX 9640: 1. First upgrade to 20.1.2h using fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.4.1d version using fullinstall. For SLX 9640: 1. First upgrade to 20.1.2h using fullinstall.

To From	20.2.2a/b/c	20.2.3a to 20.2.3h	20.3.1	20.3.2/a/b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/a/c	20.4.1/a/b/c/d	20.4.1e
	2. Then upgrade to 20.2.2a/b/c using fullinstall.	using fullinstall. 2. Then upgrade to targeted 20.2.3 version using fullinstall.	2. Then upgrade to 20.3.1 version using fullinstall.	using fullinstall. 2. Then upgrade to targeted 20.3.2 version using fullinstall.	2. Then upgrade to 20.3.2d version using fullinstall.	2. Then upgrade to 20.3.3 version using fullinstall.	2. Then upgrade to 20.3.4 version using fullinstall.	2. Then upgrade to 20.3.4a version using fullinstall.	2. Then upgrade to 20.4.1/a/b/c version using fullinstall.	2. Then upgrade to 20.4.1d version using fullinstall.
20.1.1	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.2.2a/b/c using fullinstall. For SLX 9640: Use fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to targeted 20.2.3 version using fullinstall. For SLX 9640: Use fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.1 version using fullinstall. For SLX 9640: Use fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to targeted 20.3.2 version using fullinstall. For SLX 9640: Use fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.2d version using fullinstall. For SLX 9640: Use fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.3 version using fullinstall. For SLX 9640: Use fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.4 version using fullinstall. For SLX 9640: Use fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.3.4a version using fullinstall. For SLX 9640: Use fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.4.1/a/b/c version using fullinstall. For SLX 9640: Use fullinstall.	For SLX 9540 : 1. First upgrade to 20.1.2h using fullinstall. 2. Then upgrade to 20.4.1d version using fullinstall. For SLX 9640: Use fullinstall.

To From	20.2.2a/b/c	20.2.3a to 20.2.3h	20.3.1	20.3.2/a/b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/a/c	20.4.1/a/b/c/d	20.4.1e
20.1.2e, g	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.2.1a	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.2.2x	NA	Use the normal Firmware Download / coldboot	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.2.3x	Use the normal Firmware Download / coldboot	NA	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.3.1	Use fullinstall	Use fullinstall	NA	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot . For downgrade use fullinstall.	Use the normal Firmware Download / coldboot . For downgrade use fullinstall.	Use the normal Firmware Download / coldboot . For downgrade use fullinstall.	Use the normal Firmware Download / coldboot . For downgrade use fullinstall.	Use the normal Firmware Download / coldboot . For downgrade use fullinstall.	Use the normal Firmware Download / coldboot . For downgrade use fullinstall.
20.3.2/a/b	Use fullinstall	Use fullinstall	Use the normal Firmware	Use the normal Firmware	Use the normal Firmware	Use the normal Firmware	Use the normal Firmware	Use the normal Firmware	Use the normal Firmware	Use the normal Firmware

To From	20.2.2a/b /c	20.2.3a to 20.2.3h	20.3.1	20.3.2/a/ b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/a c	20.4.1/a/ b/c/d	20.4.1e
			Download / coldboot	Download / coldboot	Download / coldboot . For downgrad e use fullinstall.	Download / coldboot . For downgrad e use fullinstall.	Download / coldboot . For downgrad e use fullinstall.	Download / coldboot . For downgrad e use fullinstall.	Download / coldboot . For downgrad e use fullinstall.	Download / coldboot . For downgrad e use fullinstall.
20.3.2c/d	Use fullins tall	Use fullins tall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot . For downgrad e use fullinstall.	Use the normal Firmware Download / coldboot . For downgrad e use fullinstall.	Use the normal Firmware Download / coldboot . For downgrad e use fullinstall.	Use the normal Firmware Download / coldboot . For downgrad e use fullinstall.	Use the normal Firmware Download / coldboot . For downgrad e use fullinstall.
20.3.3	Use fullins tall	Use fullins tall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	NA	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot
20.3.4	Use fullinstall	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	NA	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot
20.3.4a/a c	Use fullinstall	Use fullins tall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot
20.4.1/a/ b/c/d	Use fullinstall	Use fullins tall	Use the normal	Use the normal	Use the normal	Use the normal	Use the normal	Use the normal	Use the normal	Use the normal

To / From	20.2.2a/b/c	20.2.3a to 20.2.3h	20.3.1	20.3.2/a/b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/a/c	20.4.1/a/b/c/d	20.4.1e
			Firmware Download / coldboot	Firmware Download / coldboot	Firmware Download / coldboot	Firmware Download / coldboot	Firmware Download / coldboot	Firmware Download / coldboot	Firmware Download / coldboot	Firmware Download / coldboot
20.4.1e	Use fullinstall	Use fullinstall	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	NA

Notes:

- When upgrading from the 18r.1.00x and 18r.2.00a and earlier patches, upgrade first to 18r.2.00bx and then to 20.2.2x, which is a two-step upgrade procedure.
- The MCT upgrade procedure from 18r.2.00bc to 20.2.x is detailed in the *Extreme SLX-OS Software Upgrade Guide*.
- Because SLX 9540 is a bare metal device, use the "fullinstall" option to migrate between the SLX-OS 20.2.2x and SLX-OS 20.1.x releases.
- Because SLX9540 is moved to the bare metal mode in 20.2.1, use 'fullinstall' when migrating between SLX-OS 20.2.2x and SLX-OS 2.1.x releases.
- Upgrade to 20.3.x from earlier releases requires "fullinstall" due to change in glibc.
- Downgrading from 20.3.x/20.2.2x/20.2.3x to 20.1.1 requires 'fullinstall' option for all platforms due to a change in glibc
- Downgrading from 20.3.x/20.2.2x/20.2.3x to 20.1.1 may not require a 2-step procedure.

SLX 9150 and SLX 9250

To / From	20.2.2x	20.2.3x	20.3.1	20.3.2/a/b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/a/c	20.4.1/a/b/c/d	20.4.1e
20.1.1	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall

To	20.2.2x	20.2.3x	20.3.1	20.3.2/a/ b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/a c	20.4.1/a/ b/c/d	20.4.1e
From										
20.1.2x	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.2.1x	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.2.2x	Use the normal firmware download / coldboot *	Use the normal firmware download / coldboot	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.2.3x	Use the normal firmware download / coldboot	NA	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall	Use fullinstall
20.3.1	Use fullinstall	Use fullinstall	NA	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot
20.3.2/a/ b	Use fullinstall	Use fullinstall	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot

To / From	20.2.2x	20.2.3x	20.3.1	20.3.2/a/b	20.3.2c/d	20.3.3	20.3.4	20.3.4a/a/c	20.4.1/a/b/c/d	20.4.1e
20.3.2c/d	Use fullinstall	Use fullinstall	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot
20.3.3	Use fullinstall	Use fullinstall	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	NA	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot
20.3.4	Use fullinstall	Use fullinstall	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	NA	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot
20.3.4a/a/c	Use fullinstall	Use fullinstall	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot
20.4.1/a/b/c/d	Use fullinstall	Use fullinstall	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot
20.4.1e	Use fullinstall	Use fullinstall	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	Use the normal firmware download / coldboot	NA

*within the patches

Extreme 8520

To From	20.3.3	20.3.4	20.3.4a/ac	20.4.1/a	20.4.1b/c/d	20.4.1e
20.3.3	NA	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot
20.3.4	Use the normal Firmware Download / coldboot	NA	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot
20.3.4a/ac	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	NA	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot
20.4.1/a	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	NA	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot
20.4.1b/c/d	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot
20.4.1e	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	Use the normal Firmware Download / coldboot	NA

SLX TPVM Support Matrix for SLX 9150, SLX 9250, Extreme 8520, and Extreme 8720

SLX Build	TPVM – Fresh Install Supported	EFA
20.2.2	TPVM-4.1.1	EFA-2.3
20.2.2a	TPVM-4.1.2	EFA-2.3.x
20.2.2b	TPVM-4.1.2	EFA-2.3.x
20.2.3	TPVM-4.2.2	EFA-2.4.x, EFA-2.3.x
20.2.3a	TPVM-4.2.3	EFA-2.4.x, EFA-2.3.x, EFA-2.5x *
20.3.1	TPVM-4.2.4	EFA-2.4.x
20.3.2/a/b/c	TPVM-4.2.5	EFA-2.4.x, EFA-2.5x
20.3.2d	TPVM-4.3.0	EFA-2.4.x, EFA-2.5x
20.3.3	TPVM-4.2.5	EFA-2.5x
20.3.4	TPVM-4.4.0	EFA-2.5x
20.3.4a	TPVM-4.4.0	EFA-2.6.0
20.3.4ac	TPVM-4.4.0	EFA-2.6.1
20.4.1	TPVM-4.5.0	EFA-2.7.0
20.4.1a	TPVM-4.5.0	EFA-2.7.0
20.4.1b	TPVM-4.5.1	EFA-2.7.1
20.4.1c	TPVM-4.5.1	EFA-2.7.2
20.4.1d	TPVM-4.5.1	EFA-2.7.2
20.4.1e	TPVM-4.5.1 and later	EFA-2.7.2 and later

* EFA-2.4.x feature parity in 20.2.3d

Note:

Extreme 8720 and Extreme 8520 are supported from 20.3.3 onwards.

Upgrade and Downgrade considerations for Threshold Monitor configuration:

Downgrade Considerations:

1. If configured value for Cpu "limit" exceeds valid range in older release [0-80] then downgrade will be blocked with error. User can reconfigure Cpu "limit" in the range [0-80] and downgrade.
2. If configured value for Memory "high-limit" exceeds valid range in older release [0-80] or if it is less than the default value of "limit" in older release [60], then downgrade will be blocked with error. User can reconfigure Memory "high-limit" in the range [60-80] and downgrade.
3. If the startup file has "actions" configured as "snmp" or "all", then config replay process triggered in firmware full-install downgrade, will lead all the corresponding threshold-monitor CLI parameters, such as poll, retry, to reset to respective default values.

Upgrade Considerations:

1. If the startup file has “Memory limit and /or low-limit” configured, then config replay process triggered in firmware full-install downgrade, will lead all the corresponding threshold-monitor CLI parameters, such as poll, retry, to reset to respective default values.

Upgrading the TPVM without configuration persistence (Legacy upgrade method)

Upgrading TPVM from 4.0.x or 4.1.x to 4.2.x, 4.3.x, 4.4.x, 4.5.x

Consider the following when upgrading TPVM from 20.1.2x , 20.2.2/x to 20.2.3x, 20.3.1 to 20.3.2x, 20.3.3, 20.3.4x

- SLX-OS 20.3.x, 20.2.3/x has TPVM 4.2.x. SLX-OS 20.1.2x variants have TPVM 4.0.x, which is based on Ubuntu18.
- To upgrade from TPVM 4.0 to latest, do the following:
 - Upgrade to SLX-OS 20.3.x, 20.2.3/x while the existing TPVM installation continues to run
 - Remove the existing TPVM using the **tpvm stop** and **tpvm uninstall** commands.
 - Copy the new *tpvm-4.x.x-0.amd64.deb* to */tftpboot/SWBD2900* on the SLX device.
 - Install TPVM 4.x.x using the **tpvm install** or **tpvm deploy** command.
 - Note that any additional TPVM disks, including vdb (implicitly created by TPVM 4.0.x or 4.1.x), are preserved with data during the previous steps.
 - If you need to remove the disks and start clean, then use the **tpvm uninstall force** command in place of **tpvm uninstall** in these steps. Alternatively, you can use **tpvm disk remove name <disk name>** to remove each additional disk manually. For example, `tpvm disk remove name vdb`.
- To perform patch upgrade from TPVM 4.5.x to latest, do the following:
 - Upgrade to SLX-OS 20.4.x while the existing TPVM 4.5.x installation continues to run
 - Copy the new *tpvm_inc_upg-4.5.X-X.amd64.deb* to */tftpboot/SWBD2900* directory on the SLX device.
 - Install latest TPVM 4.5.x using **tpvm upgrade incremental** command

Consider the following when you upgrade TPVM from releases earlier than SLX-OS 20.2.1 to SLX-OS 20.2.x:

- During startup, the latest TPVM creates an additional TPVM disk (named vdb) and creates an ext4 partition inside it (named vdb1).
- This additional disk partition is mounted at */apps* inside TPVM.
- The disk uses all the free space available and reserved for TPVM (platform specific) TPVM disk quota.
- If you are running an older TPVM and have the additional TPVM disks already created, it is recommended and as a best practice to make a backup and then delete the old disks. Use the **tpvm disk remove name <disk name>** command to remove the disk, which requires TPVM to be started if not already running.
- Uninstall the older TPVM using the **tpvm stop** and **tpvm uninstall** command.
- Install the new TPVM package using the **tpvm install** or **tpvm deploy** command.

Alternatively, after SLX has been upgraded, you can use one command, **tpvm uninstall force**, to uninstall the TPVM and delete all the disks in the TPVM disk pool.

Important: The **tpvm uninstall force** process is destructive and irreversible, causing all TPVM data to be lost. The process works only if the TPVM is installed on the system.

Entire TPVM Data is automatically backed up in SLX while doing “**tpvm stop**” and restored during the next “**tpvm start**”. However, only “/apps” partition and its data are preserved during “tpvm stop, uninstall” & “tpvm install”. User installed applications in TPVM are not preserved. During TPVM upgrade, it is advised to take EFA data backup from TPVM using “**efa system backup**” and transfer the backup file outside TPVM to be completely safe. EFA release note document has a section for TPVM upgrade scenario and entire steps are mentioned in that document.

“When EFA is installed on TPVM, “tpvm stop” followed by “uninstall” automatically takes only EFA database backup and not a backup of EFA installation.”

Notes:

Security updates are added to the TPVM image and also to the separate Debian file used for incremental TPVM update. There is a change in size of the main TPVM image to ~2.9 GB and the TPVM incremental update Debian file size is ~0.5 GB. These TPVM packages contain Ubuntu security patches available up to May 09, 2022. You must have at least 1GB of free space on the switch before proceeding with the `tpvm upgrade incremental` command

VDB disk size for EFA has changed to 40 GB to accommodate storage for snapshot and the remaining space is considered as reserved space, for the new TPVM installation.

Upgrading the TPVM with configuration persistence – Recommended method

Consider the following when upgrading TPVM from 20.1.2x , 20.2.2/x, 20.3.x to 20.3.2x, 20.3.3, 20.3.4x

1. SLX-OS old version with tpvm instance installed/deployed and few related config may be set.
2. SLX-OS upgrade done vide `firmware download` CLI command.
3. Across SLX-OS reboots, old TPVM too shall reboot if auto-boot config was there, else shall be there in installed state.
 - a. `tpvm stop`
 - b. `tpvm uninstall`
 - i. (or) `tpvm uninstall force` – if you plan to delete disk vdb (i.e. the TPVM /apps partition).
 - ii. Note:
 1. New mode like old mode, create disk vdb (/apps) by default upon first install/deploy or reuse previously existing partition.
 2. Currently the new mode does not support new disk creation. The **tpvm disk add** command can be used.
4. As simple example for new mode of deploying TPVM:
 - a. Copy new TPVM debian Image under /tftboot/SWBD2900. Only one file should be there and no subfolder should be present/created within this folder.
 - b. Deploy TPVM in Config Mode:

```
SLX # config terminal
```

```

SLX (config)# tpvm TPVM

SLX (config-tpvm-TPVM) # deploy
SLX (config-tpvm-TPVM) # end

```

Above will install and start any TPVM image kept under /tftpboot/SWBD2900.

- c. Deploy TPVM with some configuration and later update any runtime configuration:

```

SLX # config terminal

SLX (config)# tpvm TPVM

SLX (config-tpvm-TPVM) # password newpassword
SLX (config-tpvm-TPVM) # interface management ip 10.25.24.21/24
SLX (config-tpvm-TPVM) # auto-boot
SLX (config-tpvm-TPVM) # hostname newhostname
SLX (config-tpvm-TPVM) # timezone Europe/Stockholm
SLX (config-tpvm-TPVM) # deploy
SLX (config-tpvm-TPVM) # end

SLX # config terminal

SLX (config)# tpvm TPVM

SLX (config-tpvm-TPVM) # hostname oldhostname
SLX (config-tpvm-TPVM) # no timezone

SLX (config-tpvm-TPVM) # exit

```

5. Note:

- a. Now, say, if the **tpvm config hostname xyz** command is used. It will still work and apply on TPVM instance. But this configuration shall not be persisted in SLX Database and will become inconsistent. Same is true for any other configuration done in old way.
- b. As in above example, password, management configuration should always be set before deploy. If required later, refer User Guide and use `tpvm stop`, `start` for such update/maintenance reason.
- c. If **tpvm unstage force** command is used, then you will need to perform a **no deploy** and **deploy** in the new mode.

For more information on configuring TPVM Configuration Persistence, refer the 'Management Configuration Guide' for this version.

TPVM Migration

Upgrading the SLXOS to 20.3.2x, 20.3.3, 20.3.4x results in the creation of TPVM entries in SLX running-config implicitly (This happens when upgrading TPVM from SLX-OS 20.1.2x, SLX-OS 20.2.2/x, SLX-OS 20.3.x to SLX-OS 20.3.2x, 20.3.3, 20.3.4x)

Consider the following when upgrading TPVM from SLX-OS 20.1.2x, SLX-OS 20.2.2/x, SLX-OS 20.3.x to SLX-OS 20.3.2x, 20.3.3, 20.3.4x

- a. SLX-OS old version with `tpvm` instance installed/deployed and few related config may be set in legacy exec CLI method
- b. SLX-OS upgrade done with `“firmware download”` CLI command.

- c. Across SLX-OS reboot, TPVM entries are created in SLX running-config implicitly as part of the TPVM migration feature
- d. Check the configuration are persisted in TPVM using the CLI “show running configuration tpvm”
- e. For TPVM upgrade to the latest version use command “tpvm upgrade ...”
- f. For TPVM upgrade incremental to the latest patch use command “tpvm upgrade incremental ...”

Limitations and Restrictions

Copy flash to startup and reload with TPVM

setNTPServer and setLDAPServer statuses are reported as failed in the output of the `show tpvm status-history`. After reload, TPVM is expected to be running when the above configurations are re-applied. When the TPVM is not running and the NTP and LDAP configurations are applied, these errors are seen. This is a limitation as reapplying NTP and LDAP configurations are not supported.

You need to have minimum 1GB free space on TPVM when you try to perform the security patch upgrade using the command `tpvm upgrade incremental ...`

TPVM upgrade incremental command and file support is available only from 4.5 if we try to perform the incremental upgrade from 4.4.0 to latest, the upgrade fails and ask to perform the `tpvm upgrade`.

TPVM upgrade incremental command will not be supported when you try TPVM deploy in config mode and TPVM upgrade incremental command will not support with snapshot option.

Do not use the **tpvm upgrade incremental** command to upgrade the patches with `tpvm-4.X.X-X.amd64.deb`. Use the `tpvm_inc_upg-4.X.X-X.amd64.deb` image file to perform incremental upgrades.

Similarly, do not use the `tpvm_inc_upg-4.X.X-X.amd64.deb` image file to perform full upgrade. Do not use this file to perform **tpvm deploy** in *config mode* and *option*.

TPVM Migration

The following table lists the various TPVM configurations and their migration status.

Configuration	Migration State	Notes
tpvm auto-boot	Migrated	
tpvm disk	Not Migrated	Disk configuration is not supported in the configuration mode, and therefore, not migrated.
tpvm password	Migrated	Only the old password is migrated. This is due to the password being encrypted and stored and it is not possible to know if the password was changed during the migration.
tpvm config ntp	Migrated	

Configuration	Migration State	Notes
tpvm config dns	Migrated	
tpvm config ldap	Migrated	Secure LDAP require certificates. It is assumed that certificates are already downloaded and installed. Certificates are not validated during this migration. A notification will be sent to the user to reconfigure LDAP certificate settings.
tpvm config hostname	Migrated	
tpvm config timezone	Migrated	
tpvm deploy <interface> allow-pwless	Not Migrated	This is the new default configuration and is not migrated.
tpvm deploy mgmt [dhcp static]	Migrated	
tpvm deploy insight	Not Migrated	Insight interface configuration is not supported when configuring using the Privilege Execution Mode commands.
tpvm config ldap ca-cert	Not Migrated	Configuring the TPVM LDAP ca certificate
dns primary-server ipv6_address secondary-server ipv6_address domain domain_name	Migrated	Configuring the TPVM DNS IPv6 with FQDN
ntp ipv6_address	Migrated	TPVM ntp IPV6 config
interface management ipv6 ipv6_address [gw ipv6_gw_address]	Migrated	TPVM management ip with IPV6 ip
tpvm upgrade [protocol protocol user username password <password> host IPv6_host_address directory directory filename filename]	Migrated	TPVM upgrade with IPV6 remote server config
tpvm upgrade incremental[protocol protocol user username password <password> host IPv6_host_address directory directory filename filename]	Migrated	TPVM upgrade only the patch upgrade

Configuration	Migration State	Notes
tpvm config trusted-peer	Not Migrated	All trusted-peer configurations are not migrated.

Additional information on TPVM Commands

Following list of TPVM commands under exec mode may not be supported in the future releases. The equivalent commands will continue to be available under config mode. Please refer to latest CLI documentation.

- tpvm config dns
- tpvm config hostname
- tpvm config ldap
- tpvm config ntp
- tpvm config timezone
- tpvm config trusted-peer
- tpvm auto-boot
- tpvm deploy
- tpvm password

Port macro restrictions on breakout port configuration on SLX 9740

A port macro (PM) is a port group. Each PM has 4 ports, which are contiguous. PM0 has ports 0/1-0/4, PM1 has ports 0/5-0/8, PM2 has ports 0/9-0/12, and so on.

There are 9 PMs in the SLX 9740-40C and 18 PMs in the SLX 9740-80C. Only the odd ports can be split to 4x10G or 4x25G using the breakout cables: 0/1, 0/3, 0/9, 0/11, 0/13, 0/15, 0/17, 0/19, 0/21, 0/23, 0/25, 0/27, 0/29, 0/31, 0/33, 0/35, 0/37, 0/39, 0/41, 0/43, 0/49, 0/51, 0/53, 0/55, 0/57, 0/59, 0/61, 0/63, 0/65, 0/67, 0/69, 0/71, 0/73, 0/75, 0/77, and 0/79. Breaking out these ports using the breakout cables results in 72 interfaces for the SLX 9740-40 and 144 interfaces for the SLX 9740-80C.

- Ports 5-8 and 45-48 cannot be broken up and are supported only in 100G.
- For any PM, 40G and 10G ports cannot coexist with 25G ports. The following configurations are not supported:

PM Configuration	Examples
If any port is configured as 40G or 4x10G breakout, no 4x25G breakout is allowed unless the 40G ports will be removed as part of the breakout operation.	<ul style="list-style-type: none"> • If 0/3 or 0/4 is 40G, you cannot configure 0/1 as 4x25G breakout. • If 0/1 is 4x10G breakout, you cannot configure 0/3 as 4x25G breakout. • If 0/3 is 4x10G breakout, you cannot configure 0/1 as 4x25G breakout. • If 0/1 or 0/2 is 40G, you can configure 0/1 as 4x25G breakout because 0/1 and 0/2 will be removed. • If 0/3 or 0/4 is 40G, you can configure 0/3 as 4x25G breakout because 0/3 and 0/4 will be removed.

PM Configuration	Examples
If 4x25G breakout is configured, no 40G or 4x10G.	<ul style="list-style-type: none"> • If 0/1 is configured as 4x25G breakout, you cannot configure 0/3 or 0/4 as 40G. • If 0/1 is configured as 4x25G breakout, you cannot configure 0/3 as 4x10G breakout. • If 0/3 is configured as 4x25G breakout, you cannot configure 0/1 or 0/2 as 40G. • If 0/3 is configured as 4x25G breakout, you cannot configure 0/1 as 4x10G breakout.

QoS

- PCP remarking is not supported for SLX 9740.
- Conformed and Violated counters are not supported for egress rate limiting for SLX 9740.
- Egress rate limiting in a Bridge Domain configuration is not supported for SLX 9740.
- DSCP-COS map is not work correctly for SLX 9740.

Others

- sflow sampling does not work for VLL when BUM rate limiting is applied on interface in SLX 9740
- sflow sample traffic to CPU is rate limited. You can use the **qos cpu slot** command to change the rate.
- When Resilient Hashing CLI is enabled or disabled, or the *max-path* value is changed, it may cause **BFD sessions in related VRFs** to go down. However, **BFD sessions in unrelated VRFs will not be affected.**
- Resilient Hashing feature is supported only on SLX 9150, SLX 9250, SLX 9740, Extreme 8720, and Extreme 8520. Other platforms are not supported.
- Resilient Hashing supports 32K flowset entries for Extreme 8720 and Extreme 8520.

SNMP

- Configuring an in-band port into a Management VRF requires SNMP agent reload.

Open Config Telemetry Support

- User authentication not supported.
- gNMI calls through inband interfaces not supported.
- Usage of wild cards is not supported.
- gNMI SET is not supported.
- gNMI ON CHANGE subscription is not supported.

Known Issues

Delays in traps (order of minutes) are expected with SNMP trap host config requiring DNS resolution due to SLXOS-70886.

Parent Defect ID:	SLXOS-70886	Issue ID:	SLXOS-70886
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1d
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	Traps will be received with delay of some minutes.		
Condition:	SNMP trap host configured with DNS name is causing this delay.		

Open Defects

The following software defects are open in SLX-OS 20.4.1e as of June 2023:

Parent Defect ID:	SLXOS-64538	Issue ID:	SLXOS-66860
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Other	Technology:	Other
Symptom:	RME port may be down		
Condition:	Redundant management ports on slx 9740 may not come up for certain ports in certain scenarios		
Workaround:	Reconfigure breakout cable and sh/no shut to resolve the issue		
Recovery:	Reconfigure breakout cable and sh/no shut to resolve the issue		

Parent Defect ID:	SLXOS-66994	Issue ID:	SLXOS-67851
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fa
Technology Group:	Monitoring	Technology:	Port Mirroring
Symptom:	For mirrored traffic ICMP reply packets are seen before ICM request packets.		
Condition:	When a PO is used as source interface for mirroring.		

Parent Defect ID:	SLXOS-68264	Issue ID:	SLXOS-68264
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1b
Technology Group:	Other	Technology:	Other
Symptom:	Link not coming up after reload. And if it comes up, after certain time (in secs) pld algorithm kicks in and link goes down after which it comes up again based on the configured time. This happens in loop.		
Condition:	When port link dampening CLI is configured. link-error-disable 2 120 300		

Parent Defect ID:	SLXOS-67423	Issue ID:	SLXOS-68445
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4ab
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	BGP crash and sessions went down		
Condition:	redeployment of VMs that causes MACs to be advertised		

Parent Defect ID:	SLXOS-68190	Issue ID:	SLXOS-68558
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fd
Technology Group:	IP Multicast	Technology:	MLD - Multicast Listener Discovery

Symptom:	Crash is observed in MLD module, followed by node reload and link flaps.
Condition:	The node receives MLD traffic from peer (with a large length value), on an L3 interface with no multicast configuration.

Parent Defect ID:	SLXOS-66842	Issue ID:	SLXOS-68902
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4a
Technology Group:	Security	Technology:	SSH - Secure Shell
Symptom:	Public key authentication does not work sometimes.		
Condition:	Running "ssh" exec mode command.		

Parent Defect ID:	SLXOS-68589	Issue ID:	SLXOS-69213
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00m
Technology Group:	Security	Technology:	RADIUS
Symptom:	CLI password string not masked on RADIUS accounting request and audit.log.		
Condition:	On executing authentication based CLI commands.		

Parent Defect ID:	SLXOS-68497	Issue ID:	SLXOS-69339
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Other	Technology:	Other
Symptom:	The link does not come up when the QSFP-SFPP-ADPT and 10G SR SFP+ is used in 8520-48XT ports 49,54.		
Condition:	When the optic+adapter combination QSFP-SFPP-ADPT and 10G SR SFP+ is used		

Parent Defect ID:	SLXOS-69448	Issue ID:	SLXOS-69448
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1cb
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Unexpected reload on SLX device.		
Condition:	SLX is trying to process the unexpected flow spec rules sent from the peer device.		

Parent Defect ID:	SLXOS-69844	Issue ID:	SLXOS-69866
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2ae
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	BGP daemon reload is seen in rare condition.		

Condition:	When clearing a bgp specific route.
-------------------	-------------------------------------

Parent Defect ID:	SLXOS-68208	Issue ID:	SLXOS-69891
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2f
Technology Group:	Monitoring	Technology:	OAM - Operations, Admin & Maintenance
Symptom:	Failed to fetch the utilization-watermark stats on the "show interface stats utilization-watermark interface ethernet <x/x>".		
Condition:	In SLX 9540 device configured with "system interface utilization-watermark".		

Parent Defect ID:	SLXOS-69962	Issue ID:	SLXOS-69962
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1c
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Device may reload [with rpsd] when we try to clear the large number[>1024] of BGP flowspec rules/neighbor.		
Condition:	RPSD module and device may reload, once after clearing the BGP neighbor which has populated with large number of flowpsec rules[>1024].		

Parent Defect ID:	SLXOS-69409	Issue ID:	SLXOS-70085
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.2
Technology Group:	Management	Technology:	Other
Symptom:	HTTP(S) connection fails on reload		
Condition:	Before reload if web service is running on port 80 in all VRF and then https certificate is imported and web service is restarted in one vrf and not in others.		
Recovery:	Restart web service in all VRF by doing shut/no-shut or reload SLX-OS.		

Parent Defect ID:	SLXOS-69681	Issue ID:	SLXOS-70173
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.2
Technology Group:	Management	Technology:	Other
Symptom:	HTTP(S) connection fails on reload		
Condition:	Before reload if web service is running on port 80 in all VRF and then https certificate is imported and web service is restarted in one vrf and not in others.		
Workaround:	Restart web service in all VRF by doing shut/no-shut or reload SLX-OS.		

Parent Defect ID:	SLXOS-70296	Issue ID:	SLXOS-70679
--------------------------	-------------	------------------	-------------

Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2f
Technology Group:	Layer 3 Routing/Network Layer	Technology:	IPv6 Addressing
Symptom:	IPv6 neighbor stuck in UnResolved and BFD sessions between leaf switch and UPF DP worker node is down.		
Condition:	When the Leaf with the active SRIOV IPV6 neighbor interface goes down the remaining leaf IPV6 goes unresolved for certain interval.		

Parent Defect ID:	SLXOS-69717	Issue ID:	SLXOS-71024
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2ae
Technology Group:	Traffic Management	Technology:	Rate Limiting and Shaping
Symptom:	ICMP packets may cause drops once exception queue limit is hit in SLX 9540/9640 platforms.		
Condition:	When ICMP packets are sent with TTL1 with MTR or traceroute tool, they may cause drops once exception queue limit is hit in SLX 9540/9640 platforms.		

Parent Defect ID:	SLXOS-71230	Issue ID:	SLXOS-71433
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4a
Technology Group:	IP Multicast	Technology:	IPv4 Multicast Routing
Symptom:	Node reboot while processing a Multicast packet		
Condition:	Multicast daemon reset while processing an IPv6 Multicast packet leading to a node reboot		

Parent Defect ID:	SLXOS-71680	Issue ID:	SLXOS-71680
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1d
Technology Group:	Monitoring	Technology:	Hardware Monitoring
Symptom:	Speed failure trace seen on every SLX bootup.		
Condition:	SLX 9740 to be configured with 40G speed.		

Parent Defect ID:	SLXOS-71412	Issue ID:	SLXOS-71896
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2b_CVR
Technology Group:	MPLS	Technology:	MPLS Traffic Engineering
Symptom:	Unexpected reload is seen due to MPLSD module reset.		
Condition:	MPLSD module reset due to the message queue becoming full on MPLS.		

Parent Defect ID:	SLXOS-72294	Issue ID:	SLXOS-72748
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4b
Technology Group:	Layer 3 Routing/Network Layer	Technology:	ICMP - Internet Control Message Protocol
Symptom:	Duplicate ICMP packet observed		
Condition:	Duplicate ICMP packet is observed when Ping is initiated from Border Leaf		

Parent Defect ID:	SLXOS-72770	Issue ID:	SLXOS-72828
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.3
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	SNMPGet output not matches with its (Upper/Lower)case to SNMP trap output.		
Condition:	Validate both SNMP Get and SNMP trap(pcap) output.		

Parent Defect ID:	SLXOS-71948	Issue ID:	SLXOS-72890
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2d
Technology Group:	IP Multicast	Technology:	IPv4 Multicast Routing
Symptom:	Multicast traffic drops for 5-6 secs or more.		
Condition:	When multiple hosts join and leave a set of groups, in a sequence , such that each group is joined by one host at a time, followed by leave and join the next group in the sequence.		
Workaround:	Using static groups.		

Parent Defect ID:	SLXOS-72779	Issue ID:	SLXOS-72898
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2d
Technology Group:	IP Multicast	Technology:	IGMP - Internet Group Management Protocol
Symptom:	Multicast traffic drop of 1-2 minutes		
Condition:	When sending IGMPv3 report with source as 0.0.0.0, followed by sending IGMPv3 joins, and the configured version on switch is version v3.		
Workaround:	Configuring the switch with IGMP version v2 instead of version v3.		

Parent Defect ID:	SLXOS-72780	Issue ID:	SLXOS-73141
Severity:	S3 - Moderate		

Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2d
Technology Group:	IP Multicast	Technology:	PIM - Protocol-Independent Multicast
Symptom:	Traffic loss seen on a few streams, attached to a prefix list with PIM RP		
Condition:	When more than one PIM RP with prefix list is present on a switch. Upon reload traffic drop for few prefixes will be seen		
Workaround:	Reconfigure PIM RPs, followed by PIM RP with prefix list.		

The following software defects are open in SLX-OS 20.4.1d as of February 2023:

Parent Defect ID:	SLXOS-64538	Issue ID:	SLXOS-66860
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Other	Technology:	Other
Symptom:	RME port may be down		
Condition:	Redundant management ports on slx 9740 may not come up for certain ports in certain scenarios		
Workaround:	Reconfigure breakout cable and sh/no shut to resolve the issue		
Recovery:	Reconfigure breakout cable and sh/no shut to resolve the issue		

Parent Defect ID:	SLXOS-67049	Issue ID:	SLXOS-67661
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4a
Technology Group:	Monitoring	Technology:	Hardware Monitoring
Symptom:	Flow based mirroring stopped working		
Condition:	On SLX-9150/9250 Platform port channel is configured as destination interface in monitor session in flow based mirroring.		
Recovery:	Rebind ACL on the Source interface configured in flow based monitor session		

Parent Defect ID:	SLXOS-66994	Issue ID:	SLXOS-67851
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fa
Technology Group:	Monitoring	Technology:	Port Mirroring
Symptom:	For mirrored traffic ICMP reply packets are seen before ICM request packets.		
Condition:	When a PO is used as source interface for mirroring.		

Parent Defect ID:	SLXOS-67423	Issue ID:	SLXOS-68445
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4ab

Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	BGP crash and sessions went down		
Condition:	redeployment of VMs that causes MACs to be advertised		

Parent Defect ID:	SLXOS-68190	Issue ID:	SLXOS-68558
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fd
Technology Group:	IP Multicast	Technology:	MLD - Multicast Listener Discovery
Symptom:	Crash is observed in MLD module, followed by node reload and link flaps.		
Condition:	The node receives MLD traffic from peer (with a large length value), on an L3 interface with no multicast configuration.		

Parent Defect ID:	SLXOS-67385	Issue ID:	SLXOS-68880
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00ch
Technology Group:	MPLS	Technology:	MPLS VPLS - Virtual Private LAN Services
Symptom:	Pseudowires flaps		
Condition:	After a link-down event.		

Parent Defect ID:	SLXOS-66842	Issue ID:	SLXOS-68902
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4a
Technology Group:	Security	Technology:	SSH - Secure Shell
Symptom:	Public key authentication does not work sometimes.		
Condition:	Running "ssh" exec mode command.		

Parent Defect ID:	SLXOS-68731	Issue ID:	SLXOS-68912
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00m
Technology Group:	Security	Technology:	AAA - Authentication, Authorization, and Accounting
Symptom:	Disabling AAA accounting does not appear in accounting log.		
Condition:	Disabling AAA accounting.		

Parent Defect ID:	SLXOS-68350	Issue ID:	SLXOS-69207
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2f

Technology Group:	Management	Technology:	CLI - Command Line Interface
Symptom:	May experience reload on Dcmd module.		
Condition:	Make Script to run periodically to collect 'show running nomore' output.		

Parent Defect ID:	SLXOS-68589	Issue ID:	SLXOS-69213
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00m
Technology Group:	Security	Technology:	RADIUS
Symptom:	CLI password string not masked on RADIUS accounting request and audit.log.		
Condition:	On executing authentication based CLI commands.		

Parent Defect ID:	SLXOS-69335	Issue ID:	SLXOS-69335
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Management	Technology:	Other
Symptom:	HTTP(S) connection fails on reload		
Condition:	Before reload if web service is running on port 80 in all VRF and then https certificate is imported and web service is restarted in one vrf and not in others.		
Workaround:	Restart web service in all VRF by doing shut/no-shut or reload SLX-OS.		

Parent Defect ID:	SLXOS-68497	Issue ID:	SLXOS-69339
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Other	Technology:	Other
Symptom:	The link does not come up when the QSFP-SFPP-ADPT and 10G SR SFP+ is used in 8520-48XT ports 49,54.		
Condition:	When the optic+adapter combination QSFP-SFPP-ADPT and 10G SR SFP+ is used		

Parent Defect ID:	SLXOS-69102	Issue ID:	SLXOS-69366
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2f
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	When trying to create a port configuration map using ifIndex as the key value, It is not possible to make a port configuration map because the key value(ifIndex) of the management port is not supported.		

Condition:	on SLX 9250 in 20.4.2a, issue is seen only after reloading, after reloading if SNMP walk is issued for IfIndex and later SNMP walk is issued for the IP Address table issue is not seen.
-------------------	--

Parent Defect ID:	SLXOS-68225	Issue ID:	SLXOS-69394
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00c
Technology Group:	Management	Technology:	CLI - Command Line Interface
Symptom:	Unexpected reload of the SLX device.		
Condition:	When we perform the CLI cmd "show bridge-domain" with presence of description has the special characters (Ex: <,>).		

Parent Defect ID:	SLXOS-69448	Issue ID:	SLXOS-69448
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1cb
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Unexpected reload on SLX device.		
Condition:	SLX is trying to process the unexpected flow spec rules sent from the peer device.		

Parent Defect ID:	SLXOS-69474	Issue ID:	SLXOS-69474
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Monitoring	Technology:	Hardware Monitoring
Symptom:	Occasional RAS logs suggesting there is FAN airflow mismatch and to replace the FAN module.		
Condition:	As part of the hardware monitoring, the symptoms shall be observed randomly.		
Recovery:	The warning observed is due to a software defect. There is no issue with the HW when the symptom is observed and there is no recovery mechanism.		

Parent Defect ID:	SLXOS-69844	Issue ID:	SLXOS-69866
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2ae
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	BGP daemon reload is seen in rare condition.		
Condition:	When clearing a bgp specific route.		

Parent Defect ID:	SLXOS-68208	Issue ID:	SLXOS-69891
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2f
Technology Group:	Monitoring	Technology:	OAM - Operations, Admin & Maintenance
Symptom:	Failed to fetch the utilization-watermark stats on the "show interface stats utilization-watermark interface ethernet <x/x>".		
Condition:	In SLX 9540 device configured with "system interface utilization-watermark".		

Parent Defect ID:	SLXOS-69858	Issue ID:	SLXOS-69938
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.2
Technology Group:	Management	Technology:	NTP - Network Time Protocol
Symptom:	Delayed NTP synchronization (>30 mins sometimes) after creating NTP server.		
Condition:	Creation of NTP server on SLX.		

Parent Defect ID:	SLXOS-69962	Issue ID:	SLXOS-69962
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1c
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Device will go for crash[with rpsd] when we try to clear the large number[>1024] of BGP flowspec rules/neighbor.		
Condition:	RPSD module get crashed and device went for reload, once after clearing the BGP neighbor which has populated with large number of flowpsec rules[>1024].		

Parent Defect ID:	SLXOS-69409	Issue ID:	SLXOS-70085
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.2
Technology Group:	Management	Technology:	Other
Symptom:	HTTP(S) connection fails on reload		
Condition:	Before reload if web service is running on port 80 in all VRF and then https certificate is imported and web service is restarted in one vrf and not in others.		
Recovery:	Restart web service in all VRF by doing shut/no-shut or reload SLX-OS.		

Parent Defect ID:	SLXOS-69681	Issue ID:	SLXOS-70173
Severity:	S3 - Moderate		

Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.2
Technology Group:	Management	Technology:	Other
Symptom:	HTTP(S) connection fails on reload		
Condition:	Before reload if web service is running on port 80 in all VRF and then https certificate is imported and web service is restarted in one vrf and not in others.		
Workaround:	Restart web service in all VRF by doing shut/no-shut or reload SLX-OS.		

Parent Defect ID:	SLXOS-70048	Issue ID:	SLXOS-70430
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2f
Technology Group:	Layer 3 Routing/Network Layer	Technology:	IPv6 Addressing
Symptom:	IPv6 neighbor is in Unresolved state and BFD sessions from the client node is down.		
Condition:	In an MCT pair, when the Leaf node with the active SRIOV IPv6 neighbor goes down, IPv6 neighbor in the remaining Leaf stays Unresolved for a certain interval.		

Parent Defect ID:	SLXOS-70482	Issue ID:	SLXOS-70482
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Security	Technology:	SSH - Secure Shell
Symptom:	SSH(sshd) process stops running after node reload.		
Condition:	Noticed in case of making remote side connection of management port DOWN.		

Parent Defect ID:	SLXOS-70461	Issue ID:	SLXOS-70630
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00h
Technology Group:	IP Multicast	Technology:	IGMP - Internet Group Management Protocol
Symptom:	Switch reload on mc_hms module.		
Condition:	May hit when switch processes non-multicast mac (mac not start's with 01:00:5e) packet with jumbo sized on IGMP module.		

Parent Defect ID:	SLXOS-70296	Issue ID:	SLXOS-70679
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2f
Technology Group:	Layer 3 Routing/Network Layer	Technology:	IPv6 Addressing

Symptom:	IPv6 neighbor stuck in UnResolved and BFD sessions between leaf switch and UPF DP worker node is down.
Condition:	When the Leaf with the active SRIOV IPV6 neighbor interface goes down the remaining leaf IPV6 goes unresolved for certain interval.

Parent Defect ID:	SLXOS-70192	Issue ID:	SLXOS-70783
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.2a
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	SNMP reports not updated with changed hostname on SLX.		
Condition:	Validating 'snmpget' or 'snmpwalk' after changing SLX host name.		

The following software defects are open in SLX-OS 20.4.1c as of July 2022:

Parent Defect ID:	SLXOS-64538	Issue ID:	SLXOS-66860
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Other	Technology:	Other
Symptom:	RME port may be down		
Condition:	Redundant management ports on slx 9740 may not come up for certain ports in certain scenarios		
Workaround:	Reconfigure breakout cable and sh/no shut to resolve the issue		
Recovery:	Reconfigure breakout cable and sh/no shut to resolve the issue		

Parent Defect ID:	SLXOS-66825	Issue ID:	SLXOS-66996
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fa
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	BFD sessions flaps		
Condition:	Reload of Leaf node connected to SRIOV compute servers.		

Parent Defect ID:	SLXOS-67321	Issue ID:	SLXOS-67321
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Security	Technology:	SSH - Secure Shell
Symptom:	After deleting the SSH key from flash it come up again after reload.		
Condition:	After deleting the SSH key from flash it come up again after reload.		

Parent Defect ID:	SLXOS-67049	Issue ID:	SLXOS-67661
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4a
Technology Group:	Monitoring	Technology:	Hardware Monitoring
Symptom:	Flow based mirroring stopped working		
Condition:	On SLX-9150/9250 Platform port channel is configured as destination interface in monitor session in flow based mirroring.		
Workaround:	Rebind ACL on the Source interface configured in flow based monitor session		

Parent Defect ID:	SLXOS-66927	Issue ID:	SLXOS-67668
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Monitoring	Technology:	OAM - Operations, Admin & Maintenance
Symptom:	SLX 9540/9640 does not reply with DMR pkts when CFM y.1731 DMM pkts are received from other devices.		
Condition:	SLX 9540/9640 does not reply with DMR response when CFM y.1731 DMM pkts are received from other devices.		

Parent Defect ID:	SLXOS-66416	Issue ID:	SLXOS-67703
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2e
Technology Group:	Security	Technology:	User Accounts & Passwords
Symptom:	Unable to login to the device only on SLX9740.		
Condition:	When we follow the password recovery method.		

The following software defects are open in SLX-OS 20.4.1b as of June 2022:

Parent Defect ID:	SLXOS-64538	Issue ID:	SLXOS-66860
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Other	Technology:	Other
Symptom:	RME port may be down		
Condition:	Redundant management ports on SLX 9740 may not come up for certain ports in certain scenarios		
Workaround:	Reconfigure breakout cable and sh/no shut to resolve the issue		
Recovery:	Reconfigure breakout cable and sh/no shut to resolve the issue		

Parent Defect ID:	SLXOS-66825	Issue ID:	SLXOS-66996
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fa

Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	BFD sessions flaps		
Condition:	Reload of Leaf node connected to SRIOV compute servers.		

Parent Defect ID:	SLXOS-67321	Issue ID:	SLXOS-67321
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Security	Technology:	SSH - Secure Shell
Symptom:	After deleting the SSH key from flash it come up again after reload.		
Condition:	After deleting the SSH key from flash it come up again after reload.		

The following software defects are open in SLX-OS 20.4.1a as of May 2022:

Parent Defect ID:	SLXOS-66708	Issue ID:	SLXOS-66784
Severity:	S1 - Critical		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Other	Technology:	Other
Symptom:	observed the crash		
Condition:	when kernel panic is done on the device.		

Parent Defect ID:	SLXOS-63182	Issue ID:	SLXOS-66787
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Sometimes the switch reload is seen in a scaled environment.		
Condition:	In scaled environment and BGP PIC configuration is enabled, when routes are learned through BGP and are getting processed.		

Parent Defect ID:	SLXOS-64538	Issue ID:	SLXOS-66860
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Other	Technology:	Other
Symptom:	RME port may be down		
Condition:	Redundant management ports on slx 9740 may not come up for certain ports in certain scenarios		
Workaround:	Reconfigure breakout cable and sh/no shut to resolve the issue		
Recovery:	Reconfigure breakout cable and sh/no shut to resolve the issue		

Parent Defect ID:	SLXOS-66741	Issue ID:	SLXOS-66869
--------------------------	-------------	------------------	-------------

Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Other
Symptom:	RH entries are exhausting. Utilizing more resources		
Condition:	Enabling Maintenance mode makes RH entries exhaust and utilize more resources		

Parent Defect ID:	SLXOS-66825	Issue ID:	SLXOS-66996
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fa
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	BFD sessions flaps		
Condition:	Reload of Leaf node connected to SRIOV compute servers.		

The following software defects are open in SLX-OS 20.4.1 as of **April 2022**:

Parent Defect ID:	SLXOS-50693	Issue ID:	SLXOS-50693
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.1
Technology Group:	Traffic Management	Technology:	Rate Limiting and Shaping
Symptom:	Display summation of forwarded and dropped packets for the confirmed counter		
Condition:	Applying Egress Rate Limit on bridge domain and checking the statistics with "show stat bridge-domain x"		

Parent Defect ID:	SLXOS-52599	Issue ID:	SLXOS-52599
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.1a
Technology Group:	Layer 3 Routing/Network Layer	Technology:	IPv6 Addressing
Symptom:	/127 prefix routes are accepted and traffic is dropped for them.		
Condition:	If route profile "ipv6-max-prefix64" is enabled on SLX 9150, or SLX 9250		

Parent Defect ID:	SLXOS-52746	Issue ID:	SLXOS-53722
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.1a
Technology Group:	Monitoring	Technology:	sFlow

Symptom:	S-flow will not work for Virtual leased lines interface
Condition:	When Storm control is applied on Virtual leased lines interface

Parent Defect ID:	SLXOS-55243	Issue ID:	SLXOS-55243
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2
Technology Group:	Security	Technology:	HTTP/HTTPS
Symptom:	Extreme switch bootup logs reports(sometimes) unavailable file (/usr/sbin/httpd.0)		
Condition:	Issue is seen after restarting HTTP(S) server multiple times		

Parent Defect ID:	SLXOS-55266	Issue ID:	SLXOS-55266
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2
Technology Group:	Layer 2 Switching	Technology:	VLAN - Virtual LAN
Symptom:	On SLX 9740, ARP is not resolved and Source mac is not learned when the incoming IP packets are Priority Tagged (Vlan-0 with PCP bit set).		
Condition:	The connected device to the switch is configured to send Priority tagged packets on an untagged port. The source MACs are not learnt from IP packets on the switch.		
Workaround:	Use DSCP instead of using Priority tagging for QoS.		
Recovery:	No known recovery methods available.		

Parent Defect ID:	SLXOS-56576	Issue ID:	SLXOS-56576
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2
Technology Group:	Other	Technology:	Other
Symptom:	On SLX 9740, when the user upgrades software from 20.2.2a to a later release, device becomes unreachable when accessing through an in-band port.		
Condition:	Software upgrade through in-band port.		

Parent Defect ID:	SLXOS-57174	Issue ID:	SLXOS-57432
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3b
Technology Group:	Management	Technology:	Other
Symptom:	System memory usage increases slowly over time while being managed by EFA		
Condition:	Memory increase is seen when EFA frequently polls SLX for updates and health checks		

Parent Defect ID:	SLXOS-55211	Issue ID:	SLXOS-57437
Severity:	S2 - Major		

Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2
Technology Group:	Management	Technology:	Other
Symptom:	Command is not successful and displays an error saying "Cannot resolve hostname"		
Condition:	Usage of "copy" command with FTP protocol and IPV6 address .		
Workaround:	Use IPv4 interface address		

Parent Defect ID:	SLXOS-57372	Issue ID:	SLXOS-57439
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3b
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Convergence times >500 msec are seen for South - North traffic when one of the two ports from Border Leaf to L3 gateway is shut.		
Condition:	This is a test for convergence numbers. There are two port channels between each Border Leaf to the two L3 gateways. One of the port channel is shut down at the Border Leaf. This forces the BL to reprogram the traffic going over that port channel for the South - North traffic to the other port channel. The convergence times vary and there are occasional spikes of over 700 msec.		

Parent Defect ID:	SLXOS-56401	Issue ID:	SLXOS-57443
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3
Technology Group:	Other	Technology:	Other
Symptom:	The following Brocade branded 4x10G breakout DAC modules are not detected sometimes. The affected module SKU's are 40G-DACP-QSFP4SFP1M, 40G-DACP-QSFP4SFP3M, 40G-DACP-QSFP4SFP5M		
Condition:	Over a period of time, the issue is seen from a corruption in the EEPROM MSA programming		

Parent Defect ID:	SLXOS-56740	Issue ID:	SLXOS-57454
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Convergence times > 500 msec are seen for South - North traffic when a port from Border Leaf to L3 gateway is shut		
Condition:	This is a test for convergence numbers. The port between a Border Leaf and an L3 gateway is shut which forces the BL to reprogram the next hop for the South - North traffic to go over the ICL. The convergence times vary and there are occasional spikes between 800 to 1000 msec.		

Parent Defect ID:	SLXOS-57721	Issue ID:	SLXOS-57721
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2
Technology Group:	Management	Technology:	CLI - Command Line Interface
Symptom:	When we are pinging the destination with the domain name, output will be in decimal format(IP address instead of domain name)		
Condition:	When the firmware is SLX-OS 20.1.2, SLX-OS 20.2.1 or above ping will have the output in IP address instead of domain name.		

Parent Defect ID:	SLXOS-57738	Issue ID:	SLXOS-57738
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.1.2f
Technology Group:	MPLS	Technology:	IP over MPLS
Symptom:	Hops are not displayed in IPoMPLS trace		
Condition:	During traceroute of IPoMPLS traffic		

Parent Defect ID:	SLXOS-58198	Issue ID:	SLXOS-58198
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3c
Technology Group:	Other	Technology:	Other
Symptom:	ICL interface is not coming up.		
Condition:	After the BGP process is killed.		

Parent Defect ID:	SLXOS-60302	Issue ID:	SLXOS-60754
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2a
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Static Routing (IPv4)
Symptom:	Shutting down the uplink port channel from the border leaf to the L3 gateway leads to traffic convergence of nearly 1 second		
Condition:	<p>SLX-8720 is used as the border leaf pair and SLX-9640 as L3 gateway. There are 32 VRFs configured and there are IPv4 and IPv6 routes.</p> <p>There is a port-channel between the BL nodes and the gateway. The port-channel is shut at a border leaf node and the traffic is redirected from the border leaf node to its peer along the ICL. The convergence times for this are found to be more than expected.</p> <p>With static routes, the convergence times are in the order of 1 second. With only BGP routes and PIC enabled, it was upto around 730 msec.</p>		

Parent Defect ID:	SLXOS-60298	Issue ID:	SLXOS-60757
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2a
Technology Group:	Other	Technology:	Other
Symptom:	One of the BFD session over MCT flaps on cluster node. There is no visible traffic loss as such because the other MCT peer takes the traffic over ICL and forwards it to CCEP DUT (from L3 GW).		
Condition:	<p>On reload and system maintenance turn-off on an SLX8720 cluster node.</p> <p>System scale: 32 VRFs, at least 2 BFD over MCT, 2 HW BFD and 2 BFD over VxLAN session per VRF. (one IPv4 and one IPv6) (First 20 VRFs have 10+ BFD over MCT sessions towards CCEP DUTs, last 12 VRFs have 2 BFD over MCT sessions towards CCEP DUTs)</p> <p>All VE interfaces configured across all devices are dual stack.</p> <p>SW BFD sessions: 393 HW BFD sessions: 65</p> <p>960 IPv4 routes, 960 IPv6 routes from L3 GW. 960 IPv4 routes, 960 IPv6 routes from CCEP DUTs.</p> <p>System-wide route scale: 3K IPv4 and 3K IPv6</p>		
Workaround:	issue seen on Ve's attached to BDs. Remove the VE from BD and reconfigure.		

Parent Defect ID:	SLXOS-60448	Issue ID:	SLXOS-60912
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2
Technology Group:	Management	Technology:	Configuration Fundamentals
Symptom:	DHCP/BOOTP request is seen sending out from mgmt. interface event after disable DHCP.		
Condition:	BMC is configured as DHCP client.		
Recovery:	Manually disable DHCP option from BMC . <pre>[root@slx]# bmc ipmitool lan set 1 ipsrc static</pre>		

Parent Defect ID:	SLXOS-60970	Issue ID:	SLXOS-60970
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.3
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	On SLX 9640. while programming 500 flowspec rules to hardware, a BFD session is down due to "Detection Time Expired" which in turn terminates BGP session. Some BGP sessions flapping are due to this.		

Condition:	In scaled setup, 500 BGP-flow spec rules are programmed in hardware
-------------------	---

Parent Defect ID:	SLXOS-61208	Issue ID:	SLXOS-61283
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2b
Technology Group:	Other	Technology:	Other
Symptom:	SLX 9540 device does not respond		
Condition:	Taking supptomsave when the free memory is below 600Mb.		
Recovery:	Power off/on the device		

Parent Defect ID:	SLXOS-61458	Issue ID:	SLXOS-61527
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2b
Technology Group:	Other	Technology:	Other
Symptom:	When the encrypted password string has “\” or “?” in the startup config, ? or \ is missed in the running-config after config restore and TPVM login will be failed		
Condition:	Encrypted password string should not have these charater “\” or “?”		
Workaround:	TPVM password command needs to be executed till the encrypted password string doesn't have the '\ and '?'.		
Recovery:	TPVM password command needs to be executed again to recover TPVM login		

Parent Defect ID:	SLXOS-61347	Issue ID:	SLXOS-61598
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2c
Technology Group:	Layer 2 Switching	Technology:	MCT - Multi-Chassis Trunking
Symptom:	In Multi-homed environment, shutdown of an LACP ES Port-channel may cause traffic flooding to other ES interfaces if the client/host device is not able to detect link flap and continue to send the traffic. Whenever LACP port-channel is shut, member ports will be disaggregated and laser will be down for few msec(around 100ms) to allow peer device to detect link event. After that link comes up and member port will be transitioned to disaggregated individual port. Some old devices may not be able to detect link flap and continue to send traffic for some more time till LACP timeout.		
Condition:	Some old hosts may not be able to detect link flap when the link goes down for short period of time. SLX 9150/9250 keep the link down for 100msec before bring up the link as lacp individual. If the dual homed host is not able to detect the link flap on LACP ESI shut, the host continues to send the traffic till LACP timeout. SLX device may flood the traffic (in vlan) during that period.		

Workaround:	Shutting the individual member ports along with ES port-channel avoids flooding in this scenario.
Recovery:	This situation will be recovered automatically after LACP timeout. Client device detects LACP timeout after 3sec (in case of short lacp interval), and stops traffic.

Parent Defect ID:	SLXOS-61510	Issue ID:	SLXOS-62106
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2c
Technology Group:	Management	Technology:	Software Installation & Upgrade
Symptom:	a) If the device is reloaded, running-configs is not retained with auto persistence enable as dcmd database is not present. b) If the device is not reloaded and do a normal fwdl or fullinstall, no issue will be seen.		
Condition:	If “firmware download + noreboot” is issued and later if the “firmware commit” is done and rebooted the device.		

Parent Defect ID:	SLXOS-62115	Issue ID:	SLXOS-62126
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2b
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	SNMP trap is not sent for Loopback interface which is a VTEP, during cluster bring-up after a reload.		
Condition:	Reload of switch that is in a MCT cluster. SNMP trap is not sent when an interface comes up. Issue is seen when VTEP comes up as part of cluster bring-up after reload.		

Parent Defect ID:	SLXOS-62773	Issue ID:	SLXOS-62773
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Some BGP EVPN ND routes are not flushed in BGP EVPN table alone when one MH node comes out from MM and traffic is not getting forwarded for those ND routes		
Condition:	This EVPN ND routes sync issue happens inconsistently when one MH node comes out from MM		

Parent Defect ID:	SLXOS-61178	Issue ID:	SLXOS-62976
--------------------------	-------------	------------------	-------------

Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3d
Technology Group:	Layer 3 Routing/Network Layer	Technology:	ICMP - Internet Control Message Protocol
Symptom:	Slowness on the ping responses on SLX.		
Condition:	On SLX node, CPU is busy with the higher priority packets.		

Parent Defect ID:	SLXOS-62671	Issue ID:	SLXOS-62995
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4+ - IPv6 Border Gateway Protocol
Symptom:	Latency of around 250ms to 1second is observed on SLX device.		
Condition:	SLX node has experienced the CPU congestion		

Parent Defect ID:	SLXOS-63052	Issue ID:	SLXOS-63052
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Static Routing (IPv4)
Symptom:	Higher convergence of traffic for primary and backup static nexthops.		
Condition:	When primary nexthop goes DOWN, secondary nexthop takes time to get installed and traffic handoff happens delayed.		

Parent Defect ID:	SLXOS-63118	Issue ID:	SLXOS-63118
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Other	Technology:	Other
Symptom:	2nd and 3rd BO ports of 8520-48XT and 8520-48Y do not come up when OIR is done and they are connected to Spirent or a SLX 9150 respectively.		
Condition:	When OIR is done on 8520-48XT or 8520-48Y devices.		
Workaround:	Remove and configure the breakout config or reload the device.		

Parent Defect ID:	SLXOS-63121	Issue ID:	SLXOS-63121
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 2 Switching	Technology:	MCT - Multi-Chassis Trunking
Symptom:	"show cluster track" command does not display correct interface status		

Condition:	Interface status is not displayed as 'down' under 'show cluster track' when port-channel becomes down due to the minimum-link criteria not being met.
-------------------	---

Parent Defect ID:	SLXOS-61254	Issue ID:	SLXOS-63124
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00ca
Technology Group:	MPLS	Technology:	LDP - Label Distribution Protocol
Symptom:	Duplicate LDP Address Withdraw Message sent from LDP for each VC-Peer.		
Condition:	Issue is seen when we do "clear mac-address" under a bridge domain.		

Parent Defect ID:	SLXOS-63023	Issue ID:	SLXOS-63982
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.1.2g
Technology Group:	Management	Technology:	Software Installation & Upgrade
Symptom:	Device will boot to ONIE on bootrom, and waits for ever.		
Condition:	Doing firmware downgrade from 20.2.3 to 20.1.2 via USB.		
Workaround:	Use methods of firmware download, other than the USB.		

Parent Defect ID:	SLXOS-64409	Issue ID:	SLXOS-64606
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4a
Technology Group:	Management	Technology:	CLI - Command Line Interface
Symptom:	TPVM configuration is lost when the device reloads with default configuration during firmware update.		
Condition:	Issue happens when "default-config" option is provided in "firmware download" command.		
Workaround:	Execute following commands - "copy default-config startup-config" and then "firmware download" command without "default-config" option.		

Parent Defect ID:	SLXOS-64255	Issue ID:	SLXOS-65234
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00j
Technology Group:	Management	Technology:	CLI - Command Line Interface
Symptom:	ARP not resolved for the peer entry		
Condition:	When link fault is cleared.		

Parent Defect ID:	SLXOS-65249	Issue ID:	SLXOS-65249
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	In SLX 9740, Traffic Convergence takes ~3 seconds.		
Condition:	Nexthop change takes place in ECMP prefixes.		

Parent Defect ID:	SLXOS-65436	Issue ID:	SLXOS-65436
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Other
Symptom:	Not able to delete a logical interface.		
Condition:	When a new BD/LIF was created after LIF limit is reached.		

Parent Defect ID:	SLXOS-65700	Issue ID:	SLXOS-65700
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	MPLS	Technology:	MPLS VPLS - Virtual Private LAN Services
Symptom:	LACP configured Port channels may flap after clearing MACs.		
Condition:	Executing "clear mac dynamic" command on a Provider Edge node with more than 600 VPLS bridge domain configuration may cause LACP port channels to flap.		
Workaround:	MACs can be cleared one at a time or clear MAC by one VLAN at a time		

Parent Defect ID:	SLXOS-65885	Issue ID:	SLXOS-65889
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2ad
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	BGP sessions could flap due to BGP rate-limit thresholds.		
Condition:	BGP control packets may be dropped if BGP CPU rate-limit thresholds are reached in BGP scaling scenarios.		

Parent Defect ID:	SLXOS-65909	Issue ID:	SLXOS-65909
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1

Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	EFA checks if BGP session ESTABLISHED and announces failure in bringing up the session established.		
Condition:	BGP session takes 30+ seconds to become ESTABLISHED. Before that EFA times out and announces failure.		

Parent Defect ID:	SLXOS-66144	Issue ID:	SLXOS-66144
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Other
Symptom:	Traffic takes more than 900 msec in the N-S direction when a port channel between the Gateway and Border Leaf fails. Minimum link is configured over this port channel and the trigger is the shutdown of one interface belonging to the port channel.		
Condition:	Minimum-link is configured between border leaf and gateway. When a port channel member between them is shutdown in the BL side, the PO is expected to fail. The GW should redirect the traffic to the other border leaf. This was seen to take more than 900 ms. The GW is a SLX 9640.		

Parent Defect ID:	SLXOS-65379	Issue ID:	SLXOS-66289
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3j
Technology Group:	MPLS	Technology:	MPLS VPLS - Virtual Private LAN Services
Symptom:	MPLS encapsulated 'Unicast ICMP with destination MAC starts on 4' traffic fails to forward from 9740(PHP/P) to 9850(PE).		
Condition:	a) Establish VPLS session between 9850 & MLX with adding 9740 as Transit Node. b) Initiate traffic with destination MAC starts with 4 from CE to CE.		

Parent Defect ID:	SLXOS-66290	Issue ID:	SLXOS-66290
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Layer 3 Routing/Network Layer	Technology:	VRRPv2 - Virtual Router Redundancy Protocol Version 2
Symptom:	SAG mac is not programmed in hardware.		
Condition:	ESI flap on port-channel interface.		

Parent Defect ID:	SLXOS-66291	Issue ID:	SLXOS-66291
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Peer group command not accepted under router bgp user vrf		
Condition:	While trying to add peer group for BGP under user vrf.		

Parent Defect ID:	SLXOS-66262	Issue ID:	SLXOS-66385
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4a
Technology Group:	Layer 3 Routing/Network Layer	Technology:	ARP - Address Resolution Protocol
Symptom:	Response is not seen for Neighbor Solicitation		
Condition:	On capturing packets using port mirroring while receiving ICMP6 Neighbor Solicitations at the rate of 1pkt/sec or more, a sporadic miss of Neighbor Advertisements (NA) is seen in the pcap file, though SLX responds with NA for each of them.		

Parent Defect ID:	SLXOS-66494	Issue ID:	SLXOS-66494
Severity:	S1 - Critical		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Other	Technology:	Other
Symptom:	With FEC mode RS-FEC/FC-FEC configuration, the link is not coming up.		
Condition:	When configuring the "no shutdown" on the port, with FEC mode as RS-FEC /FC-FEC.		

Parent Defect ID:	SLXOS-66686	Issue ID:	SLXOS-66686
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Other	Technology:	Other
Symptom:	"show efa status" is not getting the status from EFA and throwing the error		
Condition:	While doing multiple EFA upgrade without "no efa deploy", "show efa status" is not getting the status from EFA		
Workaround:	Execute "no efa deploy" before doing the "efa deploy" on the node with already EFA deployed.		

Parent Defect ID:	SLXOS-66718	Issue ID:	SLXOS-66718
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1

Technology Group:	Other	Technology:	Other
Symptom:	Observed the optics removed for all ports.		
Condition:	After multiple device reloads on 9740 device.		

Parent Defect ID:	SLXOS-66716	Issue ID:	SLXOS-66727
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4a
Technology Group:	MPLS	Technology:	MPLS VPLS - Virtual Private LAN Services
Symptom:	show bridge-domain <BD#> logical-interface" displays the LIF as untagged, when it is configured as a tagged interface. This is cosmetic issue.		
Condition:	This is only cosmetic bug as traffic was working as tagged. When bridge-domain is configured with tagged interface, show command show it as untagged.		
Workaround:	None		

Parent Defect ID:	SLXOS-66738	Issue ID:	SLXOS-66738
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Monitoring	Technology:	Port Mirroring
Symptom:	In port mirroring configuration if destination interface is a port-channel and source interface is either a port-channel or member of a port-channel then destination port-channel interface goes down.		
Condition:	Issue is seen if in port mirroring configuration destination interface is configured as a port-channel.		

Parent Defect ID:	SLXOS-66742	Issue ID:	SLXOS-66742
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Layer 2 Switching	Technology:	MCT - Multi-Chassis Trunking
Symptom:	BUM packets failed to go out over CCEP(cluster client endpoint) ports		
Condition:	Below is the sequence of trigger: -Maintenance mode enable -Vlan delete/add against CCEP Interface -Disable Maintenance mode		

Parent Defect ID:	SLXOS-61178	Issue ID:	SLXOS-62976
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3d
Technology Group:	Layer 3 Routing/Network Layer	Technology:	ICMP - Internet Control Message Protocol

Symptom:	Slowness on the ping responses on SLX.
Condition:	On SLX node, CPU is busy with the higher priority packets.

Parent Defect ID:	SLXOS-66305	Issue ID:	SLXOS-66802
Severity:	S2 – Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Other	Technology:	Other
Symptom:	In SLX-OS 9640, other unrelated 1G ports go down when one particular 1G port is reseated.		
Condition:	In SLX-OS 9640, for example, if ports 0/13, 0/14, 0/16, 0/17 have 1G optics and are UP, and when 0/13 optic is reseated, 0/14 and 0/16 also go down.		

Defects Closed with Code Changes

The following software defects were closed in 20.4.1e with code change as of June 2023:

Parent Defect ID:	SLXOS-67973	Issue ID:	SLXOS-68389
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2d
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	BFD session is not coming up		
Condition:	AMF POD reset		

Parent Defect ID:	SLXOS-68731	Issue ID:	SLXOS-68912
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00m
Technology Group:	Security	Technology:	AAA - Authentication, Authorization, and Accounting
Symptom:	Disabling AAA accounting does not appear in accounting log.		
Condition:	Disabling AAA accounting.		

Parent Defect ID:	SLXOS-68350	Issue ID:	SLXOS-69207
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2f
Technology Group:	Management	Technology:	CLI - Command Line Interface
Symptom:	May experience reload on Dcmd module.		
Condition:	Make Script to run periodically to collect 'show running nomore' output.		

Parent Defect ID:	SLXOS-69335	Issue ID:	SLXOS-69335
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Management	Technology:	Other
Symptom:	HTTP(S) connection fails on reload		
Condition:	Before reload if web service is running on port 80 in all VRF and then https certificate is imported and web service is restarted in one vrf and not in others.		
Workaround:	Restart web service in all VRF by doing shut/no-shut or reload SLX-OS.		

Parent Defect ID:	SLXOS-69102	Issue ID:	SLXOS-69366
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2f
Technology Group:	Management	Technology:	SNMP - Simple Network

			Management Protocol
Symptom:	When trying to create a port configuration map using ifIndex as the key value, It is not possible to make a port configuration map because the key value(ifIndex) of the management port is not supported.		
Condition:	on SLX 9250 in 20.4.2a, issue is seen only after reloading, after reloading if SNMP walk is issued for Ifindex and later SNMP walk is issued for the IP Address table issue is not seen.		

Parent Defect ID:	SLXOS-68225	Issue ID:	SLXOS-69394
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00c
Technology Group:	Management	Technology:	CLI - Command Line Interface
Symptom:	Unexpected reload of the SLX device.		
Condition:	When we perform the CLI cmd "show bridge-domain" with presence of description has the special characters (Ex: <, >).		

Parent Defect ID:	SLXOS-70748	Issue ID:	SLXOS-70748
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1c
Technology Group:	Security	Technology:	SSH - Secure Shell
Symptom:	SSH(sshd) process stops running after node reload.		
Condition:	Noticed in case of making remote side connection of management port DOWN.		

Parent Defect ID:	SLXOS-70192	Issue ID:	SLXOS-70783
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.2a
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	SNMP reports not updated with changed hostname on SLX.		
Condition:	Validating 'snmpget' or 'snmpwalk' after changing SLX host name.		

Parent Defect ID:	SLXOS-70832	Issue ID:	SLXOS-70832
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	Duplicate CPU/memory threshold monitoring SNMP traps seen.		
Condition:	CPU/memory usage in SLX reaching its configured threshold limits.		

Parent Defect ID:	SLXOS-70883	Issue ID:	SLXOS-71071
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.2a
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	For SNMP requests made to loopback interface address, SNMP response is sent with source IP address as outgoing interface address.		
Condition:	SNMP request made to loopback interface address.		

Parent Defect ID:	SLXOS-71127	Issue ID:	SLXOS-71127
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1c
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	SNMP MIB(1.3.6.1.4.1.1588.3.1.12.1.1.1.3.1.60) reporting very large value/zero CPU utilization.		
Condition:	While doing the snmpwalk for this OID (1.3.6.1.4.1.1588.3.1.12.1.1.1.3.1.60), it is displaying very large value/sometime Zero CPU utilization in SNMP response randomly.		

Parent Defect ID:	SLXOS-69875	Issue ID:	SLXOS-71383
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00m
Technology Group:	Layer 2 Switching	Technology:	LAG - Link Aggregation Group
Symptom:	Invalid "Time since last interface status change" value for Port-channel.		
Condition:	Member port flap.		
Workaround:	No		

Parent Defect ID:	SLXOS-71300	Issue ID:	SLXOS-71504
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.2
Technology Group:	Traffic Management	Technology:	QoS - Quality of Service
Symptom:	When tm voq-stats CLI command is executed, destination port shown as N/A when there are CPU discards.		
Condition:	During execution of "show tm voq-stat ingress-device all discards" command.		

Parent Defect ID:	SLXOS-70559	Issue ID:	SLXOS-71572
Severity:	S2 - Major		

Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3ja
Technology Group:	Layer 2 Switching	Technology:	xSTP - Spanning Tree Protocols
Symptom:	When no switch-port is initiated on PO interface, the device might block traffic on other interface as it updates wrong h/w entry with drop.		
Condition:	When no switch-port is done on PO interface.		

Parent Defect ID:	SLXOS-71395	Issue ID:	SLXOS-71653
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.3
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	SNMP MIB(1.3.6.1.4.1.1588.3.1.12.1.1.1.3.1.60 and 1.3.6.1.4.1.1588.3.1.13.1.1.1.4.1) reporting very large value/zero CPU and memory utilization randomly.		
Condition:	While doing the snmpwalk for OID (1.3.6.1.4.1.1588.3.1.12.1.1.1.3.1.60 and 1.3.6.1.4.1.1588.3.1.13.1.1.1.4.1), it is displaying very large value/sometime Zero CPU and memory utilization in SNMP response randomly.		

Parent Defect ID:	SLXOS-71581	Issue ID:	SLXOS-71870
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2h
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	For SNMP requests made to loopback interface address, SNMP response is sent with source IP address as outgoing interface address.		
Condition:	SNMP request made to loopback interface address.		

Parent Defect ID:	SLXOS-72014	Issue ID:	SLXOS-72014
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1cb
Technology Group:	Other	Technology:	Other
Symptom:	System may reload on executing CMSH DIAG command.		
Condition:	In execution of 'show diag pp-fdt interface' command for non-existing (loopback/port-channel) interface.		

Parent Defect ID:	SLXOS-70482	Issue ID:	SLXOS-72183
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1

Technology Group:	Security	Technology:	SSH - Secure Shell
Symptom:	SSH(sshd) process stops running after node reload.		
Condition:	Noticed in case of making remote side connection of management port DOWN.		

Parent Defect ID:	SLXOS-72212	Issue ID:	SLXOS-72212
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1cb
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Extra whitespace seen after 80 chars in AS PATH display.		
Condition:	While checking the output for "show ip bgp route detail " for a certain ip prefix whose AS PATH has more than 80 characters, an extra white space appears after that.		

Parent Defect ID:	SLXOS-72195	Issue ID:	SLXOS-72852
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3g
Technology Group:	Traffic Management	Technology:	Traffic Queueing and Scheduling
Symptom:	BFD and OSPF session flaps are observed in SLX 9540.		
Condition:	BFD and OSPF session flaps are observed if there is high latency due to internal CPU packet processing delays in hardware.		

Parent Defect ID:	SLXOS-72504	Issue ID:	SLXOS-72857
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2e
Technology Group:	Traffic Management	Technology:	Traffic Queueing and Scheduling
Symptom:	BFD and OSPF flaps are observed in SLX 9540.		
Condition:	BFD and OSPF flaps are observed if there is high latency due to internal CPU packet processing delays in hardware.		

The following software defects were closed in 20.4.1d with code change as of February 2023:

Parent Defect ID:	SLXOS-67321	Issue ID:	SLXOS-67321
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Security	Technology:	SSH - Secure Shell
Symptom:	After deleting the SSH key from flash it come up again after reload.		
Condition:	After deleting the SSH key from flash it come up again after reload.		

Parent Defect ID:	SLXOS-67415	Issue ID:	SLXOS-67415
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1

Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	snmpwalk for OID .1.3.6.1.4.1.1916.1.51.1.8.1.3 (extremeBgp4V2PrefixInPrefixes) doesn't work		
Condition:	When snmpwalk executed for OID .1.3.6.1.4.1.1916.1.51.1.8.1.3		

Parent Defect ID:	SLXOS-67492	Issue ID:	SLXOS-67492
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1a
Technology Group:	Management	Technology:	Other
Symptom:	Failed to bring up the interfaces(0/49:1 & 0/54:1) on SLX9150-48XT.		
Condition:	With presence of QSFP-SFPP-ADPT and 10G SR SFP+ optics on 0/49 or 0/54.		

Parent Defect ID:	SLXOS-67614	Issue ID:	SLXOS-67614
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1a
Technology Group:	Security	Technology:	PBR - Policy-Based Routing
Symptom:	IPv6 transit packets are getting dropped.		
Condition:	When L3 interface is configured with IPv4 and IPv6 addresses and IPv4 PBR rule is applied to drop all IPv4 packets.		

Parent Defect ID:	SLXOS-66927	Issue ID:	SLXOS-67668
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Monitoring	Technology:	OAM - Operations, Admin & Maintenance
Symptom:	SLX 9540/9640 does not reply with DMR pkts when CFM y.1731 DMM pkts are received from other devices.		
Condition:	SLX 9540/9640 does not reply with DMR response when CFM y.1731 DMM pkts are received from other devices.		

Parent Defect ID:	SLXOS-66416	Issue ID:	SLXOS-67703
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2e
Technology Group:	Security	Technology:	User Accounts & Passwords
Symptom:	Unable to login to the device on SLX9740.		
Condition:	When following the password recovery method.		

Parent Defect ID:	SLXOS-67910	Issue ID:	SLXOS-67910
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Layer 3 Routing/Network Layer	Technology:	IPv6 Addressing
Symptom:	SLX reloads, when we try to fetch the ipv6 link-local neighbors information.		
Condition:	When we try to retrieve the neighbor info from the SLX-CLI. "show ipv6 neighbor <link-local address>"		

Parent Defect ID:	SLXOS-67934	Issue ID:	SLXOS-67934
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1b
Technology Group:	Management	Technology:	Other
Symptom:	Upon the boot up of SLX, system persists directory file /TPVM/tpvm_disk_pool/		
Condition:	When "write erase all" issued without issuing command, "tpvm uninstall force"		

Parent Defect ID:	SLXOS-67837	Issue ID:	SLXOS-67999
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fb
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	In routing table, POD prefixes with /25 routes are not added instead the route which has next-hop points to gateway is added.		
Condition:	During POD reboot the routes are installed with gateway's next-hop address.		

Parent Defect ID:	SLXOS-67941	Issue ID:	SLXOS-68059
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4b
Technology Group:	Monitoring	Technology:	Hardware Monitoring
Symptom:	SLXCLI route command "show hw route-info linecard 0" will show invalid values in the LPM output display.		
Condition:	When route command "show hw route-info linecard 0" is executed from SLXCLI.		

Parent Defect ID:	SLXOS-67899	Issue ID:	SLXOS-68285
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fb

Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Route entries with 2 next-hops are added where one next-hop is inactive.		
Condition:	During the POD reboot scenario, PODs advertise different next-hop address. Though one of the next-hop is detected as BFD DOWN, route with this next-hop still present in routing table.		
Recovery:	Execute "clear ip route <route>"		

Parent Defect ID:	SLXOS-68283	Issue ID:	SLXOS-68712
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3j
Technology Group:	Management	Technology:	CLI - Command Line Interface
Symptom:	SLX crashed and reloaded Unexpectedly.		
Condition:	The 'Dcmd' process memory size keeps increasing every time when we perform 'copy running-config to startup-config' on SLX device.		

Parent Defect ID:	SLXOS-67618	Issue ID:	SLXOS-68726
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2d
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	The OID to pull the serial number is different for the Extreme 8720 than other SLX platforms.		
Condition:	If Extreme 8720 tries to fetch the serial number via entPhysicalEntry.		

Parent Defect ID:	SLXOS-67923	Issue ID:	SLXOS-69099
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00j
Technology Group:	Management	Technology:	Other
Symptom:	REST interface does not support configuring "vlan any" for mac access-list.		
Condition:	If "vlan any" is specified for mac access-list in REST configuration API		
Workaround:	Use CLI to configure "vlan any" for "mac access-list"		

Parent Defect ID:	SLXOS-69512	Issue ID:	SLXOS-69581
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00m

Technology Group:	Layer 3 Routing/Network Layer	Technology:	ARP - Address Resolution Protocol
Symptom:	When ARP requests are received on a physical IP interface, duplicated ARP responses will be sent by SLX 9540/SLX 9640.		
Condition:	When ARP request is received on a physical IP interface on SLX 9540/SLX 9640.		

Parent Defect ID:	SLXOS-69585	Issue ID:	SLXOS-69585
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	FRU notifications not getting generated.		
Condition:	When FRU related events occurred.		

Parent Defect ID:	SLXOS-68058	Issue ID:	SLXOS-69706
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3j
Technology Group:	Management	Technology:	CLI - Command Line Interface
Symptom:	SLX reloads when 'show media' command is executed		
Condition:	On 'show media' command execution when some SFPs are plugged in.		

Parent Defect ID:	SLXOS-68282	Issue ID:	SLXOS-69712
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	BFD session flaps for 20 minutes		
Condition:	Link break between Spine and Board-Leaf nodes		

Parent Defect ID:	SLXOS-69840	Issue ID:	SLXOS-69945
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2f
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	route-map "continue" is changed in order of operation		

Condition:	"continue" keyword for route-map config is changed in order of operation. It should come at the last of each route-map config.
-------------------	--

Parent Defect ID:	SLXOS-69572	Issue ID:	SLXOS-70155
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2a
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	Timer mismatch of SNMP GET call of OID bgpPeerFsmEstablishedTime when compared with CLI.		
Condition:	BGP configuration should be present on the device and peer to be established. This issue is seen when we poll OID 1.3.6.1.2.1.15.3.1.16 using SNMP.		

Parent Defect ID:	SLXOS-69334	Issue ID:	SLXOS-70185
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.2
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Multi-VRF
Symptom:	Not able to ping the SLX Ve anycast ip from external System.		
Condition:	After firmware download to 20.4.2a version.		

Parent Defect ID:	SLXOS-70148	Issue ID:	SLXOS-70324
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fb
Technology Group:	Traffic Management	Technology:	Rate Limiting and Shaping
Symptom:	System reload while updating subnet CPU packet rate during monitoring process.		
Condition:	In rare scenario during monitoring process of subnet CPU packet rate in Extreme 8720/SLX 9150/SLX 9250 platforms.		

Parent Defect ID:	SLXOS-70392	Issue ID:	SLXOS-70727
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 3 Routing/Network Layer	Technology:	ARP - Address Resolution Protocol
Symptom:	Invalid checksum in IPv6 NA packets.		
Condition:	When anycast IPv6 address is enabled.		

Parent Defect ID:	SLXOS-70203	Issue ID:	SLXOS-70739
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4b
Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	As per standards optional attributes can be added to SNMP notifications at the end of the object list specified in the MIB. But snmpTrapAddress OID is placed in the notification before the notification's object list		

The following software defects were closed in 20.4.1c with code change as of July 2022:

Parent Defect ID:	SLXOS-67528	Issue ID:	SLXOS-67675
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2d
Technology Group:	Layer 2 Switching	Technology:	MCT - Multi-Chassis Trunking
Symptom:	May encounter continuous Tx Discard count increment on Ports.		
Condition:	Reported behavior specific to MCT-ICL ports on SLX Leaf switch.		

The following software defects were closed in 20.4.1b with code change as of June 2022:

Parent Defect ID:	SLXOS-66951	Issue ID:	SLXOS-66951
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Other	Technology:	Other
Symptom:	"Last Runtime error" in the "show tpvm status" after power cycle.		
Condition:	While trying to get the tpvm status before TPVM is coming to alive.		
Recovery:	After executing "show tpvm ip" with proper ip, issue will be resolved.		

Parent Defect ID:	SLXOS-67058	Issue ID:	SLXOS-67058
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Other	Technology:	Other
Symptom:	BGP IPV6 trap with BGP peer remote address in its varbind list.		
Condition:	During BGP IPV6 traps generation, the bgp peer remote address got stored in ipAddress value type.		

Parent Defect ID:	SLXOS-67323	Issue ID:	SLXOS-67323
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1

Technology Group:	Layer 3 Routing/Network Layer	Technology:	VRRPv2 - Virtual Router Redundancy Protocol Version 2
Symptom:	TCP packets received from a VxLAN tunnel maybe copied to CPU and forwarded as duplicate packets to host.		
Condition:	When a specific TCP packet with the Acknowledgement number matches with a certain pattern, the packet maybe incorrectly copied to CPU and forwarded as duplicate packet to end host.		

Parent Defect ID:	SLXOS-67007	Issue ID:	SLXOS-67375
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fa
Technology Group:	Layer 3 Routing/Network Layer	Technology:	ARP - Address Resolution Protocol
Symptom:	Some of the BFD sessions are going down		
Condition:	SRIOV ports are connected with a Leaf pair in Active-Standby mode. When the port connected to active SRIOV is shutdown, some of the BFD sessions go down.		

The following software defects were closed in 20.4.1a with code change as of May 2022:

Parent Defect ID:	SLXOS-66305	Issue ID:	SLXOS-66798
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Other	Technology:	Other
Symptom:	In 9640, other unrelated 1G ports go down when one particular 1G port is reseated.		
Condition:	In 9640, for example, if ports 0/13, 0/14, 0/16, 0/17 have 1G optics and are UP, and when 0/13 optic is reseated, 0/14 and 0/16 also go down.		

Parent Defect ID:	SLXOS-66829	Issue ID:	SLXOS-66832
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3j
Technology Group:	Layer 2 Switching	Technology:	Other
Symptom:	Switch does not allow new tag-type or TPID to be configured.		
Condition:	While trying to configure a new tag-type the node throws an error - Exceeded the system max on how many different Tag Type can be configured.		

Parent Defect ID:	SLXOS-66826	Issue ID:	SLXOS-66846
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fa

Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	BFD session state mismatch between SLX and neighbor.		
Condition:	In SLX-9740,during BFD sessions bringup.		

Parent Defect ID:	SLXOS-66426	Issue ID:	SLXOS-66855
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 2 Switching	Technology:	VLAN - Virtual LAN
Symptom:	'show interface <phy/po> switchport' output has incorrect Active VLANs after a VLAN is removed from the interface.		
Condition:	When a Vlan is added on to an interface in the order 'switchport trunk native-vlan <vlan-id>' and 'switchport trunk allowed vlan add <vlan-id>', due to cleanup issue, even after removing the vlan using 'switchport trunk allowed vlan remove <vlan-id>', vlan is still showing up in 'show interface <phy/po> switchport' output and also in LIF output associated to vlan.		

Parent Defect ID:	SLXOS-65321	Issue ID:	SLXOS-66866
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Other
Symptom:	Traffic takes more than 700 msec to converge when the port channel between the border leaf and gateway fails, and the traffic is redirected over the ICL		
Condition:	When one port channel between a border leaf and the gateway is shutdown, the traffic should switch to the ICL. This takes more than 600 msec in the S-N direction.		

Parent Defect ID:	SLXOS-66893	Issue ID:	SLXOS-66936
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2fa
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	BFD Sessions enabled stays down.		
Condition:	In SLX-9250/SLX-9150/SLX-8720, BFD Sessions over CEP interface enabled with "bfd-software-session".		

The following software defects were closed in 20.4.1 with code changes as of **April 2022**:

Parent Defect ID:	SLXOS-42488	Issue ID:	SLXOS-42488
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.1.1
Technology Group:	Other	Technology:	Other
Symptom:	"show running-config ip prefix-list <list-name>" on specific prefix-list sometimes doesnt work		
Condition:	issue is observed during highly scaled scale prefix-list configurations		

Parent Defect ID:	SLXOS-49454	Issue ID:	SLXOS-52076
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.1
Technology Group:	Management	Technology:	CLI - Command Line Interface
Symptom:	Sometimes, show running-config ip prefix-list <name> takes around 25 mins to display output		
Condition:	Issue is seen when the user is querying for a specific prefix-list while the device has highly scaled prefix list configuration		

Parent Defect ID:	SLXOS-56675	Issue ID:	SLXOS-56675
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3
Technology Group:	Other	Technology:	Other
Symptom:	WARNING message, Unqualified SFP transceiver for interface Ethernet 0/x is detected.		
Condition:	Insert 100G LR4 optic (EQPT1H4LR4LCL100) optics.		

Parent Defect ID:	SLXOS-57274	Issue ID:	SLXOS-57274
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2
Technology Group:	Management	Technology:	CLI - Command Line Interface
Symptom:	On execution of "show run route-map" command with route map name like "show run route-map <route-map-name>" it throws error.		
Condition:	Issue is seen when "show run route-map" command is invoked with route map name.		

Parent Defect ID:	SLXOS-60172	Issue ID:	SLXOS-60176
Severity:	S1 - Critical		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3ea
Technology Group:	Other	Technology:	Other
Symptom:	We may see flap of any random interface during the bootup time of the device. The device can be SLX 9740, SLX 9250, SLX 8720, SLX 9150.		
Condition:	Sometimes Port flap is seen on a device during bootup.		

Parent Defect ID:	SLXOS-61120	Issue ID:	SLXOS-61167
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3b
Technology Group:	Layer 2 Switching	Technology:	VLAN - Virtual LAN
Symptom:	Access to SLX management port is not working.		
Condition:	Ping packet drop is seen if it passes through VLAN before turning back on the mgmt. interface.		

Parent Defect ID:	SLXOS-61209	Issue ID:	SLXOS-61209
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.3
Technology Group:	Layer 2 Switching	Technology:	MCT - Multi-Chassis Trunking
Symptom:	Broadcast, unknown unicast and Multicast traffic loss		
Condition:	Remote client interface shutdown followed by no cluster-client auto and cluster-client auto under local client interface		

Parent Defect ID:	SLXOS-62256	Issue ID:	SLXOS-62256
Severity:	S1 - Critical		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.3
Technology Group:	Layer 2 Switching	Technology:	MCT - Multi-Chassis Trunking
Symptom:	CCEP Port-channel flaps		
Condition:	With more than 96 Port-channels as MCT clients, and traffic running with COS priority of 6 or 7 - when one of the MCT node is reloaded, we see some of the CCEP Port-channels flapping on other MCT node.		

Parent Defect ID:	SLXOS-62863	Issue ID:	SLXOS-62863
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	1+ sec of traffic loss is observed during a border leaf reload.		
Condition:	Reloading one of SLX-9740 border leaf's in a MCT configuration		

Parent Defect ID:	SLXOS-62230	Issue ID:	SLXOS-62998
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2c
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	On SLX 9640, BGP flaps are seen sometimes		

Condition:	In a scaled environment, and when high rate of control packets are processed on CPU, it can lead to lead loss of BGP packets.
-------------------	---

Parent Defect ID:	SLXOS-62353	Issue ID:	SLXOS-63106
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2b
Technology Group:	Layer 2 Switching	Technology:	VXLAN - Virtual Extensible LAN
Symptom:	VRF traffic loss is greater than 1sec upon spine node reboot.		
Condition:	Upon spine reboot, few BFD sessions from compute nodes to border-leaf flap and traffic loss for 1-2 sec is observed.		

Parent Defect ID:	SLXOS-63253	Issue ID:	SLXOS-63253
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 2 Switching	Technology:	MCT - Multi-Chassis Trunking
Symptom:	MCT Cluster peer-interface Port-channel flaps few times		
Condition:	On reloading one of the border leaf nodes in the MCT configuration, ICL port-channel flaps, while the reloaded node is coming online. This happens when more than 5000 BFD sessions are established over the VxLAN tunnel.		

Parent Defect ID:	SLXOS-63282	Issue ID:	SLXOS-63282
Severity:	S1 - Critical		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Monitoring	Technology:	Port Mirroring
Symptom:	On SLX 9740, flow based mirroring is not working for flow matching deny rules with the configured ACL		
Condition:	configure mirror action in deny rule , traffic matching deny rule are not mirrored.		

Parent Defect ID:	SLXOS-63289	Issue ID:	SLXOS-63289
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Monitoring	Technology:	sFlow
Symptom:	Flow based ERSPAN mirroring is not working in the ingress direction.		
Condition:	If the configured ERSPAN id is more than 255.		

Parent Defect ID:	SLXOS-63125	Issue ID:	SLXOS-63317
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3g

Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	MAC address is not updated properly when there is MAC move between MCT peer nodes multiple times.		
Condition:	In the IP fabric, the MAC move happens between the MCT peer nodes.		

Parent Defect ID:	SLXOS-63941	Issue ID:	SLXOS-63960
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2bb
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Unexpected reload of the switch		
Condition:	During the SNMP walk with 1 M routes learnt from real internet feed, when any route among the learnt routes has a longer BGP AS path attribute.		

Parent Defect ID:	SLXOS-63974	Issue ID:	SLXOS-63978
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3g
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	BGP flaps could be seen during high scale of BGP packets to CPU if it hits threshold rate-limit.		
Condition:	BGP flaps could be seen during high scale of BGP packets to CPU if it hits threshold rate-limit.		

Parent Defect ID:	SLXOS-62922	Issue ID:	SLXOS-64002
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2d
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Some IPV4 BGP sessions gets deleted only after BGP hold timer expires even though BFD has gone down		
Condition:	When configuring with Extreme Fabric Automation(EFA), and EPG(End Point Group) is removed in the local node. Issue in the symptom is seen on the remote node.		

Parent Defect ID:	SLXOS-64007	Issue ID:	SLXOS-64083
Severity:	S2 - Major		

Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2b
Technology Group:	Layer 2 Switching	Technology:	MCT - Multi-Chassis Trunking
Symptom:	Port-channel interfaces stay down		
Condition:	On a 8720 MCT, when one of the MCT leaf reloads, port-channel interfaces stay down on one end, as the LACP packets are not being received.		

Parent Defect ID:	SLXOS-64022	Issue ID:	SLXOS-64090
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	MAC address is not updated properly when there is MAC move between MCT peer nodes multiple times.		
Condition:	In the IP fabric, the MAC move happens between the MCT peer nodes.		

Parent Defect ID:	SLXOS-63334	Issue ID:	SLXOS-64111
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00j
Technology Group:	MPLS	Technology:	MPLS VLL - Virtual Leased Line
Symptom:	User may experiences one way traffic over VLL usually during failover to bypass path.		
Condition:	Rarely, hardware fails to delete transit cross-connect, and hardware continues to have stale Label in MPLS forwarding table.		

Parent Defect ID:	SLXOS-64141	Issue ID:	SLXOS-64145
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2d
Technology Group:	Management	Technology:	Other
Symptom:	In case, when file replay takes place during reboot of the switch and the configuration file contains CLI for Maintenance Mode - "enable-on-reboot", then log "RASLOG SMAN-1004" is generated twice. This indicates system is entering into maintenance Mode.		
Condition:	During system reload, when the configuration file replay takes place as in case of "full-install"		

Parent Defect ID:	SLXOS-63036	Issue ID:	SLXOS-64417
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2b

Technology Group:	Management	Technology:	SNMP - Simple Network Management Protocol
Symptom:	During bootup, SNMP traps for link status of VE and loopback interfaces are sent even when "snmp trap lnk-status disable" is configured for the interfaces		
Condition:	Issue is seen only during bootup for VE and loopback interfaces that are not shutdown.		

Parent Defect ID:	SLXOS-64508	Issue ID:	SLXOS-64516
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 2 Switching	Technology:	VXLAN - Virtual Extensible LAN
Symptom:	Broadcast storm across IP Fabric caused by BUM traffic flooding due to Layer 2 loop		
Condition:	Adding another MCT pair into the exiting IP Fabric		

Parent Defect ID:	SLXOS-60949	Issue ID:	SLXOS-64600
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00h
Technology Group:	Other	Technology:	Other
Symptom:	Tx Errors observed on interfaces		
Condition:	<p>Following different conditions are required to see this issue</p> <ul style="list-style-type: none"> • oTraffic type • mixed traffic with jumbo frame sizes • Tunneled traffic of MPLS and VPLS • Ingress normal - egress tunneled traffic • Egress port-channels • QoS Port-Speed-Up command configured on the Port-Channels with the max allowed limit 		

Parent Defect ID:	SLXOS-64668	Issue ID:	SLXOS-64673
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3c_CVR
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	During loop condition, BGP TTL1 packets maybe dropped.		
Condition:	During loop condition, BGP control packets may be classified as TTL1 packets and they are processed from Exception queue and maybe dropped once the threshold is reached.		

Parent Defect ID:	SLXOS-64669	Issue ID:	SLXOS-64677
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3c_CVR
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	BGP sessions may flap due to high rate of incoming BGP packets with TTL value 1.		
Condition:	BGP control packets with TTL value 1 may be dropped due to incorrect CPU queue classification with lower rate-limit of 100 pps for BGP protocols packets.		

Parent Defect ID:	SLXOS-64690	Issue ID:	SLXOS-64711
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2c
Technology Group:	Other	Technology:	Other
Symptom:	Tx Errors observed on interfaces continuously incrementing at a significant number when monitored over a 24 hour period		
Condition:	<p>Following different conditions are required to see this issue</p> <ul style="list-style-type: none"> • oTraffic type • mixed traffic with jumbo frame sizes • Tunneled traffic of MPLS and VPLS • Ingress normal - egress tunneled traffic • Egress port-channels • QoS Port-Speed-Up command configured on the Port-Channels with the max allowed limit 		

Parent Defect ID:	SLXOS-64211	Issue ID:	SLXOS-64722
Severity:	S2 – Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3d
Technology Group:	Layer 2 Switching	Technology:	LAG - Link Aggregation Group
Symptom:	Physical Port Laser was not turned OFF when port is made down.		
Condition:	When FEC is configured, physical port Laser was not turned OFF when port is made down		

Parent Defect ID:	SLXOS-64678	Issue ID:	SLXOS-64791
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	In 9250/9150/8720/8520 BFD sessions in MCT secondary border leaf node may flap.		

Condition:	While MCT primary border leaf node's cluster comes up after reload.
-------------------	---

Parent Defect ID:	SLXOS-64803	Issue ID:	SLXOS-64844
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4a
Technology Group:	Layer 2 Switching	Technology:	LAG - Link Aggregation Group
Symptom:	LACP LAG continuously flaps with reason 'timeout' or 'peer-out-of-sync'.		
Condition:	When native VLAN is used in the range of 768 to 1023 on port-channel, with 'no switchport tag native' on SLX-9150/9250, port-channel may flap.		

Parent Defect ID:	SLXOS-64706	Issue ID:	SLXOS-64848
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2b
Technology Group:	Layer 2 Switching	Technology:	VXLAN - Virtual Extensible LAN
Symptom:	ARP/NDs are not resolved for the hosts reachable through one particular VxLAN tunnel (14th tunnel created - Tunnel 32785) in IP Fabric topology.		
Condition:	BUM traffic from Tunnel 32785 is being wrongly interpreted as ICL BUM traffic, and getting dropped at CCEP ports, which is leading to the failure of ARP/ND. Moreover this wrong mapping can cause BUM flooding to fabric side also.		

Parent Defect ID:	SLXOS-64941	Issue ID:	SLXOS-64941
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.3
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	SNMP OID extremeBgp4V2PrefixInPrefixes shows "Routes Accepted/Installed + Filtered"		
Condition:	extremeBgp4V2PrefixInPrefixes value is not accurate/confusing, when Filtered value is more than actual received routes.		

Parent Defect ID:	SLXOS-64244	Issue ID:	SLXOS-64951
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2c
Technology Group:	Layer 2 Switching	Technology:	UDLD - Uni-Directional Link Detection

Symptom:	UDLD will not come-up between CE(slx) routers across mpls vll networks as UDLD pkts get dropped on transient SLX routers.
Condition:	UDLD will not come-up between CE(slx) routers across mpls vll networks as UDLD pkts get dropped on transient SLX routers(9540/9640/9850).

Parent Defect ID:	SLXOS-64594	Issue ID:	SLXOS-64979
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3g
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Other
Symptom:	May notice traffic latency between end customers and data packets looks lifted to CPU on transit node for processing.		
Condition:	This issue may be seen only on MCT configured topology on SLX 9540 and SLX 9640.		

Parent Defect ID:	SLXOS-64048	Issue ID:	SLXOS-65198
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3g
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Other
Symptom:	May notice traffic latency between end customers and data packets looks lifted to CPU on transit node for processing.		
Condition:	This issue maybe seen only on MCT configured topology on SLX 9540 and SLX 9640.		

Parent Defect ID:	SLXOS-64855	Issue ID:	SLXOS-65254
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Security	Technology:	AAA - Authentication, Authorization, and Accounting
Symptom:	REST query for show-system-monitor fails		
Condition:	REST query for show-system-monitor from non-admin user		

Parent Defect ID:	SLXOS-64688	Issue ID:	SLXOS-65273
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 3 Routing/Network Layer	Technology:	ARP - Address Resolution Protocol

Symptom:	When the port channel from an MCT node to the CCEP client goes down, the ping to the CCEP client fails, even though there is a path to the CCEP client through the ICL and the other MCT node.
Condition:	<p>There is a CCEP client (Linux box) connected to a pair of MCT nodes through a port channel. A server is able to ping the client through the MCT node-1 and the port channel.</p> <p>When the port channel is shutdown at MCT node-1, the expectation is that the packet will be sent to MCT node-2 through ICL and to the client from there. But it was found the packet was getting dropped at MCT node-2 because it was going over the ICL as a VLAN tagged packet.</p> <p>This is applicable to SLX 9640 and SLX 9540.</p>

Parent Defect ID:	SLXOS-64585	Issue ID:	SLXOS-65277
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Management	Technology:	Configuration Fundamentals
Symptom:	DCMD module reboot was observed when deletion of VRF configuration was in progress and simultaneously request was made to read the configuration via REST.		
Condition:	The issue was seen during deletion of VRF configuration and simultaneously request was made to read the configuration via REST. This issue was seen rarely.		

Parent Defect ID:	SLXOS-65380	Issue ID:	SLXOS-65405
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4a
Technology Group:	Other	Technology:	Other
Symptom:	DNX entry for TPVM is missing after device reload with running TPVM		
Condition:	Issue is observed after device reload with running tpvm dnx entries		

Parent Defect ID:	SLXOS-65398	Issue ID:	SLXOS-65426
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 2 Switching	Technology:	VLAN - Virtual LAN
Symptom:	<p>End point group (EPG) configuration from EFA fails to create new Bridge domain (BD) logical interfaces (LIF) as the system reached maximum allowed Attachment Circuit (AC) LIF scale.</p> <p>EFA displays the following error: %Error: Config not allowed as it will exceed system max allowed AC LIFs..', Error : EndpointGroup Creation failed</p>		

Condition:	BD LIF creation beyond 9087 number fails with error code. This fix allows BD LIF scale to grow till 11,647 limit.
-------------------	--

Parent Defect ID:	SLXOS-64783	Issue ID:	SLXOS-66047
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3g
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Other
Symptom:	Traceroute command output not showing response time for some intermediate hops.		
Condition:	Traceroute command output not showing response time for some intermediate hops when destination is reachable via non-management VRF		

Parent Defect ID:	SLXOS-66123	Issue ID:	SLXOS-66136
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2d
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	Unexpected reload of router		
Condition:	Unexpected reload of router when BFD sessions are flapped.		

Parent Defect ID:	SLXOS-64995	Issue ID:	SLXOS-66153
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2b
Technology Group:	Layer 3 Routing/Network Layer	Technology:	ARP - Address Resolution Protocol
Symptom:	Some of the BFD sessions are going down		
Condition:	SRIOV ports are connected with Leaf pair in Active-Standby mode. Reload of the Leaf with active SRIOV port causes some of the BFD sessions to go down.		

Parent Defect ID:	SLXOS-66145	Issue ID:	SLXOS-66157
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4a
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	Unexpected reload of router		
Condition:	Router unexpectedly reloaded with BFD session flap.		

Parent Defect ID:	SLXOS-66161	Issue ID:	SLXOS-66197
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4ab
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	Unexpected reload of router		
Condition:	Unexpected reload of router with BFD configuration		

Parent Defect ID:	SLXOS-63139	Issue ID:	SLXOS-66229
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3g
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Other
Symptom:	Traceroute command output not showing response time for some intermediate hops.		
Condition:	Traceroute command output not showing response time for some intermediate hops when destination is reachable via non-management VRF.		

Parent Defect ID:	SLXOS-66244	Issue ID:	SLXOS-66253
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4ab
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Other
Symptom:	Traffic was getting dropped for one or a few VLANs after restoring from EFA config backup		
Condition:	The customer made an EFA backup. Removed a VRF configuration. Restored the EFA backup.		

Parent Defect ID:	SLXOS-64586	Issue ID:	SLXOS-66261
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2b
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	During loop condition, BGP TTL1 packets maybe dropped.		
Condition:	During loop condition, BGP control packets may be classified as TTL1 packets and they are processed from Exception queue and maybe dropped once the threshold is reached.		

Parent Defect ID:	SLXOS-62785	Issue ID:	SLXOS-66398
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2d
Technology Group:	Layer 3 Routing/Network Layer	Technology:	Other
Symptom:	Traffic loss of 2+ seconds observed in border leaf device.		
Condition:	When gateway link failover happens, traffic loss was observed in border leaf.		

Parent Defect ID:	SLXOS-66399	Issue ID:	SLXOS-66403
Severity:	S3 - Moderate		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	Default debug level of BFD is displayed.		
Condition:	On executing show debug all		

Parent Defect ID:	SLXOS-66687	Issue ID:	SLXOS-66687
Severity:	S2 - Major		
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Security	Technology:	HTTP/HTTPS
Symptom:	HTTP server is not accepting the connections and HTTP connection is refused.		
Condition:	HTTP server is not accepting the connections during EFA configuration, or while adding to the device to the EFA fabric in the EFA.		

Defects Closed without Code Changes

The following software defects were closed in 20.4.1a without code changes as of May 2022.

Parent Defect ID:	SLXOS-66740	Issue ID:	SLXOS-66797
Reason Code:	Not Reproducible	Severity:	S2 - Major
Product:	SLX-OS	Reported in Release:	SLX-OS 20.4.1
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	BFD daemon reboot may be seen.		
Condition:	Multiple times add and remove of EPGs from EFA.		

The following software defects were closed in 20.4.1 without code changes as of **April 2022**.

Parent Defect ID:	SLXOS-46276	Issue ID:	SLXOS-46276
Reason Code:	Not Reproducible	Severity:	S2 - Major
Product:	SLX-OS	Reported in Release:	SLX-OS 20.1.1
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	The remote end tunnel retains old VTEP IP when VTEP IP is changed at the local end		
Condition:	When tunnel VTEP IP is changed locally, some of the evpn IMR routes for old VTEP IP are not withdrawn. Hence old tunnel exists at remote end.		
Workaround:	When VTEP IP is modified, please issue "clear bgp evpn neighbor all"		

Parent Defect ID:	SLXOS-46419	Issue ID:	SLXOS-46419
Reason Code:	Not Reproducible	Severity:	S3 - Moderate
Product:	SLX-OS	Reported in Release:	SLX-OS 20.1.1
Technology Group:	Monitoring	Technology:	Port Mirroring
Symptom:	QoS service-policy configuration is not allowed on a mirror destination port-channel.		
Condition:	Configure a port-channel as mirror destination and configure a service-policy under this port-channel.		
Workaround:	Remove mirror configuration and add service-policy under this port-channel. Reconfigure mirror session with this port-channel as mirror destination.		

Parent Defect ID:	SLXOS-47644	Issue ID:	SLXOS-47644
Reason Code:	Not Reproducible	Severity:	S2 - Major
Product:	SLX-OS	Reported in Release:	SLX-OS 20.1.1

Technology Group:	Security	Technology:	ACLs - Access Control Lists
Symptom:	OSPF neighbourship doesn't go down after applying IP ACL on the interface		
Condition:	Applying IP ACL after OSPF neighbourship up.		
Workaround:	Clear OSPF neighbourship after IP ACL applied.		

Parent Defect ID:	SLXOS-52329	Issue ID:	SLXOS-52329
Reason Code:	Will Not Fix	Severity:	S2 - Major
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.1a
Technology Group:	IP Multicast	Technology:	IGMP - Internet Group Management Protocol
Symptom:	The IGMP querier node does not receive IGMP joins on Multicast tunnel even though there are receivers present on other LVTEP. This causes IGMP group entry expiry after the time-out.		
Condition:	<ol style="list-style-type: none"> 1. There should be MCT nodes acting as a leaf (LVTEP) and receiver should be connected to CCEP client or CEP port. 2. The MDT Rx path is on one MCT peer and MDT Tx path is on other MCT peer. 3. IGMP Query should be received on Multicast tunnel. 4. IGMP report should land on the peer which is having MDT Rx path. 		
Workaround:	If Source or Receiver is connected to one of the MCT nodes, then it is recommended to configure IGMP snooping querier for the vlan or Bridge domain on both the MCT peers.		

Parent Defect ID:	SLXOS-52506	Issue ID:	SLXOS-52506
Reason Code:	Will Not Fix	Severity:	S2 - Major
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.1a
Technology Group:	Management	Technology:	Other
Symptom:	Netconf request to configure ip prefix-list without providing sequence number fails and returns error.		
Condition:	Issue exists only for configuration via Netconf		
Workaround:	Workaround is to provide sequence number value in the Netconf request while configuring ip prefix-list		

Parent Defect ID:	SLXOS-56861	Issue ID:	SLXOS-56861
Reason Code:	Not Reproducible	Severity:	S3 - Moderate
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.2
Technology Group:	Other	Technology:	Other
Symptom:	Sometimes, a unrelated interface can go down when an optic is inserted.		
Condition:	A new optic is inserted in SLX 9740.		

Parent Defect ID:	SLXOS-60682	Issue ID:	SLXOS-60682
Reason Code:	Network Tuning	Severity:	S3 - Moderate
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.1
Technology Group:	Other	Technology:	Other
Symptom:	Interface Link flap is observed.		
Condition:	Speed is configured on the interface		

Parent Defect ID:	SLXOS-60951	Issue ID:	SLXOS-61576
Reason Code:	Design Limitation	Severity:	S3 - Moderate
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3e
Technology Group:	Layer 2 Switching	Technology:	LAG - Link Aggregation Group
Symptom:	MAC address of port-channel INTF changes when system is reloaded after performing un-config and then config of port channel interfaces.		
Condition:	MAC address of port channel interfaces change in below two cases; 1. Without reload - Port-channel interfaces are configured. Some of the port-channel interfaces are un-configured, and configured again without any specific sequence. 2. Port-channel Interfaces config and un-config is done without any particular sequence. Then config is saved and system is reloaded.		
Workaround:	For SLX 9540, SLX 9640 and SLX 9740, Some number of port-channel INTF can be created in the incremental order interface index. (say , port-channel 1, then port-channel 2, ..., then port-channel 10). Now, config can be saved, and these port-channel are kind or reserved for future use. With these steps followed, MAC address of port-channel interfaces will not change with reload as well.		

Parent Defect ID:	SLXOS-61371	Issue ID:	SLXOS-62218
Reason Code:	Network Tuning	Severity:	S2 - Major
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2
Technology Group:	Other	Technology:	Other
Symptom:	On SLX 9740, and breakout port cli command on a port-macro group, can cause other ports in same group to flap sometimes.		
Condition:	Issue is seen when the breakout command is configured.		

Parent Defect ID:	SLXOS-62270	Issue ID:	SLXOS-62361
Reason Code:	Not Reproducible	Severity:	S3 - Moderate
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2c
Technology Group:	Monitoring	Technology:	Port Mirroring
Symptom:	When VLAN is configured as source in monitor session , mirroring stops working after rebooting device		
Condition:	Configure flow based mirroring session with VLAN as source		
Workaround:	1)Delete Monitor configuration 2)Remove the ACL binding from the VLAN interface		

	3)Configure monitor session with VLAN as source 4)Bind L2 ACL on the VLAN interface.
--	---

Parent Defect ID:	SLXOS-62507	Issue ID:	SLXOS-62712
Reason Code:	Not Reproducible	Severity:	S2 - Major
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.2c
Technology Group:	Layer 2 Switching	Technology:	VXLAN - Virtual Extensible LAN
Symptom:	HSLagt daemon crash		
Condition:	HSLagt daemon termination is seen when VxLAN tunnel creation and deletion operations happen at very quick interval		

Parent Defect ID:	SLXOS-60455	Issue ID:	SLXOS-62870
Reason Code:	Feature/Function Not Supported	Severity:	S3 - Moderate
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00ch
Technology Group:	Layer 2 Switching	Technology:	xSTP - Spanning Tree Protocols
Symptom:	RPVST flaps on SLX device		
Condition:	when root bridge change occurs without any user intervention		

Parent Defect ID:	SLXOS-62690	Issue ID:	SLXOS-62986
Reason Code:	Insufficient Information	Severity:	S3 - Moderate
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3d
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	BGP session is down on SLX device		
Condition:	Interface down on SLX due to failure on the LACP BPDU's. This will lead to BGP session down.		

Parent Defect ID:	SLXOS-61558	Issue ID:	SLXOS-62992
Reason Code:	Insufficient Information	Severity:	S2 - Major
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3d
Technology Group:	Management	Technology:	Other
Symptom:	Occasional TPVM CPU spike above 90% noticed for 1-2 sec.		
Condition:	Collecting EFA support-save on TPVM.		

Parent Defect ID:	SLXOS-62722	Issue ID:	SLXOS-63001
Reason Code:	Feature/Function Not Supported	Severity:	S2 - Major

Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3c
Technology Group:	Traffic Management	Technology:	QoS - Quality of Service
Symptom:	Packets are egressing with DSCP value as 0 value, irrespective of incoming DSCP value.		
Condition:	In IP fabric environment, packets ingress at the SLX 9150 leaf switch with non-zero DSCP values and egress the SLX 9250 border leaf switch.		

Parent Defect ID:	SLXOS-62849	Issue ID:	SLXOS-63004
Reason Code:	Working as Designed	Severity:	S2 - Major
Product:	SLX-OS	Reported in Release:	SLX-OS 20.2.3g
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	May experience 20-60 seconds of traffic loss.		
Condition:	On BGP re-convergence on network with below scale values, where 873k+ bgp ipv4 routes + 136k+ bgp ipv6 routes made to switch other path because of manual shut on working path.		

Parent Defect ID:	SLXOS-62093	Issue ID:	SLXOS-63015
Reason Code:	Insufficient Information	Severity:	S3 - Moderate
Product:	SLX-OS	Reported in Release:	SLX-OS 20.1.2f
Technology Group:	Layer 3 Routing/Network Layer	Technology:	BFD - BiDirectional Forwarding Detection
Symptom:	SLX stops forwarding the Traffic after the unexpected reload		
Condition:	BGP is configured on a SLX node. While processing the BGP packets, sometimes the switch reloads.		
Recovery:	Power cycle the switch.		

Parent Defect ID:	SLXOS-60943	Issue ID:	SLXOS-63018
Reason Code:	Feature/Function Not Supported	Severity:	S3 - Moderate
Product:	SLX-OS	Reported in Release:	SLX-OS 20.1.2g
Technology Group:	Monitoring	Technology:	sFlow
Symptom:	Sflow collector is configured for user vrf		
Condition:	Sflow sample reaching sflow collector via default vrf.		

Parent Defect ID:	SLXOS-63092	Issue ID:	SLXOS-63092
Reason Code:	Not Reproducible	Severity:	S2 - Major
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4

Technology Group:	Layer 3 Routing/Network Layer	Technology:	BGP4 - IPv4 Border Gateway Protocol
Symptom:	Convergence times of upto 800 msec is seen when an interface from the Gateway towards the Border Leaf is shut down		
Condition:	<p>There is a port channel between PE router and the Border leaf. The minimum-links is configured in the port channel. One of the physical interfaces in the port channel is shut and the minimum-link configuration brings down the port channel.</p> <p>The convergence time for the traffic from the border leaf towards the gateway is sometimes seen to be in the range of 500-800 msec.</p>		
Workaround:	Using only BGP routes and configuring Prefix-Independent-Convergence can provide better convergence times than having static routes.		

Parent Defect ID:	SLXOS-63115	Issue ID:	SLXOS-63115
Reason Code:	Already Reported	Severity:	S2 - Major
Product:	SLX-OS	Reported in Release:	SLX-OS 20.3.4
Technology Group:	Security	Technology:	ACLs - Access Control Lists
Symptom:	On SLX 9740, Ingress ipv6 access-list counters do not increment in ipv6-optimised tcam profile		
Condition:	User has configured to use ipv6-optimised tcam profile and has configured counters for matching ipv6 access-list rules. Issued "clear counters" cli command.		

Parent Defect ID:	SLXOS-62135	Issue ID:	SLXOS-64196
Reason Code:	Already Implemented	Severity:	S3 - Moderate
Product:	SLX-OS	Reported in Release:	SLX-OS 18r.1.00b
Technology Group:	Monitoring	Technology:	RAS - Reliability, Availability, and Serviceability
Symptom:	Logs indicating flash size usage crossing high boundary		
Condition:	/var/log/hasm.log file size is large, with no impact on functionality		