

Customer Release Notes

ExtremeWireless™ Convergence Software

Software Version 10.51.24.0003

Nov 30, 2022

INTRODUCTION:

This document provides specific information for this version of software for the ExtremeWireless™ Convergence Software.

Extreme Networks recommends that you thoroughly review this document prior to installing or upgrading this product.

**For the latest firmware versions, visit the download site at:
<https://extremeportal.force.com/>**

FIRMWARE SPECIFICATION:

Status	Version No.	Type	Release Date
Current Version	10.51.24.0003	Maintenance Release	Nov 30, 2022
Previous Version	10.51.23.0003	Maintenance Release	Aug 05, 2022
Previous Version	10.51.22.0004	Maintenance Release	May 24, 2022
Previous Version	10.51.21.0002	Maintenance Release	Nov 25, 2021
Previous Version	10.51.20.0003	Maintenance Release	July 29, 2021
Previous Version	10.51.19.0001	Maintenance Release	June 14, 2021
Previous Version	10.51.18.0002	Maintenance Release	May 7, 2021
Previous Version	10.51.17.0006	Maintenance Release	November 23, 2020
Previous Version	10.51.16.0003	Maintenance Release	September 30, 2020
Previous Version	10.51.15.0002	Maintenance Release	July 24, 2020
Previous Version	10.51.14.0005	Maintenance Release	June 19, 2020
Previous Version	10.51.13.0003	Maintenance Release	May 6, 2020
Previous Version	10.51.12.0003	Maintenance Release	March 12, 2020
Previous Version	10.51.11.0002	Maintenance Release	February 21, 2020
Previous Version	10.51.10.0006	Maintenance Release	December 6, 2019

Status	Version No.	Type	Release Date
Previous Version	10.51.09.0008	Maintenance Release	October 25, 2019
Previous Version	10.51.08.0004	Maintenance Release	September 20, 2019
Previous Version	10.51.07.0006	Maintenance Release	August 19, 2019
Previous Version	10.51.06.0003	Maintenance Release	July 19, 2019
Previous Version	10.51.05.0005	Maintenance Release	June 14, 2019
Previous Version	10.51.04.0009	Maintenance Release	May 23, 2019
Previous Version	10.51.03.0002	Maintenance Release	April 24, 2019
Previous Version	10.51.02.0006	Maintenance Release	April 17, 2019
Do not use	10.51.01.0100	Patch Release	March 20, 2019
Do not use	10.51.01.0097	Minor Feature Release	March 1, 2019
Previous Version	10.41.13.0008	Maintenance Release	January 25, 2019
Previous Version	10.41.12.0006	Maintenance Release	December 6, 2018
Previous Version	10.41.11.0009	Maintenance Release	November 9, 2018
Previous Version	10.41.10.0014	Maintenance Release	September 13, 2018
Previous Version	10.41.09.0008	Maintenance Release	August 2, 2018
Previous Version	10.41.08.0012	Maintenance Release	June 22, 2018
Previous Version	10.41.07.0014	Maintenance Release	May 11, 2018
Previous Version	10.41.06.0013	Maintenance Release	April 9, 2018
Previous Version	10.41.05.0010	Maintenance Release	March 9, 2018
Previous Version	10.41.04.0002	Maintenance Release	February 13, 2018
Previous Version	10.41.03.0012	Maintenance Release	February 2, 2018
Previous Version	10.41.02.0014	Maintenance Release	November 24, 2017
Previous Version	10.41.01.0082	Patch release	November 3, 2017
Previous Version	10.41.01.0080	Minor Feature Release	September 29, 2017
Previous Version	10.31.06.0007	Maintenance Release	October 5, 2017
Previous Version	10.31.05.0003	Maintenance Release	August 18, 2017
Previous Version	10.31.04.0009	Maintenance Release	July 21, 2017
Previous Version	10.31.03.0012	Maintenance Release	June 9, 2017
Previous Version	10.31.02.0007	Maintenance Release	May 5, 2017

Status	Version No.	Type	Release Date
Previous Version	10.31.01.0048	Minor Feature Release	March 29, 2017
Previous Version	10.21.03.0010	Maintenance Release	March 6, 2017
Previous Version	10.21.02.0017	Maintenance Release	January 27, 2017
Previous Version	10.21.01.0065	Minor Feature Release	December 7, 2016
Previous Version	10.11.05.0005	Maintenance Release	December 2, 2016
Previous Version	10.11.04.0008	Maintenance Release	October 28, 2016
Previous Version	10.11.03.0004	Maintenance Release	September 19, 2016
Previous Version	10.11.02.0032	Maintenance Release	August 15, 2016
Previous Version	10.11.01.0210	Minor Feature Release	June 29, 2016
Previous Version	10.01.05.0008	Maintenance Release	June 3, 2016
Previous Version	10.01.04.0011	Maintenance Release	April 22, 2016
Previous Version	10.01.03.0007	Maintenance Release	March 7, 2016
Previous Version	10.01.02.0038	Maintenance Release	February 2, 2016
Previous Version	10.01.01.0129	Major Feature Release	December 11, 2015

SUPPORTED CONTROLLERS AND ACCESS POINTS

This ExtremeWireless™ Convergence Software version supports the following controllers and access points:

Product	Image
ExtremeWireless Controller C5215	AV-MV-10.51.24.0003.ice
ExtremeWireless Controller C5210	AV-MV-10.51.24.0003.rue
ExtremeWireless Controller C35	AV-MV-10.51.24.0003.cwe
ExtremeWireless Virtual Appliance V2110 VMware	AV-MV-10.51.24.0003.bge
ExtremeWireless Virtual Appliance V2110 MS Hyper-V	AV-MV-10.51.24.0003.ize
Wireless AP3917i-FCC Wireless AP3917i-ROW Wireless AP3917e-FCC Wireless AP3917e-ROW Wireless AP3917k-FCC Wireless AP3917k-ROW	AP391x-10.51.24.0003.img
Wireless AP3916ic-FCC Wireless AP3916ic-ROW	

Wireless AP3915i-FCC Wireless AP3915i-ROW Wireless AP3915e-FCC Wireless AP3915e-ROW	
Wireless AP3912i-FCC Wireless AP3912i-ROW	
AP3916-camera	AP3916IC-V1-0-14-1.dlf
Wireless AP3935i-FCC Wireless AP3935e-FCC Wireless AP3935i-ROW Wireless AP3935e-ROW	AP3935-10.51.24.0003 .img
Wireless AP3965i-FCC Wireless AP3965e-FCC Wireless AP3965i-ROW Wireless AP3965e-ROW	
Wireless AP3801i	AP3801-10.51.24.0003 .img
Wireless AP3805i Wireless AP3805e Wireless AP3805i-FCC Wireless AP3805i-ROW	AP3805-10.51.24.0003 .img
Wireless AP3825i Wireless AP3825e	AP3825-10.51.24.0003 .img
Wireless AP3865e	
End of SW Support since Dec 31, 2018	
Wireless AP3705i	AP3705-10.41.12.0006 .img
Wireless AP3710i Wireless AP3710e	AP3710-10.41.12.0006 .img
Wireless AP3715i Wireless AP3715e	AP3715-10.41.12.0006 .img
Wireless AP3765i Wireless AP3765e	W78XC-2-10.41.12.0006 .img
Wireless AP3767e	
Scalance W788C	
Scalance W786C	

INSTALLATION INFORMATION

Note: Extreme Networks strongly recommends that you create a rescue image (perform a backup operation) before upgrading your controller as described in the *Maintenance Guide*.

Installation Notes

- The minimum system software version is 09.21.18 to upgrade to this software version.
- After upgrading to V10.51.01 or V10.41.02 from a release earlier than V10.11.02, users with IPv4 networks will see the following changes to their Ipv4/Ipv6 traffic:
 - a) Users with Bridged at AP deployment: Before upgrade, Bridged at AP allowed all unicast Ipv6 and multicast Ipv6 traffic on the network (unless the user had an explicit rule to stop the unicast Ipv6). After upgrading to V10.51.01 or V10.41.01/10.41.02, ALL unicast Ipv6 traffic will continue to be allowed, but multicast IPV6 traffic will be denied – Except multicast Ipv6 Router Solicitation (RS), Neighbor Solicitation (NS), and Neighbor Advertisement (NA) will be allowed.
If the user wants to have the identical behavior as pre-V10.41.01, i.e. allow multicast IPV6 traffic, the user can add a multicast Ipv6 “allow all” rule to the multicast rules.
 - b) Users with Bridged at Controller deployment: Before upgrade, Bridged at Controller denied all Ipv6 traffic (unicast and multicast). After upgrading to V10.51.01 or V10.41.01/10.41.02, ALL Ipv6 unicast traffic and multicast RS/NS/NA traffic will be allowed. All other multicast traffic will be denied.
If the user wants to have almost identical behavior as pre-V10.41.01, the user can add a unicast Ipv6 “deny all” rule. There is no mechanism/rule to stop multicast RS/NS/NA traffic.
- It is possible that some client devices will not handle frames properly when the L2 MAC is unicast and the L3 IP address is multicast. In this case, the “Multicast to Unicast Delivery” option should be disabled.
- The V2110 is supported on ESXi version 5.5, 6.0, 6.5, and 6.7. For best performance and lowest latency, the MMU and CPU should support hardware virtualization such as the Intel EP-T & VT-x or AMD AMD-V & RTI.
- The following advanced features are supported on vSphere 5.5:
 - vSphere High Availability (HA). Release 9.12.01 Added support for vSphere application level HA monitoring. This provides protection comparable to that offered by the hardware watchdog timer on the hardware wireless controllers.
 - vSphere vMotion. vMotion involves moving a running virtual machine (VM) from one host to another within a cluster with minimal or no service interruption.
 - vSphere Dynamic Resource Scheduling (DRS) and Dynamic Power Management (DPM). These features monitor host utilization and use vMotion to migrate VMs to different hosts based on power management and resource utilization goals.
 - Storage vMotion. Storage vMotion allows the administrator to move a VM’s disks to different host servers while the VM is running.
 - Cold migration – The V2110 supports cold migration subject to the requirement that the V2110 is migrated in a shutdown state not in a suspended state.
 - Distributed Virtual Switches (DVS). A DVS is a virtual switch that spans multiple physical hosts. VMs migrated between hosts sharing a DVS retain their network point of presence and addresses. Customers who expect to vMotion V2110s frequently should deploy DVSs if possible.
 - The V2110 has supported the virtual serial port and virtual serial port concentrator features since its first release. VMware requires that the customer purchase a license to use this feature.
 - V2110 does not support the vSphere Fault Tolerance feature. This feature is only available to VMs that require only one virtual core. This is a VMware restriction. The V2110 is supported on ESXi version 5.5, 6.0 and 6.5. For best performance and lowest latency, the MMU and CPU should support hardware virtualization such as the Intel EP-T & VT-x or AMD AMD-V & RTI.

- If configuring a service that will incur topology changes after the user gets an IP address via DHCP, for example due to authentication state, it is recommended to use short lease times on the initial topology (un-auth topology) so that clients automatically re-negotiate a new address faster (typically at half-lease). Alternatively, it may be required to manually renew the DHCP lease from the client.
- Add filter rule “In Filter:dest, Out Filter:src, 0.0.0.0/0, port:BootP(67), Protocol:UDP, allow” in non-authenticated policy for captive portal WLAN Service if you intend to allow wireless clients to get an IP address through DHCP.
- If the filters used by controllers are managed by Policy Manager (PM), PM should include the DHCP allow rule in the policies where that is appropriate. If PM has not done this, then it will need to explicitly add the rule to policies that are pushed to the controller and that need to support DHCP.
- IP Broadcast Multicast traffic will apply catch-all role action. To allow specific multicast, broadcast, and subnet broadcast traffic with the deny-all catch-all filter rule for global default policy, explicitly add specific multicast, broadcast and subnet broadcast rules one by one to allow that traffic.
- \, ‘, “ characters are not supported in WLAN/VNS fields.
- When upgrading to V10.XX, if an existing VNS has WMM disabled, only legacy clients will be serviced until WMM is enabled.
- For Aps with dual Ethernet ports, both interfaces need to be connected to the same subnet/VLAN for Link Aggregation.
- **Note: End of Software Support**
 - AP3710, AP3765, AP3767 reached End of SW Support on July 31, 2018 (under both 9.21 and 10.xx)
 - AP3705 and AP 3715 reached End of SW Support on Dec 31, 2018 (under both 9.21 and 10.xx)
 - C25, C4110-1, C4110-2, C5110-1, and C5110-2 reached on Dec 31, 2018 (under both 9.21 and 10.xx). No features or bug fixes (controller related) will be considered.
- **Note: End of Software Support**

Since the End of SW support dates have passed for AP37xx in December 2018, there will be no further features or bug fixes for the AP37xx platform. However, the AP37xx will continue to register to the V10.41 Controller. As a result, the following will be the last supported images for AP37xx:

 - AP3705-10.41.12.0006.img
 - AP3710-10.41.12.0006.img
 - AP3715-10.41.12.0006.img
 - W78XC-2-10.41.12.0006.img

Again, these AP37xx will be accepted on discovery (controller in 10.51.01 or 10.41.xx) and will work as is. No features or bug fixes will be considered.



Upgrading Virtual Appliance V2110 VMware to the Current Release

It is MANDATORY that before upgrading to v10.11.xx, 10.21.xx, 10.31.xx, 10.41.01 and 10.51.01 the “SCSI controller” setting for the VMware virtual controller (V2110) is set to “Paravirtual”

You only need to install the “.ova” file when you first install the V2110 VMware. The latest .ova file is V2110-10.41.02.0014.ova. All subsequent upgrades can be performed using the standard controller upgrade procedure to apply a “.bge” file to the V2110 VMware.

For more information about installing the V2110 VMware, refer to the “ExtremeWireless V2110 Virtual Appliance Installation Guide VMware platform”.

For more information about upgrading the V2110 VMware, refer to the “ExtremeWireless Maintenance Guide”.

Upgrading V2110 Virtual Appliance V2110 MS Hyper-V to the Current Release

For any v10.xx – V2110 deployments on Hyper-V with Intel/AMD CPUs, the CPUs must support the SSSE3 instruction set. Failure to meet this requirement will result in the V2110 not fully booting up and operate correctly.



You need to install the “.zip” file when you first install the V2110 Hyper-V. The latest .zip file is V2110_Hyper-V_Edition-10.41.02.0014.zip. All subsequent upgrades can be performed using the standard controller upgrade procedure to apply a “.ize” file to the V2110 Hyper-V.

V10.41.01 has been validated with Microsoft Hyper-V Server 2012 R2 and Microsoft Hyper-V Server 2016 Standard editions.

For more information about installing the V2110 MS Hyper-V, refer to the “ExtremeWireless V2110 Virtual Appliance Installation Guide MS Hyper-V platform”.

For more information about upgrading the V2110 MS Hyper-V, refer to the “ExtremeWireless Maintenance Guide”.

Configuring the Shared Secret for Controller Communication

The controllers communicate amongst themselves using a secure protocol. Among other things, this protocol is used to share the data required for high availability between controllers. They also use this protocol to communicate with NetSight Wireless Manager. The protocol requires the use of a shared secret for mutual authentication of the end-points.

By default, the controllers and NetSight Wireless Manager use a well-known factory default shared secret. This makes it easy to get up and running. However, it is not as secure as some sites require.

The controllers and NetSight Wireless Manager allow an administrator to change the shared secret used by the secure protocol. In fact, the controllers and Wireless Manager can use a different shared secret for each individual end-point to which they connect with the protocol.

To configure the shared secret for a connection on the controller, open the **Secure Connections** page of the **Wireless Controller** GUI module. Enter the IP address of the other end of the secure protocol tunnel and the shared secret to use.

Be sure to configure the same shared secret on the devices at each end of the connection, ensuring that the two controllers, or controller and NetSight Wireless Manager, are able to communicate. Without the same shared secret on each end of the connection, features like availability will fail.

Note that changes to secure connection share secret come into effect only when a new connection is being established.

Please refer to the NetSight Wireless Manager *User Guide* (v5.1 or higher) for a description of how to configure the shared secret on a Wireless Manager.

NETWORK MANAGEMENT SOFTWARE SUPPORT

Network Management Suite (NMS)	Version
ExtremeManagement™	8.1 or higher
ExtremeManagement™ Wireless Advanced Services	4.4
ExtremeControl™	8.1 or higher

Note: Configuration of the AP3935/AP3965/AP3912/ AP3915/AP3916/AP3917 is not yet supported via ExtremeManagement™ WirelessManager.

IMPORTANT: EXTREMEWIRELESS V10 LICENSING CHANGES

Consolidated the regulatory domains to FCC, ROW, EGY (Egypt), and Base (for no domain specified). The FCC domain is limited to the US (and US territories), Puerto Rico, and Colombia. All other countries, except Egypt, where an AP is certified falls under the Rest-Of-World (ROW) regulatory domain including countries previously under the NAM domain (e.g. Canada). BASE only allows management of models such as the AP3805_FCC/ROW and the AP39xx models that enforce regulatory requirements at the AP (independent of controller regulatory domain). For installation in Egypt the EGY activation key must be used. When activated EGY key will not allow management of Aps for any other country.

EXTREMEWIRELESS V9 TO V10 REQUESTS FOR NEW LICENSE KEYS

A new activation license key needs to be requested whenever the Wireless Controller software is upgraded from one major version to another (e.g. version 9 to version 10). Old activation keys will not carry over in the upgrade process, but feature licenses (incremental AP licenses, Radar, etc.) are carried over on the same controller.

After an upgrade from NAM to FCC, if the AP country is not supported, then the AP radios are disabled.

After an upgrade, a customer is given a 7-day grace period. If customer does not activate an upgraded system, then customer loses the ability to manage VNS configuration and Radar scanning. Logs are recorded every 15 minutes to remind the customer to install a valid V10 activation key.

To request a new V10 license key:

1. Log into your Extreme Networks Extranet account (<https://extremeportal.force.com/>).
2. Select the Product Licensing link (<https://extremeportal.force.com/ExtrLicenseLanding>).
3. Select the **ExtremeWireless Upgrade Licenses** option from the list of tasks on the right-hand menu.
4. Fill in the simple form:

Upgrade Version: select V10

Contract Number: type your service contract number

MAC Address: type the dash-delimited MAC Address of your ExtremeWireless controller

5. Click **Submit**.
6. Once the form has been submitted, it will be reviewed by Order Management to confirm the contract is valid for a version 10 upgrade.
7. Upon approval, the user is notified by email and given an Entitlement ID that must be redeemed through the user's Extranet account (follow the emailed instructions).
8. Once the Entitlement is redeemed, an activation key is emailed to the user (it can be directly copied by the user).
9. Enter the activation key into the ExtremeWireless Controller.

If you experience any issues with this process, please contact GTAC for assistance.

BEFORE USING THE FABRIC ATTACH FEATURE

V10.41.01.0080 (or above) is the minimum required firmware revision for Fabric Attach functionality. Out-of-Factory new APs will likely run older revisions that are not FA capable. (Except for the AP3915 family and the AP3917 family):

- For automatic provisioning of new equipment, the admin VLAN on the switch port should be set to untagged. The admin VLAN must provide (switch or routed) support for controller discoverability and connection. Controller may then upgrade the AP to the latest release.
- If the admin VLAN on the switch is tagged, then the new AP must first be pre-staged to force an upgrade to a compatible firmware release.

For AP3915 (hardware revisions before 'AB' for AP3915i and 'AC' for AP3915e), when deploying into an ERSxxx based Fabric Attach deployment, the new AP must first be pre-staged with a switch port that has Fabric to allow it to be upgraded to V10.41.01 GA (Build 80) or later.

After upgrade to a release of at least 10.41.01 GA (Build 80) the AP will then be able to fully participate in Fabric Attach function.

Note: The Fabric Attach Feature is only supported on AP3900 series Aps (AP3912 / AP3915 / AP3916 / AP3917 / AP3935 / AP3965).

Note: The manufacturing revision of an access point is reflected in the last 2 digits of the "Shipping" ID printed in the unit's gift-box label.

Disable the Fabric Attach functionality in Extreme ERS switches if Fabric is not actually provisioned.



- Extreme ERS family switches ship from the factory with Fabric Attach enabled. Even if the switch is not actually provisioned into an Extreme Fabric Connect, it will advertise the availability of Fabric Attached to connecting devices.
- One of the elements of the advertisement is the attribute of Management VLAN (VLAN ID 1 by default). That announcement however is processed by ExtremeWireless™ Aps and will cause the AP to configure itself to use that VLAN ID for its management function. That VLAN ID (1) is typically not the actual VLAN the AP should be using to access its management network and the corresponding managing controller. Therefore, it will lead to the AP losing network connectivity.
- Workaround:
 1. If you have an ERS series switch that is not actually deployed into a Fabric Attach network, disable the switch's FA function.
 - Syntax: *no fa port-enable <port #s>*
 2. Recover the AP by resetting to the factory default. (Typically push and hold the reset pin.) Refer to the corresponding AP model's Installation guide for details on the reset procedure.
 - The AP will recover by using the default untagged access or a more specific VLAN, if provisioned by the ExtremeWireless™ appliance.

NEW FEATURES, SOFTWARE CHANGES, AND ENHANCEMENTS



This Maintenance release includes all previous 10.51.xx.xxxx features and changes.

Changes in 10.51.24.0003	
wns0023006	Fix provided for high throughput utilization report spikes for AP3935.

Changes in 10.51.23.0003	
wns0022994	Provided fix for AP3915i Poor performance with Acuson Freestyle Ultrasound.
wns0022997	Fixed the identify-roaming in mobility domain between XCC and EWC.
wns0023000	Provided the new AP Web server certificate renewal for Identifi APs.

Changes in 10.51.22.0004	
wns0022984	Fixed RADIUS accounting situation. The RADIUS accounting component now sends accounting totals that match what the end user sends based on Verizon testing in Salem.
wns0022987	Fixed situation where AP loses the tunnel to controllers. Clusters ap.log file was fixed by removing the messages.
wns0022988	Fixed situation where EWC was not including called-station-id on intermittent clients who were not connected for long periods of time.
wns0022990	Fixed AP3915i silent crashing by updating memory initialization.
wns0022991	Fixed the incorrect report on active client page "Time Seen" in GUI.

Changes in 10.51.21.0002	
wns0022905	Fixed the Kernel messages seen frequently.
wns0022978	Fixed issue that caused AP3935 to crash during XCC smoke test.

Changes in 10.51.20.0003	
wns0022892	Fixed priority handling of Multiple NAC and pending state server states (RADIUS servers).

Enhancements in 10.51.20.0003	
wns0022969	Added Security Vulnerabilities (QCA) patch for AP 38xx (3805 & 3825) models.
wns0022973	Added TLS 1.1 from strong to weak ciphers for GUI access.

Enhancements in 10.51.19.0001	
wns0022968	Added Security Vulnerabilities (QCA) patch for AP 39xx (3912, 3915i/e, 3916, 3917i/e) models for Frag Attack.

Changes in 10.51.18.0002	
wns0022961	Addressed the issue with 3935 in Site mode which were dropping clients and connectivity with SIAPP errors.
wns0022962	Fixed the issue with AP39xx as supplicant fails when management VLAN was tagged.
wns0022963	Address the issue with AP connectivity via secure tunnel.

Changes in 10.51.17.0006	
wns0022381	Corrects an issue when forwarding tagged packets after resetting the controller.
wns0022804	Addresses an issue that could affect service stability.
wns0022936	Improves the stability of the AP38XX platforms when a 2.4G client sends an improper VHT request.
wns0022950	Addresses a sporadic issue that could cause the AP3825 to reboot.
wns0022952	Addresses the issue that causes AP39xx to reboot to get new configuration changes of SSID or WLAN privacy.

Enhancements in 10.51.17.0006	
wns0022945	Enhances security when establishing IPSec control or data tunnels by using manufacturing certificates with the 39XX Series and Extreme Campus Controller (XCC).
wns0022949	Enhances the security of Fabric Attach implementations by adding support for customers to override the default FA Authentication Key with Extreme Campus Controller deployments.

Changes in 10.51.16.0003	
wns0022812	Corrected an issue where the controller sent control data from the wrong interface.
wns0022904	Corrected a memory management issue that could cause the controller to reboot.
wns0022930	Corrected an issue that impacted management services when upgrading from v10.51.10 to v10.51.14.

Enhancements in 10.51.16.0003	
wns0022932	Radio driver security updates addressing Beyond Kr00K.

Changes in 10.51.15.0002	
wns0022921	Fix implemented for the AP3912 wired port policy zone name to include in called Station ID.
wns0022927	Fix provided to log the Informational level logging events seen for APs with log level set to "Major".

Enhancements in 10.51.15.0002	
wns0022928	Added support for renewal of AP web server certificate.

Changes in 10.51.14.0005	
wns0022915	Increased Controller SSH/RSA host key length from 1024 to 4096
wns0022925	Improved AP39xx stability when enabled with LBS for Aeroscout integration
wns0022926	Updated SNMP OID Value for stationIPAddress to show 0.0.0.0 instead of null for those instances where IP address is unknown

Enhancements in 10.51.14.0005	
wns0022919	Added support for ISID value of 0 when using FA Standalone mode.

Changes in 10.51.13.0003	
wns0022878	Addressed second BSSID on an AP39xx radio incorrectly advertising basic rates in beacon frame.
wns0022892	Improved Radius state checking when multiple Radius servers are configured under WLAN Service.
wns0022903	Resolved duplicate L2Port being found on Controller LAG mapping when Jumbo Frames are enabled.
wns0022907	Improved logic for determining gateway conflict when using 3 rd party AP Topologies.
wns0022906	Improved input validation for adding mac address to Controller blacklist.

Changes in 10.51.12.0003	
wns0022898	Corrected RSSI values reporting to Aeroscout server for AP3915i Access Points.

Enhancements in 10.51.12.0003	
wns0022899	Added country support of AP39XX-ROW for Barbados.

Changes in 10.51.11.0002	
wns0022883	Improved session management in high capacity environments.
wns0022890	Improved handling of data frames when Secure Tunnel for Control is configured.

Enhancements in 10.51.11.0002	
wns0022839	Added country support of AP3915i-ROW for Brunei.

Changes in 10.51.10.0006	
wns0022140	Handled race condition where RADIUS CoA-Request would not get acknowledged by the Controller while a client was roaming to a new AP.
wns0022571	For APs that support RADAR WIPS, we added a new device ID for the AP that is associating as a client. It now displays as EXTR-RADAR-MU under All Client Reports.
wns0022835	Improved AP Load Group->Client Balancing algorithm for AP39xx.
wns0022857	Resolved compatibility issue that was found in the Python dependency on the Controller, which could cause instability.
wns0022860	Improved AP logic to revert to the original DFS channel after reboot.

Enhancements in 10.51.10.0006	
wns0022870	Improved resiliency for AP39xx in environments with high noise floors.
wns0022789	Enhanced AP Name in Beacon setting by including the AP Name in Vendor-Specific IE for Probe Responses, de-coupled the setting from LED Mode, and added the ability to configure AP Name in a Beacon per WLAN Service.

Changes in 10.51.09.0008	
wns0021351	Added support for EAP Identity fields starting with 0x00 and Identity is over the maximum RADIUS username limit of 253 bytes
wns0022066	Improved controller stability for Guest Splash in an availability pair by properly cleaning up client session tokens
wns0022559	Improved stats accuracy for RADIUS Accounting packets in those instances where clients would disconnect/reconnect
wns0022838	Enhanced channel recovery time after a DFS event on AP3825 with ATPC enabled
wns0022846	Resolved IP address gateway conflict with AP's using subnet 1.1.0.0/16 and Controller also using 1.1.1.1 for FFECF
wns0022842	Improved compatibility between Vocera badges and AP when FT is enabled

Enhancements in 10.51.09.0008	
wns0022786	Added Chinese Character Support for SSIDs
wns0022822	Added V2110 (VMware) Jumbo Frame Support
wns0021062	Changed default value for RADAR -> "Remove network access from violating clients (WIPS)" from 900s to 30s

Changes in 10.51.08.0004	
wns0022528	Addressed TCP vulnerability CVE-2019-11477 for C35, C5210, C5215, V2110 and V2110H

Enhancements in 10.51.08.0004	
wns0022788	Modified factory default settings for AMSDUs, TxBF, PMF and 802.11e

Changes in 10.51.07.0006	
wns0020720	Improved AP handling for clients with hostnames greater than 31 characters.
wns0020760	Addressed handling of commas in Guest User description field where exporting the file and importing it back would generate an error.
wns0021161	Addressed DNS not properly caching hostnames for FQDN related input fields after Controller upgrade.
wns0021916	Improved MU inter-controller roaming between APs configured with an encrypted SSID whereby clients (WL3) were slow or unable to associate to a previously authenticated AP.
wns0022066	Improved robustness of any WLAN Service using Authentication when # of simultaneous authenticating clients exceeds 4096.
wns0022508	Improved handling of single quote(s) in SSID name when any action related to shutting down Radio/WLAN Service; such as channel-scan or In-Service auto channel-scan.
wns0022542	Corrected issue with exporting of strings with special character 'Ö'. Character would be missing after upgrade. Corrected for upgrades from 10.51.07 onwards.
wns0022650	Enhanced accuracy of RSSI readings sent from AP to ExtremeLocation server.
wns0022659	Included "Radio Mode" in Active AP report when exporting to XML.
wns0022709	Corrected issue with lack of exporting a Max Session Lifetime of zero (0 - forever) for Guest portal users, which results in the setting resetting to 30 minutes. From this build forward export/import and upgrade will work correctly. For upgrades from previous releases, please reset the value after the upgrade completes.

Changes in 10.51.06.0003	
wns0021532	Improved U-APSD support with VoWLAN phones to properly manage Tx queues on AP38xx platform.
wns0022104	Improved EAP-TLS re-authentication handling for AP38xx and AP39xx authenticating against wired switch-port.
wns0022527	Addressed TCP vulnerability CVE-2019-11477 for AP38xx and AP39xx.

Enhancements in 10.51.05.0005	
wns0022412	Per Egypt Regulatory, removed 5GHz Band 4 channel support (channels 149, 153, 157, 161, 165) for AP3965i/e-ROW deployed outdoors.

Changes in 10.51.05.0005	
wns0022313	Improved stability with 802.11h enabled and DFS events to properly scan for new channel after a radar event has occurred.
wns0022415	Addressed WLANs (having special character "@" in the name) being removed from Sites Configuration during upgrade

Enhancements in 10.51.04.0009	
wns0022323	Support override of Called Station ID to MAC:SSID for RADIUS accounting, in compliance with RFC3580

Changes in 10.51.04.0009	
wns0021459	Addressed issue with management of ACL rules which could cause AP instability.
wns0021760	Adjusted logic for managing nameservers (DNS) to better rely on DHCP information versus persisted settings.
wns0022036	Improved filtering logic for wireless packet capture to focus on end-system traffic, removing internal state frames.
wns0022254	Improved escaping of special characters in user-provided descriptive configuration fields, for configuration backups that could otherwise cause import and upgrade issues.
wns0022319	Improved bounds checking protection for large hostnames in client statistics reporting. Maximum 32 character enforced.
wns0021218	Enforced that AP391x generate IGMP JOIN when configured for SIAPP (Multicast) dependent functions such as Site and Load balancing

Changes in 10.51.03.0002	
wns0021949	Corrected classification and parsing of IPv6 malformed packets (on the ethernet driver level) which could cause AP3915 to lock-up.
wns0022015	Improved inter-communication between Controller appliances with Mobility enabled.
wns0022016	Improved compatibility for FabricAttach between AP39xx and EXOS 30.2 for Element Types '4' and '5'.

Changes in 10.51.02.0006 (includes all 10.51.01.xxxx features and changes)	
wns0021243	Improved co-existence for 2.4GHz radio between client connectivity with interference scans for both in-service and Guardian modes on AP38xx and AP39xx.
wns0021803	Addressed activation date for user accounts in captive portal field behaving incorrectly when inputting minutes between 0-9.
wns0021882	Corrected behavior when changing EWC data port configuration between tagged <-> untagged could result in packets being dropped.
wns0022038	Addressed Potential Vulnerability of Controller in CVE-2018-15473.
wns0022136	Updated Client Reports for 11ac clients which could appear incorrectly as 11n capable only.
wns0022144	After a Controller firmware upgrade from 10.41.xx to 10.51.01, it was discovered upon AP39xx initial re-registration to the Controller there was potential of AP39xx configuration being reset (factory defaulted) which would cause loss of service requiring admin to reconfigure the AP settings.

Changes in 10.51.01.0100	
wns0021917	Improved boundary check in PSK for configuring long strings that may have prevented AP radio to come online (<i>fix added in build 0100 on top of others</i>)

New features in V10.51.01.0097

Mesh Client Enhancements

- Improves stability for AP39xx with Mesh Client, 11k and Location Engine enabled.
- Added multi-edit functionality for Mesh configurations.
- Enhanced Mesh statistics reports with search function.

Increased Topology/Role limits for C5215

- The maximum number of the topology and role limits has increased to 4000 on C5215 only.

Purge Sessions Upon Client Disconnect (Wireless or Wired)

- This feature cleans up the client session upon DeAuth/DeAssoc received from the wireless client or link down on wired client.

Return to Original Channel after DFS when clients <= "X"

- This feature allows user to configure the client threshold number before the AP will return to the original channel prior to the DFS event.

Configuration of timeout for Location Entries

- This feature allows Location Entry "Idle Timeout" to be configurable between 5-1440 minutes (defaulted to 30 min).

Overwrite of Calibration setting for IoT Beacons

- This feature allows configuration for calibration setting on iBeacon and Eddystone-URL Beacon.

Policy MIB update for NSI/ISID indication

- Policy MIB update for NSI/ISID indication for Fabric Attach Mode topology.

Added MIB OID for Called-Station-Id-SSID

- Added MIB OID support for Called-Station-Id-SSID.

Display 802.1X usernames in-lieu of device name

- This feature displays the 802.11x usernames in-lieu of device name for 802.1x authenticated clients.

Append SSID to MAC in Called-Station-Id

- Added support in the AP RADIUS Client Called-Station-Id format XX-XX-XX-XX-XX-XX:SSID according to RFC3580.

Changes in 10.51.01.0097	
wns0021401	Radio driver code is “stuck” when commanded to scan the channel.

Changes in 10.41.13.0008	
wns0021208	Corrected "Invalid configuration request" being shown in AP logs during a controller upgrade while APs failover to secondary Controller.
wns0021242	Improved handling of Bonjour multicast traffic mapped to contain to VLAN while in Sites Mode.
wns0021325	Improved handing of ARP tables when dealing with large number of devices on network.
wns0021358	Resolved co-existence when AP subnets are in the same range of 1.1.0.0/16 while FFECF is enabled.

Enhancements in 10.41.13.0008	
wns0021030	Added country support of AP3912i-ROW for Russia.
wns0021335	Added country support of AP3915i-ROW for Ukraine.

Changes in 10.41.12.0006	
wns0014094	Completed 10.41 interoperability testing with AP38xx and SpectraLink handsets.
wns0021014	Resolved AP not returning to original channel after DFS timeout with 11h enabled.
wns0021039	Improved Guardian mode threat detection and prevention for “..DoS and password-cracking attacks”.
wns0021093	Improved handling of session state tables when there are an influx of clients associating/disassociating at a given time.
wns0021104	Corrected 2.4GHz rate selection on AP38xx for single 1x1 clients.
wns0021196	Improved session state handling when clients are idle which may have introduced instability on the Controller.

Enhancements in 10.41.12.0006	
wns0020571	Added integration of AP38xx with ExtremeLocation.
wns0021200	Added new metrics 'Noise Floor' and 'Radio Channel' under Reports > APs > AP Performance by Radio.
wns0021241	Added country support of AP3912i-ROW for Brazil

Changes in 10.41.11.0009	
wns0020759 wns0021113 wns0021084	Addressed logic in Low Link Speed health widget incorrectly reporting # of APs with dual ethernet ports.
wns0020762	Improved In-Service Radar spoof detection for AP3805 reporting each other as spoof APs.
wns0020966	Addressed corner case while under client load where controller in HA failed to notify APs to failover to secondary controller and WLAN would become disabled.
wns0020142	Improved client compatibility for AP38xx when MFP is enabled. <i>(only a specific corner case issue was fixed. Please see Known Issue section)</i>
wns0021051 wns0021163	Improved configuration import logic for upgrades from 9.21.xx to 10.41.xx due to channel width setting not being preserved instead of halting import process.
wns0021090	Corrected mal-formed LLDP packets for AP39xx
wns0021091	Improved stability of Wireless Controller with Netsight.
wns0021114	Improved configuration import logic for upgrades from 10.41.08 to 10.41.10 due to IPv6 default action of Deny would change to None after upgrade.
wns0021123	Improved error handling of failed connections between Wireless Controller and Netsight.
wns0021149	Improved compatibility of AP39xx for FA with ERS switch in v7.6007.
wns0021185	Improved configuration import logic for upgrades from 10.41.01 to 10.41.10 due to encrypted FTP passwords being used in Remote FTP settings within the GUI.
wns0021193	Removed incorrect Mobility log messages while Availability is enabled with Mobility disabled.

Enhancements in 10.41.11.0009	
wns0020779	Added country support of ALL AP3865e and AP39xx for Myanmar
wns0021068	Added country support of AP3865e and ALL AP39xx for El Salvador
wns0021088	Added country support of AP3917i-ROW for Mexico
wns0021166	Added country support of AP3865e and ALL AP39xx for Guatemala

Changes in 10.41.10.0014	
wns0020630	Improved AP38xx stability for spectrum scans when Guardian is enabled.
wns0020763	Revised workflow for AP search tab by preserving the input value to allow for configuring the AP and returning to the search list.
wns0020801	Improved AP search to include both Active and Inactive APs.
wns0020803	Addressed failover scenario where client traffic would not egress from an AP on a secondary controller.
wns0020843	Corrected GUI spelling error on Home screen when Application Visibility referenced "Datebases" instead of "Databases".
wns0020879	Reverted Health widget on dashboard to display AP uptime instead of tunnel duration.
wns0020887	Improved ACS algorithm to prevent APs from selecting only the first channel from a list of best four channels.
wns0020903	Added DHCP fingerprint for Windows 10: Microsoft Surface.
wns0020933	Improved data path logic for clients sending multicast/broadcast packets with Controllers in Mobility (no HA) where a storm could occur on client roam.
wns0020862	Resolved default route being inactive from routing table upon upgrade from V10.31 to V10.41.

Enhancements in 10.41.10.0014	
wns0020806	Added country support of AP3915i-ROW and AP3915e-ROW for Argentina.
wns0020857	Added country support of AP3915i-ROW for Tonga.
wns0020863	Removed Band 4 from AP3935/AP3965 Indoors for Egypt.

Changes in 10.41.09.0008	
wns0020387	Updated AP default settings logic to properly enforce channel width when an AP is adopted for the first time.
wns0020566	Resolved synchronization re-keying which could prevent AP from establishing their backup tunnel.
wns0020637	Corrected logic while in Sites Mode using B@AP Topology where DHCP traffic would be encapsulated in WASSP tunnel.
wns0020651	Improved congestion control on the radio to prevent radio resets.
wns0020687	Resolved corner case whereby if AP was previously configured with Auto Channel and fixed channel width, if a factory reset occurred the AP would be stuck on channel 36 @ 20MHz.
wns0020688	Updated GUI dashboard to allow click-through for the Un-Authenticated Stations icon.
wns0020699 wns0020715	Updated GUI dashboard to display properly where extents of Health widget would previously be cut off.
wns0020760	Addressed handling of commas in Guest User description field where exporting the file and importing it back would generate an error.
wns0020763	Revised workflow for AP search tab by preserving the input value to allow for configuring the AP and returning to the search list.

Enhancements in 10.41.09.0008	
wns0020716	Added country support of AP3915i-ROW, AP3917i/e-ROW, AP3935i/e-ROW and AP3965i/e-ROW for Serbia.

Changes in 10.41.08.0012	
wns0019972	Resolved interoperability with Aeroscout tags to emit the correct tag report.
wns0020519	Addressed client location showing incorrectly on Netsight.
wns0020544	Improved packet buffer management protection logic and data plane affinity assignment updates to better align with latest kernel architecture
wns0020567	Corrected logic with handling of Policy rules with flexible IP port-range definitions.
wns0020576	Addressed issue with intermittent failure to collect and report interface statistics for the wireless appliance.
wns0020580	Corrected active AccessPoint count mib to be consistent with GUI.
wns0020594	Resolved configuration conflict when saving topologies in an availability pair could result in VLAN ID conflict.
wns0020603	Addressed beacon sending on incorrect data rate for 2.4GHz radio on AP3805 despite being configured.
wns0020621	Corrected scheduled upgrade to apply correct date when enforcing the upgrade.
wns0020652	Improved 802.1x compatibility with Sites Mode on AP3710.

Enhancements in 10.41.08.0012	
wns0019286	Added Client Port support on second ethernet port for AP3965e and AP3865e.
wns0019287	Replaced AP serial number with AP name in the formatted AP alarm log sent to syslog, SNMP trap and XMC.
wns0020584	Added country support of AP3917i/e-ROW for Korea.
wns0020633	Added three new searchable columns (Status, Managed, IP Address) to AP List view.
wns0020645	Added country support of AP3917i/e-ROW for Vietnam.
wns0020646	Added country support of AP3965i-ROW for Bermuda and Dominican Republic.
wns0020658	Updated power settings of AP3915i/e and AP3917i/e for Korea.

Changes in 10.41.07.0014	
wns0019859	Relaxed 11k scanning aggressiveness when AP has many clients associated or multicast-to-unicast is enabled.
wns0019860	Corrected issue where adding an L7 filter rule to a policy could result in any TOS/DSCP classifications to be removed.
wns0019924	Relaxed the timers to 30mins for sending Area Change events in case client cannot be triangulated or client is no longer probing.
wns0019985	Addressed migrating of Guest Usernames with invalid/empty passwords which could prevent Controller to upgrade successfully.
wns0020048	Further improved logic for spoofed AP detection where APs would incorrectly report its own APs as spoofed.
wns0020055	Adjusted SNMP update period in ifxtable for accurate polling into XMC.
wns0020241	Updated Health dashboard report to only show "802.3.at-capable APs" in Low Power Mode across the AP39xx.
wns0020281	Corrected active Access Point count mib to be consistent with GUI.
wns0020345	Improved AP38xx performance for 2.4GHz in noisy environments.
wns0020430	Resolved reoccurring messages flooding AP logs causing them to rollover quickly.
wns0020468	Improved input handling for RADIUS shared-secret which was causing instability for the RADIUS client.
wns0020533	Addressed port statistics not properly being updated in EWC Reports.

Enhancements in 10.41.07.0014	
wns0019878	Added enhancement to ADSP RadioShare (In-Service-Only) for AP39xx.
wns0020266	Added Tenant ID support to ExtremeLocation™ for AP39xx.
wns0020502	Added country support of AP3915i/e-ROW for Mexico, Chile, Vietnam and Japan.
wns0020503	Added country support of AP3917i/e-ROW for Chile, India, Qatar, Dominican Republic, Argentina, Japan.
wns0020504	Added country support of WS-AP3865e for Vietnam.
wns0020505	Added country support of ALL AP38XX models for Kenya.
wns0020506	Added country support of ALL AP39XX models for Kenya.

Changes in 10.41.06.0013	
wns0019788	Modified DHCP fingerprint for WiDi boxes to report correctly.
wns0019944	Corrected query of apCertificateExpiry mib to return accurate information.
wns0020048	Adjusted logic for spoofed AP detection where APs would incorrectly report its own APs as spoofed .
wns0020085	Adjusted GUI and CLI to have consistent SNMP password-length of 32 characters.
wns0020097	Addressed logic for captive portal redirection when in Sites mode while using tunneled topologies.
wns0020126	Corrected issue with displaying tooltips for Multi-edit
wns0020173	Improved consistency of Client Search function on contextual reports (AP, VNS)
wns0020205	Addressed issue with Multi-Edit not allowing configuration of parameters for AP391x Series APs.
wns0020192	Corrected issue with credentials management logic on firmware upgrade of Camera Module of AP3916

Enhancements in 10.41.06.0013	
wns0019578	Added enhancement responsiveness metrics for key protocols (DNS, DHCP) for AP38xx and AP39xx.
wns0020167	Added Support for 802.1x Reauth for Wired Clients on AP3912 and AP3917.
wns0020174.	Extended support for AP packet capture to CLI.
wns0020322	Added country support of AP3917i-ROW and AP3917e-ROW for China, Hong Kong, Brazil, Indonesia, Kuwait.
wns0020323	Added country support of AP3915i-ROW and AP3915e-ROW for Korea_ROC and Brazil.
wns0020324	Added country support of AP3915e-ROW for China, Hong Kong and Serbia.
wns0020325	Added country support of All AP39xxx-ROW for Albania.

Changes in 10.41.05.0010	
wns0019886	Addressed instability on AP39xx where AP would not perform full 802.1x re-authentication.
wns0019920	Addressed handling of mal-formed DNS packets by adding more protection when decoding DNS replies.
wns0019979	Corrected issue with interpretation of policy/filter rules which could prevent enablement of services on AP radios.
wns0020024	Enhanced logic for AP39xx where having a larger number of clients associated could impact AP service.

Enhancements in 10.41.05.0010	
wns0019285	Added support for 802.1x authentication on AP3912 and AP3917 Client ports.
wns0019289	Added SSID and Encryption in "Reports - Active threats report".
wns0019290	Added support for IOT: AP as Eddystone Beacon.
wns0019939	Added warning message when number of mobility domain users exceeds 48k.

Enhancements in 10.41.04.0002	
wns0019955	Added country support of AP3916ic for Saudi Arabia
wns0019956	Added country support of AP3915i-ROW for Chile, China, Ecuador, Hong Kong, India, Indonesia, Kuwait, Malaysia, Peru, Philippines, Qatar, Russia, Saudi Arabia, Singapore, South Africa, Taiwan, Thailand and UAE
wns0019957	Added DFS Channels for FCC based countries to AP3915i-FCC
wns0019958	Added DFS Channels for FCC based countries to AP3915e-FCC
wns0019959	Added country support of AP3915e-ROW for Chile, Ecuador, India, Indonesia, Kuwait, Malaysia, Philippines, Peru, Qatar, Russia, Saudi Arabia, Singapore, South Africa, Taiwan, Thailand and UAE.
wns0019960	Added country support of AP3917i-ROW for Ecuador, Malaysia, Philippines, Russia, South Africa, Thailand and UAE
wns0019961	Added DFS Channels for FCC based countries to AP3917i-FCC
wns0019962	Added country support of AP3917e-ROW for Ecuador, Malaysia, Philippines, Russia, South Africa, Thailand and UAE
wns0019963	Added DFS Channels for FCC based countries to AP3917e-FCC
wns0019964	Added DFS Channels for FCC based countries to AP3917k-FCC
wns0019994	Added country support of AP3917e-ROW for Peru, Saudi Arabia and Taiwan
wns0019995	Added country support of AP3917i-ROW Hong Kong, Peru, Saudi Arabia and Taiwan
wns0019996	Added country support of AP3916ic-ROW for India

Changes in 10.41.03.0012	
wns0017485	Changing the VLAIN ID for an assigned B@AP topology requires rebooting of Access Points on which the topology is present
wns0019434	Improved resilience in handling of timer expirations for 802.11r/Fast Transitions (FT).
wns0019704	Updated logic to ensure that Client Limits are updated whenever limits are adjusted for an existing Radio Preference group.
wns0019827	Corrected packet length calculations on interface to RNDIS driver interface for Hyper-V that could cause packet drop for VLAN tagged interfaces.
wns0019868	Improved parsing of OUIs starting with an encoding equivalent to "0x"
wns0019876	Removed "Service" account from Access Points
wns0019891	Improved recognition of terminal characteristics from Customer's browser for AP Remote Shell feature to better support international keyboards

Enhancements in 10.41.03.0012	
wns0017287	Draeger Certification for AP3912i and AP3916i.
wns0017963	Added support to RADIUS Access-Request for username AVP longer than 253 characters.
wns0018777	Add ability to 'Pause' a Remote Packet Capture session.
wns0019288	Added "Export" option to Radar->Uncategorized APs report for XLS and XML.
wns0019292	Updated RADAR logging events description to include channel numbers with the frequency.
wns0019293	Enhanced logic for Topology Groups to sort by VLAN ID then re-index them in order to have symmetry between multiple Availability Pairs.
wns0019700	Added country support of AP3912i for Mexico.
wns0019701	Added country support of AP3916i for Mexico.
wns0019744	Added country support of AP3916i for Brazil.
wns0019745	Added country support of AP3916i for Serbia.
wns0019746	Added country support of AP3916i for China.
wns0019747	Added country support of AP3912i for Serbia.
wns0019832	Added country support of AP3915i/e for Taiwan.
wns0019908	Added AP Remote Diagnostics (Packet Capture/SSH) when in Availability Mode, allowing remote access to an AP even if the AP is actively connected to the peer appliance.

New features in V10.41.02.0014

Introduces AP3917i/AP3917e/AP3917k (2x2 11ac wave 2) Access Point

- The AP3917 is a feature rich 802.11ac Wave 2 and 802.11abgn outdoor access point that extends affordable enterprise-grade mobility beyond the walls. These outdoor access points are designed to operate in harsh environments such as manufacturing plants, parks, practice facilities and budget conscious venues. The AP3917 offers multiple connectivity options including Wi-Fi 2.4GHz, Wi-Fi 5GHz, and BLE/802.15.4 (Thread, etc.) for location services or extended connectivity to Internet of Things (IoT) sensors and devices.
- AP3917i, AP3917e and AP3917k are 2x2 dual concurrent 5GHz/2.4GHz band APs. They support 11ac Wave 2 on the 5GHz radio and 11n on the 2.4GHz radio, and feature an integrated Bluetooth Low Energy (4.0)/802.15.4 sensor radio.
- AP3917e and AP3917k are equipped with the integrated GPS hardware, which provides the coordinate information of the access point location. The software support of the GPS is not available in V10.41.02. Software support will be available in a later release.
- AP3917k is a PCB board only model with no enclosure. This model is available only for specific partner integration and is not available for general resale.
- Interfaces:
 - 1 x 1 Gbps uplink port
 - 1 x 1 Gbps client port
 - 1 x RJ45 Console port

- There are six new models available:
 - AP3917i-FCC and AP3917e-FCC for the FCC region:
COLOMBIA, PUERTO_RICO, UNITED_STATES
 - AP3917i-ROW and AP3917e-ROW for the rest of the world region
AUSTRALIA, AUSTRIA, BELGIUM, BOSNIA_HERZEGOVINA, BULGARIA, CANADA, CROATIA, CYPRUS, CZECH, DENMARK, ESTONIA, FINLAND, FRANCE, GEORGIA, GERMANY, GREECE, HUNGARY, ICELAND, IRELAND, ITALY, KAZAKHSTAN, KOSOVO, LATVIA, LIECHTENSTEIN, LITHUANIA, LUXEMBOURG, MACAU, MACEDONIA, MALTA, MONTENEGRO, NETHERLANDS, NEW_ZEALAND, NORWAY, POLAND, PORTUGAL, ROMANIA, SINGAPORE, SLOVAKIA, SLOVENIA, SPAIN, SWEDEN, SWITZERLAND, TURKEY, UNITED_KINGDOM
 - AP3917k-FCC for the FCC region:
COLOMBIA, PUERTO_RICO, UNITED_STATES
 - AP3917k-ROW for the rest of the world region
CANADA

Introduces AP3912/AP3915/AP3916/AP3917Thread™ Gateway for IOT

- A Border Router is a specific type of router that provides connectivity from the Thread™ (802.15.4) network to adjacent networks on other physical layers (for example, Wi-Fi and Ethernet).
- Devices in the Thread™ stack support IPv6 addressing. AP3912/AP3915/AP3916/AP3917 will act as border GW between Wi-Fi & Thread network. The Border Gateway function enabled Thread™ devices to communicate with internet entities (Application management, device control or data/state visibility) using IPv6.
- Thread™ Gateway leverages the IOT radio's capability for IEEE Standard 802.15.4 and operates on 2.4GHz band.

AP3900 Series Integration with AirDefense 9.5

- Extend availability of Extreme AirDefense™ as a WIPS/WIDS choice for ExtremeWireless™ installations.
- ADSP server will recognize and adopt AP3900 series APs.
- Automate provisioning by enabling Collection of ExtremeWireless™ SSID/BSSID mappings for deployment info, from wireless appliance via SNMP.
- Configuration of Sensor APs via HWC ADSP Server IP addresses and assign the AP into the ADSP Scan Group.
- APs can only operate as full-time sensors. Radio-Share function is not available in 10.41.02. It will be considered for a future release.
 - Note: Configuring an AP3916ic as an ADSP Sensor will disable the usage of the integrated camera.
- Requires AP Capacity license on ExtremeWireless. Does not require RADAR licenses.
- Adoption and feature licenses for Extreme AirDefense are required. Refer to the Extreme AirDefense Datasheet for details.

AP3900 Series Integration with ExtremeLocation 1.1

- Integration of ExtremeWireless™ AP3900 series with ExtremeLocation 1.1 system.
- AP establishes websocket connections (HTTPS with self-signed certificates) to the ExtremeLocation Server and reports RSS readings based on the ExtremeLocation configuration.
- In V10.41.02, Tenant information, Site information and AP (added/deleted from configuration) are not provided from the Controller to the ExtremeLocation. ExtremeLocation administrators must create and associate theTenant Id and Site with the AP MAC addresses reported over AP webSocket.

Changes in 10.41.02.0014	
wns0018847	Adjusted UI logic to correct logic for persisting configuration of Fast-Failover settings in RADIUS Accounting.
wns0019234	When running in link persistence mode with B@AP, corrected logic to prevent duplicate L2 updates for new client associations to AP. This could cause invalid MAC addresses to show up on AP switch port.
wns0019326	Corrected policy assignment for clients roaming with Fast Transition (802.11r/FT) services.
wns0019361	Changed behavior for AP with link persistence mode disabled. If Ethernet link goes down, it now prevents the AP from rebooting. This behavior is consistent whether link persistence is enabled or disabled.
wns0019371	Adjusted logic to prevent the requirement to change channel if configured as Auto when channel width is being changed.
wns0019397	Corrected Controller MIB attribute "apPerformanceReportbyRadioAndWlanTable" to return accurate number of clients and WLANs being broadcast by AP radios when queried.
wns0019449	Addressed corner case where enabling MBA and Accounting and then disabling MBA could result in MBA still being enabled.
wns0019479	Adjusted radio state management logic to prevent race condition that could prevent radios from being disabled by administrator command for WDS setups with multiple SSIDs.
wns0019529	Corrected logic when in Sites Mode where client session lifetime would not adhere to pre-auth idle, post-auth idle, or session timeouts. As a result, this could cause client sessions to be cleaned up prematurely.

Changes in 10.41.01.0082	
wns0019363, wns0019377	<p>Addressed several vulnerabilities related to protection of key management and improved key re-installation protection for AP as Authenticator for WPAv2 (PSK or Enterprise) services and as supplicant for WDS/Mesh functions:</p> <p>CVE-2017-13077, CVE-2017-13078, CVE-2017-13079, CVE-2017-13080, CVE-2017-13081, CVE-2017-13081, CVE-2017-13082, CVE-2017-13086, CVE-2017-13087, CVE-2017-13088</p> <p>Please refer to Vulnerability Notice 18005 KRACK, WPA2 Protocol Flaw (https://extremeportal.force.com/ExtrArticleDetail?n=000018005) for updates to release schedule.</p>
wns0019430	<p>Addressed issue after an upgrade where if auto channel selection is used, it would re-request a new channel and channel width. The expected behavior has been corrected to preserve previous channel and channel width. Also adjusted UI logic when channel is set to 'Auto' to only allow channel widths of 'Auto' or '20MHz'.</p>

New features in V10.41.01.0080

Introduces AP3915i/AP3915e (2x2 11ac wave 2) Access Point

- The AP3915 is a feature rich 802.11ac Wave 2 and 802.11abgn indoor access point that delivers enterprise-grade performance and security without the premium cost. The AP3915i is designed to blend into any office, carpeted enterprise, or classroom environment. The AP3915 offers multiple connectivity options including 2.4G, 5G, and BLE/802.15.4 (Thread, etc.) for location services and extended connectivity to Internet of Things (IoT) sensors and devices.
- AP3915i and AP3915e are a 2x2 dual concurrent 5GHz/2.4GHz band AP. It supports 11ac Wave 2 on the 5GHz radio and 11n on the 2.4GHz radio. It also features an integrated Bluetooth Low Energy (4.0)/802.15.4 sensor radio.
- Interfaces:
 - 1 x 1 Gbps uplink port
 - 1 x RJ45 Console port (optional)
 - 1 x External 12V Power Supply connector (optional)
- There are four new models available:
 - AP3915i-FCC and AP3915e-FCC for the FCC region:
COLOMBIA, PUERTO_RICO, UNITED_STATES
 - AP3915i-ROW and AP3915e-ROW for the rest of the world region
AUSTRALIA, AUSTRIA, BELGIUM, BOSNIA_HERZEGOVINA, BULGARIA, CANADA, CROATIA, CYPRUS, CZECH, DENMARK, ESTONIA, FINLAND, FRANCE, GEORGIA, GERMANY, GREECE, HUNGARY, ICELAND, IRELAND, ITALY, KAZAKHSTAN, KOSOVO, LATVIA, LIECHTENSTEIN, LITHUANIA, LUXEMBOURG, MACAU, MACEDONIA, MALTA, MONTENEGRO, NETHERLANDS, NEW_ZEALAND, NORWAY, POLAND, PORTUGAL, ROMANIA, SLOVAKIA, SLOVENIA, SPAIN, SWEDEN, SWITZERLAND, TURKEY, UNITED_KINGDOM

Introduces C5215 Wireless Controller Platform

- C5215 is a new ExtremeWireless Management platform, supporting up to 1000 APs and 16,000 users in Standalone or 2000 APs and 32,000 users in High Availability pair. This platform is equivalent to the existing C5210 and will serve as its effective replacement offering. (Note: Requires minimum of 10.41.01.)
- Configuration import for C5210 to C5215 is supported.
- Rescue image import from C5210 to C5215 (or vice versa) is NOT supported.
- The C5215 hardware platform will be released in November 2017.

Fabric Attach: Edge Automation

- Fabric Attach provides Edge Installation Automation with Zero-Touch User & Device Attachment
- Integrates Extreme Edge products & connection services with next-generation Fabric Core
- Fabric Attach extends Fabric Connect services to EXOS and ExtremeWireless™ Edge
- Facilitates clients network access via VLAN abstraction as Individual Service Identifier (I-SID)
- FA Client(AP), Server/Proxy (switches) elements exchange facilitate orchestration of points of presence and path
- Leverage the Extreme Networks dynamic role-based policy control and automation and orchestration to secure auto-attachment of users/devices to Fabric-based services
- Automates switch port provisioning for required topologies
- This feature is only supported on AP3912/AP3915/AP3916/AP3935/AP3965 families.

AP Upgrade with Minimized Service Impact

- This feature extends the rebooting APs on schedule without interrupting the service to upgrading the AP FW process.
- Under the control upgrade process, the AP FW will be upgraded when the AP has low traffic and/or is in consideration of channel plan to minimize impact to wireless service.

ExtremeAnalytics™ Signature Synchronization

- Support synchronization of Application signature sets from ExtremeManagement™ to propagate updates due to Custom signature definition or subscription updates.
- ExtremeManagement™ Center will sync changes to signature definitions (Custom, Updates) to ExtremeWireless™ and ExtremeAnalytics.

AP Diagnostics

- The feature provides the AP diagnostics capability via wireless controller. It includes the various remote tools on the wireless controller:
 - AP Remote Shell to provide remote command line access to each AP.
 - AP image upgrade via HTTP, which reduces AP image download time compared to the current TFTP method.
 - AP Remote Packet Capture provides real time traffic view on the AP for both the management and the data traffic.

Auto Channel Width Selection (ACWS)

- This feature enhances the channel selection algorithm by performing deployment density evaluation. For dense deployments, the 80 MHz channels will be split in two 40MHz or four 20MHz channels in order to increase the number of individual channels available for selection. The ACS algorithm will select the AP channels to ensure minimum co-channel interferences and avoid channel overlap.
- New and improved formula to calculate best channel based on channel cost, penalty for Noise, CCI /NCI, and tiebreakers.
- Results are aggregated into Channel Inspector report facilitating easier validation of channel selection results.

DFS - Return to Original Channel

- This feature restores AP channel to the original DFS channel after a Radar event. It allows for a stable deployment channel plan.
- Post Radar / DFS event, the channel is flagged and should not be used for 30 minutes according (to the DFS standard). AP performs ACS and selects a new channel from the allowed channel list. After 30 minutes, the original channel can be used again, and the AP will return to the original channel as soon as the AP does not service any clients.

Airtime Fairness Update

- This feature allows the user to define up to four WLANs that have configurable minimum airtime reservation during periods of congestion. Up to 80% airtime can be configured. The other 20% airtime is reserved for other WLANs to prevent starvation.
- Flexible Client Access (FCA) was previously introduced during the transition from legacy Wi-Fi to 11n. Modern 11ac Wi-Fi interface supports client airtime fairness by default. FCA is no longer needed.

IOT: iBeacon RTLS (listening) Reporting

- Extends RTLS capability to support use cases such as asset tagging - using standard (off the shelf) iBeacon tags. APs receive the presence of iBeacon messages from tags within range and report the corresponding signal strength to a defined application server implemented by the customer in real time.
- The iBeacon info is translated into JSON structure (to facilitate easier application programming) and transported to a configured recipient application server via the wireless Controller. The applications can correlate location context based on access point location via BatchLocationReport for additional context.

AP web server configured with commercial certificates to avoid captive portal browser HTTPS warning

- Upgraded the built-in certificate on the AP to the valid commercial certificate. This avoids the browser-generated warning during a captive portal redirect.

Layer 7 Application signature updates for V10.41

- The following signatures were added in this release:
 - AccountKit
 - Adobe IO
 - Answers Cloud Services
 - AppointmentPlus
 - Assembla
 - Autodesk
 - Bidpath
 - BidTheatre
 - CADVault
 - CareZone
 - Cisco Meraki
 - ComplianceDesktop
 - Consumer Reports
 - Continuum
 - Conversica
 - Customer.io
 - DLNA Service
 - Doctor On Demand
 - Doximity
 - Druva
 - Endomondo
 - Epic
 - Epocrates
 - Eyeota
 - FastMail
 - FollowMyHealth
 - FSV Payment Systems
 - GoodRx
 - HealthTap
 - inContact
 - Kronos
 - LawRoom
 - LiveChat
 - Livingly Media
 - Mac App Store
 - MathXL
 - NE Journal of Medicine
 - Nuance
 - Nvidia
 - Oracle Cloud
 - Pearson VUE
 - PEPID
 - Piazza
 - POLYV
 - ReviewBoard
 - Rise
 - ROXIMITY
 - SAP SuccessFactors
 - Secure-24
 - ServiceNow
 - Signal
 - Silverpeak GMS
 - Skype for Business
 - SocialChorus
 - Strava
 - Symplicity
 - Teem
 - Vengo
 - Verizon Voice over WiFi
 - Vertex
 - vTuner
 - Wishabi
 - ZAM
 - Zocdoc

Changes in 10.41.01.0080	
wns0018612	Fixed the implementation of filter search that had a redundancy that might generate a warning message. Data traffic was not impacted.
wns0018713	Force the AP to use short GI when the AP is as Parent in the WDS/Mesh in order to improve the throughput performance between the Parent AP and the Child AP.
wns0018751	Correct the warning message when the AP has a low speed Ethernet link other than 1GB.
wns0018798	Stop sending the Radius Accounting Interim Update when the configured value for "Interim Accounting Interval" is zero.
wns0018833	Correct the error that the AP radio will be stopped after the fast failover if there is antenna setting is defaulted on the secondly wireless controller.
wns0018861	Adding support for the case where a RADIUS server was back up after being down. And this scenario was for a WLAN Service with only 1 RADIUS server. And the RADIUS server was put in the down state from another WLAN Service where the RADIUS server was the primary server (and there is at least 1 backup server).

Changes in 10.31.06.0007	
wns0018025	Resolved a corner case where creating a topology may have an invalid internal VLAN ID causing Controller instability.
wns0018713	Addressed configuration not being applied for guard interval->Short in a Mesh/WDS deployment which resulted in link using Long guard interval.
wns0018751	Changed GUI dashboard verbiage under Health to "APs with Low Link Speed"
wns0018798	Resolved RADIUS Accounting sending interim accounting messages despite the interval set to "0" (disabled).
wns0018830	Addressed floor plans being deleted between HA paired controllers when managed by ExtremeManagement.
wns0018833	Corrected failover scenario for external antenna APs that would disable their radios while in a Mesh/WDS link.
wns0018861	Addressed scenario for multiple WLAN services having common RADIUS servers configured. If the common RADIUS Server went down, the WLAN Service with only 1 primary RADIUS server would not accept new RADIUS requests because of it being marked as down.

Changes in 10.31.05.0003	
wns0018482	Addressed corner case where ordering of WLAN Services assigned to AP could prevent clients from roaming.
wns0018613	Corrected the ability to add multiple domains to Hotspot identification field.

Enhancements in 10.31.04.0009	
wns0018137	Added support for dual-2.4 GHz radio for SCALANCE W786C / W788C.

Changes in 10.31.04.0009	
wns0017368	Readjusted change for improved stability for Load Balance Groups when many clients are within the same group
wns0017422	Corrected Guest Account session lifetime to act as an upper bound on the session duration
wns0018026	Resolved invalid link speed being reported by AP during LACP bonding negotiation
wns0018046	Improved client roaming with Mobility enabled between HA pairs running V9 and V10
wns0018057	Modified Device fingerprint signature for HP Printer to show correct OS
wns0018375	Corrected corner case where changing domain keys could prevent Radar from turning ON
wns0018446	Adjusted radio configuration logic to ensure that changes to privacy for defined service are propagated correctly.
wns0018508	Improved stability for handling Configuration of WLAN Services with RADIUS Accounting delivery without a defined RADIUS server.
wns0018524	Improved protection against bad frames on AP38xx and AP39xx
wns0018545	Resolved Location Engine showing multiple audit log entries that a floor plan has been deleted.
wns0018553	Corrected logic for filtering rule when using an IP port of '0' which could cause Web traffic to be blocked.
wns0018556	Improved cloud connector's state machine to protect against interrupted connections, for ExtremeCloud™ managed Access Points.

Enhancements in 10.31.03.0012	
wns0017956	Added existing reports for 'Clients by AP' and 'Clients by VNS' under the Reports > Clients menu.
wns0018087	Added Country Support for Russia for AP3916ic-ROW.
wns0018088	Added Country support for Dominican Republic for AP3916ic-ROW.
wns0018089	Added Country support for Ecuador for AP3916ic-ROW.
wns0018090	Added country support for South Africa for AP3916ic-ROW.
wns0018091	Added Country support for Taiwan for AP3916ic-ROW.
wns0018092	Added Country support for Indonesia for AP3912i-ROW.
wns0018093	Added Channels 116-128 (DFS Channels) for Columbia for AP39xx-FCC.
wns0018094	Added Channels 116-128 (DFS Channels) for Puerto Rico for AP39xx-FCC.
wns0018095	Added Channels 116-128 (DFS Channels) for United States for AP39xx-FCC.

Changes in 10.31.03.0012	
wns0017164	Improved AP3935 stability when Guardian Mode is enabled will all features set.
wns0017368	Improved stability for Load Balance Groups when many clients are within the same group
wns0017377	Addressed instability on AP37xx and AP38xx when convert multicast-to-unicast feature is enabled
wns0017478	Improved Airtime Fairness algorithm for when only 1 WLAN Service has it enabled.
wns0017916	Corrected Wireless Client reports not loaded due to special characters in hostname or username.
wns0018005	Resolved LACP not working on AP3825 after upgrade to 10.31.01.0048.
wns0018008	Addressed reporting inconsistency where AP39xx was showing incorrect noise floor levels
wns0018062	Addressed Potential Vulnerability of AP/Controller in CVE-2016-10229
wns0018078	Resolved config restore for CLI command 'called-station-id-ssid disable' when upgrading from 9.21.x to 10.31.x
wns0018139	Addressed memory leak on AP37xx and AP38xx when 11k enabled

Enhancements in 10.31.02.0007	
wns0017991	Added Country support for Kuwait for AP3916ic.
wns0017992	Added Country support for Philippines for AP3916ic-ROW.
wns0017993	Added Country support for Singapore for AP3916ic-ROW.
wns0017994	Added Country support for Malaysia for AP3916ic-ROW.
wns0017995	Added Country support for Hong Kong for AP3916ic-ROW.
wns0017996	Added Country support for Peru for AP3916ic-ROW.
wns0017997	Added Country support for Singapore for AP3912i-ROW.
wns0017998	Added Country support for Trinidad & Tobago for AP3912i-ROW.
wns0017999	Added Country support for Dominican Republic for AP3912i-ROW.
wns0018000	Added Country support for Ukraine for AP3825i.
wns0018001	Added Country support for Uganda for AP3800 models.
wns0018017	Added FCC DFS Channel support for AP3916iC-FCC and AP3916ic-ROW models.
wns0017430	Added a second configuration option for sending RADIUS accounting packets; send to only one server (round-robin).
wns0017611	Added AP support for Pronto Captive Portal.
wns0017898	Introduced a process to update AP Webserver certificate prior to expiration when using FFECP @ AP.

Changes in 10.31.02.0007	
wns0016226	Improved configuration import logic to prompt user to re-enter corrupted Radius Secret values instead of halting import process.
wns0017126	Enhanced logic in Background Scan and Quiet IE functions for 802.11k to better handle effect of devices in Power Save Mode
wns0017305	Added new signature "APP: FACEBOOK-ZERO" to detect new Facebook flow.
wns0017620	Corrected logical error for AP37xx (both radios) and AP38xx (2.4GHz radio) when triggered it does not always restart the Rx path after the queues have been drained which results in the radio getting stuck
wns0017752	Addressed client connectivity issue with AP3805i-FCC and AP3935i-FCC when switching a WLAN privacy between WEP(128-bit) and WPA-PSK(AES)
wns0017926	Improved stability on AP3935/AP3965 when SIAPP traffic is present.
wns0017968	Addressed the RFC3580 support for RADIUS Access-Request Called-Station-Id to use format BSSID:SSID.
wns0018004	Improved 11k stability during background scan when Radar is detected.
wns0017221	Addressed TCP connection sessions still showing ESTABLISHED by purging MU and HOST tables after session timeout.

New features in V10.31.01.0048

Introduces AP3916ic (2x2 11ac wave 2) with integrated infrared camera

- AP3916ic is a 2x2 dual concurrent 5GHz/2.4GHz band AP with an integrated 2MB camera. It supports 11ac Wave 2 on the 5GHz radio and 11n on the 2.4GHz radio. The onboard camera is equipped with a 2MB sensor which supports up to 1080p real time video streaming. The on-board camera is ONVIF certified enabling third party video management support.
- There are two new models available:
 - AP3916ic-FCC for the FCC region:
COLOMBIA, PUERTO_RICO, UNITED_STATES
 - AP3916ic-ROW for the rest of the world region
AUSTRALIA, AUSTRIA, BELGIUM, BOSNIA_HERZEGOVINA, BULGARIA, CANADA, CROATIA, CYPRUS, CZECH, DENMARK, ESTONIA, FINLAND, FRANCE, GEORGIA, GERMANY, GREECE, HUNGARY, ICELAND, IRELAND, ITALY, KOSOVO, LATVIA, LIECHTENSTEIN, LITHUANIA, LUXEMBOURG, MACAU, MACEDONIA, MALTA, MONTENEGRO, NETHERLANDS, NEW_ZEALAND, NORWAY, POLAND, PORTUGAL, ROMANIA, SLOVAKIA, SLOVENIA, SPAIN, SWEDEN, SWITZERLAND, TURKEY, UNITED_KINGDOM

AP3912/AP3916 IoT GW with iBeacon Support

- Both AP3912i and AP3916ic Access Points are equipped with a Bluetooth Low Energy radio, which now provides iBeacon (Apple based standard) support. When the iBeacon feature is enabled, an iBeacon is transmitted periodically by the AP that can be seen by mobile devices. For example, this feature can be used by way-finding mobile applications to get location information about the user.

Added a pre-defined Topology Multicast Filter for AP3916ic

- WS-Discovery multicast group available in drop down for policy definition of topologies. WS-Discovery is the base multicast group used by ONVIF device discovery.
- This multicast group policy must be applied to the default topology assigned to the CAM function of the AP3916ic in order to support the ONVIF discovery protocol.

Topology Independent Captive Portal @ AP

- In the captive portal support for the B@AP topology, the AP will use fixed IP address 1.1.1.1 for captive portal redirects. Extreme will register sub-domain "portal.ezcloudx.com" and populate public/Extreme DNS server with DNS mapping of 1.1.1.1 for FQDN "portal.ezcloudx.com".
- When MU is redirected to captive portal, AP will include in the URL the FQDN "portal.ezcloudx.com" as AP's address.
- Upgrade from pre v10.31 will require to insert new rules in both "non-auth" and "auth" policies.

Weather Channel Support on AP3916ic

- AP3916ic-ROW has obtained the certification of using the weather channels including 5600MHz-5650MHz sub-bands.
- The certification includes the DFS detection on the weather channels and the 10 mins CAC (Channel Availability Check) before providing the service on the weather channels.

Configurable WDS ACK Timeout

- A new AP configuration option is provided to allow indication of expected distance between two nodes. In particular, for WDS links, distance between WDS points can add significant delay to the roundtrip of control Acknowledgements. The Distance indicator automatically adjusts the timeout values of control functions of the 802.11 stack to improve link quality and reduce retries for links over large distances. It is applicable to all the AP38xx/AP39xx Access Point products.

ACS enhancements for Sites

- This feature allow user to issue "Site Auto Channel Selection" from the main site menu. The controller will forward the command to the 1st active site AP found. The selected AP will forward the command to all other members over SIAPP.
- All the AP in the site group will participate in the ACS operation.

AP LAN MAC address as Called-Station-ID

- This feature allows the user to configure Called-Station-Id overwrite flag with a newly added checkbox.
- When the above check box is enabled, the Called-Station-Id can be overwritten for both the wired and wireless client with the AP Management port MAC address in the Radius request.
- When the above check box is disabled, the wireless client Called-Station-Id uses the BSSID value for the wireless client as before and the AP Management port MAC address for the wired client.

Reporting of AP LAN Link speed and duplex

- The AP inventory report was enhanced to display the negotiated link speed and duplex information for the AP LAN ports.
- A new health check indicator will identify APs with link connections not matching their optimal configuration.

Created a new Regulatory Key to enforce only EGYPT Selection

- As of January 1st, 2017, regulatory requirements in Egypt deployments are required to enforce/assert that deployed access points are only configured according to Egypt compliance regulations. Only Egypt is allowed as an available country.
- A new Regulatory License key (EGY) is now available (Parts: 30319 HW, 30320 Virtual). Once installed, the EGY key restricts the country selection for AP assignment to Egypt (and only Egypt).
- Egypt is no longer available for ROW or MNT keys.

Validation of V2110 with VMWare ESXi 6.5

- Added support for VMWare ESXi 6.5 to the V2110.

New AP configuration properties publisher

- The Push Publisher Report facility was enhanced to provide a new option to publish high-level AP configuration properties as a periodic XML report. The report includes AP name, Serial Number, BSSID, IOT configuration, Location XY coordinates, etc.

Layer 7 Application signature updates for V10.31

- The following signatures were added in this release:

Signature	Display Name
360OVERSEAS	360 Software
ADOBEDTM-COM	Adobe Marketing Cloud
AKISMET-COM	Akismet
ANY-DO	Any.do
AVAST-COM	Avast
AVIRA-COM	Avira
BEACONSINSPACE-COM	BeaconsInSpace
BITDEFENDER	Bitdefender
BITMOJI-COM	Bitmoji
CDC-GOV	CDC
CMCM-COM	Cheetah Mobile
CLOUDFLARESSL-COM	CloudFlare
COMODO-COM	Comodo Security
DOCKER	Docker
DROPBOXAPI-COM	Dropbox
DUOLINGO-COM	Duolingo

LIVESEGMENTSERVICE	ESPN
EVERALBUM-COM	EverAlbum
SCDN-CO	Fastly
FIREEYE-COM	FireEye
FOODUCATE-COM	Fooducate
FOOTMARKS-COM	Footmarks
FOXSPORTSGO-COM	FOX Sports Go
FOXSPORTSGO-UA	FOX Sports Go
FSG-BAMCONTENT	FOX Sports Go
GETTYIMAGES	Getty Images
ULXIMG-COM	HotNewHipHop
HOUSTONTEXANS-COM	Houston Texans Football
HULU-DASH	Hulu
HULUEDGECAST	Hulu
BLOBSTORE-APPLE-COM	iCloud
IDRIVE-COM	IDrive
IFTTT-COM	IFTTT
CCOMRCDN-COM	iHeartRadio
LETGO-COM	Letgo
LIFESUM-COM	Lifesum
LSMDM-COM	Lightspeed Systems
MALWAREBYTES	Malwarebytes
MAYOCLINIC-ORG	Mayo Clinic
MAYO-EDU	Mayo Clinic
MSEDGE-NET	Microsoft CDN
MIMECAST-COM	Mimecast
MOXTRA-COM	Moxtra
MPARTICLE-COM	mParticle
MYFITNESSPAL-COM	MyFitnessPal
UA-MYRADAR	MyRadar
NR-DATA-NET	New Relic
CLOUDMAGIC-COM	Newton
NFL-MOBILE-AKAMAIHD	NFL Mobile -(Android and IOS requests) to Akamai CDN
NFLRUSH-COM	NFL RUSH
UA-NFLRUSH	NFL RUSH
OCULUS	Oculus
PALOALTONETWORKS-COM	PaloAlto Networks
PANDASECURITY-COM	Panda Security
PIKSEL-COM	Piksel
QRADAR-TCP	QRadar

XFORCE-SECURITY	QRadar
SAMSUNG-COM	Samsung
SAMSUNG-CLOUD-COM	Samsung Cloud
SHARINGBOX-COM	Sharingbox
SHOEBOXAPP-COM	Shoebox
SLING-SPSBXSMES	Slingbox
SMITHMICRO-COM	Smith Micro
PICTURELIFE-COM	SmugMug
SNAPADS-COM	Snapchat Advertising
SOPHOSUPD-COM	Sophos
SOPHOSUPD-COM	Sophos
SPACE-MONKEY-COM	SpaceMonkey
SPINRILLA	Spinrilla
SPRINGER-COM	Springer
STEAMCONTENT-COM	Steam
GOAPPS-TCP	Sungy Mobile
GOFOR-ANDROID-COM	Sungy Mobile
SWARMAPP-COM	Swarm
TEAMVIEWER-COM	TeamViewer
TELEGRAM-ORG	Telegram
THRIVE-MARKET-COM	Thrive Market
VADIO-COM	Vadio
VEMBA-IO	Vemba
WXTRIGGERS-COM	Weather Channel
WEBMD-COM	WebMD
WEBROOT	Webroot
WIBBITZ-COM	Wibbitz
WOLFRAM-ALPHA-COM	Wolfram Alpha
AMP-AVAI-COM	Super Bowl 51
SUPER-BOWL51-FISHSOFTWARE	
UA-SUPER-BOWL-51	
BRICKFTP	BrickFTP
IPERF-TCP	iPerf
IPERF-TCP1	
PINGHD	Ping HD
SMOOTHSTREAMS	SmoothStreamsTV
STREAMRAIL	StreamRail
UNITY3D	Unity Game Engine

- Changed the group name for the following Yinzcam fingerprints to Sports:
 - YINZCAM
 - YINZCAM-S3-STORAGE
- Changed the display name for the following Skydrive fingerprints to "Microsoft OneDrive":
 - MESH
 - UA-SKYDRIVE
 - SKYDRIVE-MSN-WEBAPP
 - SKYDRIVE-LIVEFILESTORE-WEBAPP
 - SKYDRIVESYNC-WEBAPP
 - SKYDRIVE-LIVE
 - SKYDRIVE-API
 - SKYDRIVE-SECURESHARE
 - SKYDRIVE-SKYGFX
 - SKYDRIVE-STORAGE
 - SKYDRIVE-STORAGE2

Enhancements in 10.31.01.0048	
wns0017227	Enhanced channel plan logic such that changing the radio mode or channel width does not reset it to 'Auto'.
wns0016397	Corrected logic with channel selection of DFS channels to consider alternate DFS channel for operation after a DFS event (radar). In some countries only DFS band is available for outdoor operation.
wns0017729	Resolved 'AP Performance Report by Radio' columns sorting incorrectly.
wns0017631	Added Country support for South Africa for the AP3912i-ROW
wns0017631	Added Country support for South Africa for the AP3912i-ROW
wns0017632	Added Country support for Chile for the AP3912i-ROW
wns0017633	Added Country support for Philippines for the AP3912i-ROW
wns0017635	Added Country support for China for the AP3912i-ROW
wns0017636	Added Country support for Saudi Arabia for the AP3912i-ROW
wns0017637	Added Country support for Jamaica for the AP3865e
wns0017680	Added Country support for UAE for the AP3912i-ROW
wns0017715	Added Country support for Antigua Barbuda for the AP3935i-ROW
wns0017716	Added Country support for Antigua Barbuda for the AP3805i-ROW
wns0017717	Added Country support for Kazakhstan for the AP3912i-ROW
wns0017913	Added Country support for Uganda for AP3935i/e and the AP3965i/e models
wns0017730	Added Antenna support WS-AO-DX07180N for the AP3965e

Enhancements in 10.21.03.0010	
wns0017614	Added support for Scalance W788C and W786C models
wns0017458	Added support for AP3912i-ROW for Korea

Changes in 10.21.03.0010	
wns0015950	Corrected debug statement that could create a stack overflow by printing a value out of bounds, resulting in instability of wireless appliance (controller).
wns0016397	Corrected logic with channel selection of DFS channels to consider alternate DFS channel for operation after a DFS event (radar). In some countries only DFS band is available for outdoor operation.
wns0017030	Improved memory footprint for AP3705 by removing un-necessary in-memory functions and reduced size flow table size to 2048 entries, to avoid possible memory exhaustion conditions.
wns0017187	Corrected issue with propagation of AP tunnel state to peer Controller in High-Availability (HA), which could cause APs to fail in establishment of backup tunnel.
wns0017218	Corrected issue with importing of MAC Blacklists, by improving serialization logic to better handle special characters in MAC listings.
wns0017289	Corrected WEP key initialization logic that could prevent correct establishment with clients using Key Index 4
wns0017291	Improved logic for handling of malformed small frames to protect from possible memory corruption leading to platform instability.
wns0017306	Updated device fingerprint signature to correctly identify "Unify OpenStage WL3" phones
wns0017380	Improved session management logic to protect against possible incorrect radio references, which could result in system instability.
wns0016421	Improved support for Policy MIB and etsysPolicyHttpRedirect to facilitate HTTP redirect policy definitions from ExtremeManagement™ 8.01

Enhancements in 10.21.02.0017	
wns0016942	Update for AP3912 configuration and statistics modules to allow cloud support
wns0016891	Improve Auto-Channel Selection coordination for ExtremeCloud™ deployments
wns0016943	Enable support for MAC Based authentication and Captive Portal on AP3912i wired ports. Note: Support for 802.1x on the port will be provided into a later release.
wns0013138	Added Country Support for AP3935 for Costa Rica
wns0017271	Added Country support for Trinidad & Tobago for AP3935i-ROW
wns0017272	Added Country support for Dominican Republic for AP3935i-ROW
wns0017273	Added Country support for Trinidad & Tobago for AP3805i-ROW
wns0017274	Added Country support for Philippines for AP3805i-ROW
wns0017275	Added Country support for Costa Rica for AP3805i variants (AP3805i/e, AP3805i-ROW)
wns0017295	Added Country Support for AP3965 for Costa Rica
wns0017265	Added Country support for Taiwan for AP3912i-ROW
wns0017266	Added Country support for Russia for AP3912i-ROW
wns0017267	Added Country support for Qatar for AP3912i-ROW
wns0017268	Added Country support for Kuwait for AP3912i-ROW
wns0017269	Added Country support for Peru for AP3912i-ROW
wns0017270	Added Country support for Malaysia for AP3912i-ROW
wns0017276	Added Channels 52-144 (DFS Channels) for Colombia for AP3912i-FCC
wns0017277	Added Channels 52-144 (DFS Channels) for Puerto Rico for AP3912i-FCC
wns0017278	Added Channels 52-144 (DFS Channels) for United States for AP3912i-FCC
wns0017281	Added Country support for Hong Kong for AP3912i-ROW
wns0017296	Added Country Support for AP3912i-ROW for Costa Rica

Changes in 10.21.02.0017	
wns0014750	Adjusted client association management logic to improve buffer management for disconnecting devices.
wns0016281	Optimized AP discovery method to account for low MTU links.
wns0016897	Corrected issue with configuration of Band Preference/Load Control for Sites deployments.
wns0016947	Addressed antenna port assignment logic on AP3805 for non-populated port configurations.
wns0017037	Corrected the problem in the Edit AP dialog. After an auto channel selection, it was possible for the AP Radio to show as “scanning” for a long time and never exit this state. To resolve this, the AP had to be rebooted.
wns0017125	Enforced inclusion of local reference address for NAS-IP-Address when doing local RADIUS authentication in Sites mode.
wns0017185	Addressed AP Multi-Edit race condition for Auto-Channel Selection (ACS) configuration that could cause radio to become non-responsive.
wns0017187	Corrected issued with propagation of AP tunnel state to peer Controller in High-Availability (HA).
wns0017217	Improved performance for handling of fragmented frames in Secure Data tunnel.
wns0017279	Improved compatibility with Ascom Phones i62 for power management frames when aggregation enabled.
wns0017179 wns0017301 wns0017318 wns0017228	Improved performance of SNMP agent to handle large volume of configuration transactions.

Enhancements in 10.21.01.0065	
wns014359	<p>Introduce support for AP3912i, Wall-Plate, 802.11ac Wave 2, up to 1.17Gbps capacity, dual radio, 2x2:2, integrated BTLE/802.15.4 radio. 10.21.01 is the minimum release version of this access point.</p> <p>Extends foundational flow-based architecture to the AP3912i wireless AND wired ports, providing insight and control without impacting network performance in an easy to install package.</p> <p>Support default policy enforcement on wired ports. Policy assignment modeled as wireless service provides consistent enforcement for wireless and wired users.</p> <p>Ubiquitous reporting of wired and wireless clients. Same metrics capability for wired clients, including application visibility reporting and device fingerprinting</p> <p>Supports Control and Data encryption up to 150 Mbps.</p>
wns015804	<p>Introduces IPFIX support for statistics reporting on network and application response times in distributed and centralized modes improving network efficiency and simplifying integration with ExtremeAnalytics</p> <p>Deprecates Mirror-N based method for ExtremeAnalytics integration. IPFix delivers metrics directly to Analytics engine via the Netflow feed. Requires ExtremeAnalytics 7.0.8.</p>
wns0015695	<p>Refreshed client representation into full unified list with user definable criteria</p> <p>Visual indication of 802.11w/PMF capability for associated clients</p> <p>Provide per user Round Trip Time (RTT) metrics split for wireless and network contribution.</p>
wns0015822	<p>Introduce per AP dashboard on operational metrics, including RF configuration, client load representation, channel occupancy and noise floor.</p>
wns0015803	<p>Extends market-leading Extreme Policy with support for Domain Name System (DNS) based rules; reduces rule complexity, improves security, while simplifying integration with external Guest Service applications.</p>
wns0016211	<p>Introduces support for fall through L7 deny rules as well as Wild Cards and Unknown Groups rule sets; reduces management complexity and provides greater flexibility for L7 based policies.</p>
wns0016148	<p>Doubles the maximum session capacity of the V2110 on VMware to 8,192 concurrent sessions per appliance and a total of 16,384 sessions in high-availability mode.</p>
wns0014422	<p>Introduces native integration with Centrak Real-Time Location System (RTLs) for value added location-based services.</p>
wns005741	<p>Channel inspector report provides RF assessment for channel configuration, including CoChannel, adjacency and overlapping SSID configurations for the wireless band from the perspective of a particular AP, helpful to determine congestion or other RF interference related diagnostics.</p>
wns0015801	<p>Enhances Firewall Friendly Captive Portal (FFCEP) at AP to support user authentication via RADIUS from a response to FFCEP credentials. AP ETH MAC address and AP Location added as variables to FFCEP exchange.</p>

Changes in 10.11.05.0005	
wns0016280 wns0016353	Enhanced power save mode logic to improve client wake-up.
wns0016386	Improved stability on Controller when integrating NAC and leveraging Change-of-Authorization (CoA).
wns0016413	Improved reliability of 4-way handshake in congested environments which could affect sensitive clients.
wns0016466	Relaxed restrictions on multicast/broadcast queue management and optimized algorithm to minimize drops.
wns0016498 wns0016863	Improved performance with Chromebooks on AP3700(both radios) and AP3800 (2.4GHz only) where clients entering power save mode would not receive aggregated packets.
wns0016584	Improved configuration logic for deploying FFECF and 802.1x which could result in failure to redirect user.
wns0016592	Corrected noise floor level reporting.
wns0016777	Improved probe suppression logic for when RSS is low to release client instead of sending de-auth.
wns0016906	Addressed Potential Vulnerability of AP/Controller in CVE-2016-5195.
wns0016955 wns0017019	Addressed condition where small encrypted 802.11g frames could affect stability for AP3900.
wns0016986	Improved SSH key management logic to regenerate keys on restart.

Changes in 10.11.04.0008	
wns0014331	Addressed protection mode logic to improve compatibility with Motorola Scanner connecting to 2.4Ghz radio.
wns0016159 wns0016366	Improved logic for client de-authentication that could affect stability during generation of 802.11k Neighborhood reports.
wns0016175	Improved stability by adding prevention for invalid topology ID.
wns0016198	Corrected issue that could cause AP to apply wrong role to client while in Site mode.
wns0016226	Improved configuration import logic to prompt user to re-enter corrupted Radius Secret values instead of halting import process.
wns0016269	Improved memory management in SNMPAgent to improve stability.
wns0016298	Addressed race condition in client disassociating during a failover event that could corrupt session tables.
wns0016364	Correct logic of multicast-to-unicast conversion to improve stability of AP39xx series APs when serving slow clients.
wns0016347	Improved logic for logging function to prevent log file from being flooded.
wns0016390	Addressed use case for VNS Wizard when using role based redirection.
wns0016450	Improved stability for look up on missing rates.

Enhancements in 10.11.04.0008	
wns0011752	Log recommendation for user to change AP default Password every 30 days.
wns0012837	Added support for AP3825i in Uganda.
wns0016453	Added country support for Taiwan for AP3805i-ROW.
wns0016454	Added country support for Argentina for AP3805i-ROW.
wns0016455	Added country support for Korea (ROC) for AP3805i-ROW.
wns0016456	Added country support for South Africa for AP3805i-ROW.
wns0016457	Added country support for Serbia for AP3825i/e.

Enhancements in 10.11.03.0004	
wns0015680	Added Country Support for Kazakhstan for AP3965i/e_ROW.
wns0016062	Added country support for Russia for AP3965i/e-ROW.
wns0016063	Added Country Support for Brazil for AP3935i/e_ROW.
wns0016064	Added Country Support for Brazil for AP3965i/e_ROW.
wns0016065	Added Country Support for Mexico for AP3805i_ROW.
wns0016066	Added Country Support for Uruguay for AP3825i/e.
wns0016067	Adjusted Power settings for Macau to leverage 200mw allowance in 2.4 GHz (B/G/N) for AP Update AP38xx and AP39xx models.
wns0016073	Added country support for Brazil for AP3805i-ROW.
wns0016074	Added Country Support for Nicaragua for AP3935i/e-ROW.
wns0016075	Added Country Support for Nicaragua for AP3965i/e-ROW.

Changes in 10.11.03.0004	
wns0015352	Adjusted parsing logic of RADIUS attributes to avoid stripping of domain name information for Captive Portal Authentication.
wns0015593	Enhanced Guest account management interface to support multi-edit for Account lifetime.
wns0015807	Improved packet processing logic for core assignment to address possible instability during high-rate flows on wave2 Access points.
wns0015880	Corrected endianness conversion issue that could cause malfunction of Mac Based Authentication (MBA) for AP39xx models.
wns0015950	Corrected debug statement that could create a stack overflow by printing a value out of bounds, resulting in instability of wireless appliance (controller).
wns0015963	Corrected inclusion logic of Class attribute on Radius Accounting for 802.1x networks in 10.11.x software.

wns0015980	Improved logic in Deep Packet Inspection (DPI) Engine to address possible instability when Application Visibility enabled for a WLAN service under high traffic loads.
wns0016013	Corrected issue with reporting of user statistics by Access Points, which could result in inadvertent idle timeout of registered devices.

Enhancements in 10.11.02.0032	
Software	
	Introducing IPv6 support for Bridge at Wireless Controller and Tunnel at Wireless Controller topology with IPv6 filter rules and IPv6 Proxy support.
	Added support for time-based subscription licenses when integrated with ExtremeManagement.
	Introducing the WS-AP3935i-IL, Indoor Wave 2 for Israel under the ROW regulatory domain.
	Introducing a GUI page for AP38xx/37xx to provide support for the Dräger Certification.
	Provide Warning in AP Grouping's WLAN Config quick action.
	Replaced throughput pie chart with historical throughput chart from user selectable application groups.
	Adding IGMP on AP37xx/AP38xx/AP39xx including support for IGMP V3 Multicast Group Registration and IGMP V2 Query/Report.
wns0013111	Added country support for Korea for the AP3935i/e-ROW.
wns0015674	Added country support for Kazakhstan for the AP3825i/e under ROW regulatory domain.
wns0015675	Added country support for Kazakhstan for the AP3805i/e under ROW regulatory domain.
wns0015676	Added country support for Kazakhstan for the AP3801i under ROW regulatory domain.
wns0015677	Added country support for Kazakhstan for the AP3865e under ROW regulatory domain.
wns0015678	Added country support for Kazakhstan for the AP3805i-ROW.
wns0015679	Added country support for Kazakhstan for the AP3935i/e-ROW.
wns0015680	Added country support for Kazakhstan for the AP3965i/e-ROW.
wns0015681	Added country support for Chile for the AP3805i-ROW.
wns0015682	Added country support for Russia for the AP3805i-ROW.
wns0015683	Added country support for Georgia for the AP3805i-ROW.
wns0014684	Added country support for Ecuador for the AP3805i-ROW.
wns0015685	Added country support for Ecuador for the AP3965i-ROW.
wns0015748	Added country support for Korea for AP3965i-ROW and AP3965e-ROW.
wns0015752	Added support for DEMO for AP3935i-IL.

Changes in 10.11.02.0032	
wns0012777	Optimized background scanning algorithm to improve stability of AP3800 series APs
wns0015281	Addressed issue with limited connectivity for Intel Clients. See known issues for other cases
wns0012074	Updated V2110 network device drivers to improve stability and host interoperability
wns0015550	Improved logic to recover from possible radio stalling during configuration.
wns0014589	Corrected user guide to correct description of CSV fields that carry user session lifetime.
wns0015121	Addressed issue with packet fragmentation logic on AP3935 which could affect Client connections over VPN
wns0015715	Corrected issue with handling of HTTPS for Captive Portal redirection
wns0014382	Updated packet buffer handler to address message corruption for secure tunnel connections
wns0015436	Adjusted radio logic handling to protect against aggressive client behavior of frequent changes in Power-Save mode for mixed client environments.

Enhancements in 10.11.01.0210	
Software	
Enhanced customer control over network traffic operation, by providing visibility of the Top 5 application groups per SSID and per individual user on the wireless appliance dashboard and report.	
Introducing new policy definition and enforcement to support Layer7/application rules specific to control (allow, deny, QoS, rate limiting, VLAN containment) for over 3,000 fingerprints covering 2,000+ web-based applications.	
Improved visibility of associating devices by providing improved fingerprinting of client device's device type and operating system. Device characteristics are represented on the device's report as well as an aggregate representation of top 5 device types and OS on a per WLAN basis.	
Improved visibility and flexibility of roles defined for Captive Portal functions, by introducing an explicit REDIRECT action. This action allows user to specifically define when HTTP/HTTPS redirection should take place within the role.	
Enhanced Access Points (AP38XX/39XX) to directly support redirection and Firewall Friendly External Captive Portal (FFECP) for distributed topologies.	
Added support for wireless countermeasures to the AP39XX Series platforms.	
Added the ability to hide the SSID for a WDS mesh for increased security.	
Streamlined the AP configuration simplifying the process of provisioning of large-scale AP deployments.	
Upgraded the operating system to a 64bit kernel for the wireless appliances.	
Enhanced Batch Location Report (BLR) to include the option to provide snapshot of full set of statistic metrics for associated Mobile Units (Mus)	
Increased the number of APs that can be configured as a site to 100 and 2,000 sessions.	
Enhanced the SNMP interface to include PerProtocol statistics.	

wns0015080	Added country support for Ecuador to the AP3965e-ROW.
wns0015082	Added country support for Colombia to the AP3805i-FCC.
wns0015077	Added country support for United Arab Emirates to the AP3965i/e-ROW.
wns0015087	Updated Pakistan and Mexico to the latest regulations for all tables.
wns0015081	Added country support for Mexico to the AP3965i/e-ROW.
wns0015096	Added country support for India to the AP3935i/e-ROW.
wns0015086	Added country support for Pakistan to the AP3805i/e and AP3825i/e.
wns0015093	Added country support for Mexico to the AP3935i/e-ROW.
wns0015079	Added country support for India to the AP3965i/e-ROW.
wns0015085	Added country support for Argentina to the AP3805i/e and AP3865e.
wns0014815	Added country support for Malaysia to the AP3935i/e and AP3965i/e-ROW.
wns0015078	Added country support for Hong Kong to the AP3965i/e-ROW.
wns0015084	Added country support for Morocco to the AP3825i
wns0015094	Added country support for United Arab Emirates to the AP3935i/e-ROW.
wns0015076	Added country support for Pakistan for the AP3935i/e and AP3965i/e-ROW.
wns0015083	Added country support for Saudi Arabia to the AP3805i-ROW
Changes in 10.11.01.0210	
wns0013712	Addressed possible exposure to OpenSSH keyboard-interactive authentication (CVE-2015-5600)
wns0014390	Improved memory allocation management for AP3705 to better handle high utilization loads.
wns0014899	Fixed timer for Inter-AP Protocol to reduce the number of multicast transmissions for Auto Channel Selection exchanges
wns0014333	Addressed possible issue with radio operational mode after removal of WLAN services. When administrator Added or removes WLANS services from the radio, clients associated to other WLANS on the same radio may experience temporary service interruption. Clients on the radio are disassociated and will re-associate soon after service is restarted.
wns0014488	For AP3705i, booting up is delayed until flash clean-up is finished (up to 5 minutes). Improved resilience on recovery from hard-power reset/interruption
wns0014431	Fixed password generator tool for the add guest user dialog
wns0015157	Updated configuration handler for hostname to remove leading and trailing 'space' characters. Space characters are not supported in Hostname definition and can cause configuration backup/restore to fail
wns0014080	Corrected issue with handling of Multicast definitions for Access Points configured in Site Mode
wns0013918	Ensure consistency of username reporting in radius accounting-request packets

wns0013916	Addressed Acknowledgment to NAC on policy change authentication after a Captive Portal authentication
wns0013997, wns0014278	Addressed Potential Vulnerability of APs to CVE-2015-4000, CVE-2015-3197, CVE-2015-0204, CVE-2016-0800
wns0014009	Improved key management protection to address possible key corruption for 802.1x authentication
wns0014729	Addressed Radius client recovery after target Server IP configuration changes
wns0014298	Corrected handling of deny default action on B@AP for AP39xx series devices
wns0014415	Fixed channel plan pop-up when adjusting large number of APs in multi-edit
wns0014426	Addressed memory management issues when configuring MU blacklists
wns0014565	Addressed issue with possible corruption of Radius IP address configuration via SNMP
wns0014085	Corrected IPv6 address parsing for the management interface when added via the CLI
wns0015240	Adjusted validation logic for derived key maximum key length for 802.11r (Fast Transition) configuration. Misconfiguration could cause AP3800 series radio to not initialize correctly.
wns0013505	Fixed issue when controller didn't send Siemens-SSID RADIUS value for a fast-failover event
wns0014148	Addressed Potential Vulnerability of APs to CVE-2015-7547
wns0014251	Updated AP3825i/e power settings for band 1 and 4 to comply with new FCC Part 15 UNII rule with DFS, introduced new AP-ID number (-1). This is required in order to keep shipping beyond June 2016. The new rules increased power in band 1 but reduced power in band 4.
wns0015206	Addressed possible instability for AP3800 series devices in handling of client connectivity management features (Steering, Balance, Probe Suppression)

Changes in 10.01.05.0008	
wns0013289 wns0014572	Improved handling of broadcast packets for AP3900 series APs
wns0014085	Added support of topology groups in the exception filters for internal captive portal
wns0014371	Improved probe suppression logic to also block 802.11 AUTH requests
wns0014415	Fixed channel plan pop-up when adjusting large number of APs in multi-edit
wns0014426	Addressed memory management issues when configuring MU blacklists
wns0014431	Fixed password generator tool for the add guest user dialog
wns0014570	Resolved issue with APs in Guardian mode not reporting location data for 5.0 GHz radio.
wns0014777	Fixed race condition when learning new addresses with ARP proxy enabled
wns0014633	Enhanced Location logs to include X, Y coordinates for tracked devices
wns0014690	Resolved issue with possible image upgrades failures to 10.01.04 build for AP3900 series APs
wns0014729	Addressed Radius client recovery after target Server IP configuration changes
wns0014899	Fixed timer for Inter-AP Protocol to reduce the number of multicast transmissions for Auto Channel Selection exchanges

Enhancements in 10.01.05.0008	
wns0013123	Added country support for Russia to the AP3935i/e
wns0014654	Added country support for Bosnia Herzegovina to AP3801i
wns0015077	Added country support for Bosnia Herzegovina to AP3805i/e
wns0014656	Added country support for Bosnia Herzegovina to AP3805i-ROW
wns0014657	Added country support for Bosnia Herzegovina to AP3825i/e
wns0014658	Added country support for Bosnia Herzegovina to AP3825i/e-1
wns0014659	Added country support for Bosnia Herzegovina to AP3865e
wns0014660	Added country support for Bosnia Herzegovina to AP3935i/e
wns0014661	Added country support for Bosnia Herzegovina to AP3965i/e
wns0014677	Added country support for Peru to AP3965i/e
wns0014679	Added channels 52-144 (DFS) for Colombia, Puerto Rico, and United States to AP3965i/e
wns0014806	Added country support for Hong Kong to the AP3805i-ROW
wns0014807	Added country support for Kuwait to the AP3805i-ROW
wns0014808	Added country support for Peru to the AP3805i-ROW
wns0014809	Added country support for Dominican Republic to the AP3805i-ROW
wns0014810	Added country support for Malaysia to the AP3805i-ROW

Enhancements in 10.01.05.0008	
wns0014811	Added country support for Qatar to the AP3805i-ROW
wns0014812	Added country support for Singapore to the AP3805i-ROW
wns0014813	Added country support for China to the AP3805i-ROW
wns0014814	Added country support for Chile to the AP3935i/e and AP3965i/e
wns0014815	Added country support for Malaysia to the AP3935i/e and AP3965i/e
wns0014816	Added country support for Kuwait to the AP3965i/e
wns0014817	Added country support for Qatar to the AP3965i/e
wns0014818	Added country support for Ecuador to the AP3935i/e
wns0014765	Added country support for South Africa to the AP3935i/e
wns0014766	Added country support for South Africa to the AP3965e
wns0014488	For AP3705i, delayed booting up until flash clean-up is finished (up to 5 minutes). Improved resilience on recovery from hard-power reset/interruption

Changes in 10.01.04.0011	
wns0013847	Corrected logic for timer handling to address possible connectivity issues for APs operational for long-periods of time
wns0013916	Addressed Acknowledgment to NAC on policy change authentication after a Captive Portal authentication
wns0013918	Ensure consistency of username reporting in radius accounting-request packets
wns0014298	Corrected handling of deny default action on B@AP for AP39xx series devices.
wns0014358	Updated probe suppression algorithm to adhere to Qualcomm usage pattern, addressing possible resource exhaustion
wns0014371	Improved probe suppression logic to also block 802.11 AUTH requests
wns0014389	Addressed possible transmit lockup due to group rekeying operations
wns0014390	Improved memory allocation management for AP3705 to better handle high utilization loads.
wns0014416	Fixed channel plan pop-up when adjusting large number of APs in multi-edit
wns0014037	Improved More-Data indication for Power Save mode. Improved WMM (QoS) logic to ensure that AMPDU is only enabled for clients that support the function.
wns0013997	Addressed Potential Vulnerability of APs to CVE-2015-4000, CVE-2015-3197, CVE-2015-0204
wns0014148	Addressed Potential Vulnerability of APs to CVE-2015-7547

Enhancements in 10.01.04.0011	
wns0013106	Add country support for Hong Kong to the AP3935i/e
wns0013124	Add country support for Saudi Arabia to the AP3935i/e
wns0013126	Add country support for Singapore to the AP3935i/e
wns0013129	Add country support for Thailand to the AP3935i/e and AP3965i/e
wns0013542	Introduce support for AP3805 FCC & ROW models
wns0013757	Add country support for Indonesia to AP3801i, AP3805i/e and AP3825i/e
wns0014239	Add country support for Peru for AP3935i and AP3935e
wns0014240	Add country support for Taiwan for AP3965i and AP3965e
wns0014241	Add country support for Singapore for AP3965i/e
wns0014242	Add country support for Channels 116-128 on AP3935i/e in Taiwan
wns0014251	Add support for AP3825i-1 and AP3825e-1 models
wns0014347	Add support WS-AO-DX10055N antenna to AP3965e
wns0014448	Add country support for China to AP3935i/e and AP3965i/e
wns0014449	Add country support for Qatar to AP3935i/e
wns0014450	Add country support for Kuwait to AP3935i/e
wns0014451	Add country support for Egypt to AP3935i/e and AP3965i/e
wns0014452	Add country support for Jordan to AP3935i/e and AP3965i/e
wns0014453	Add DFS Support (Channels 52-144) to AP3935i/e-FCC models
wns0014454	Add country support for Philippines to AP3935i/e and AP3965i/e.
wns0014455	Add country support for Indonesia to AP3935i/e and AP3965i/e
wns0014456	Add country support for Saudi Arabia to AP3965i/e
wns0014457	Add country support for Brunei to AP3805i and AP3865e.
wns0014458	Add country support for Vietnam to AP3805i, AP3825i, and AP3825i-1.
wns0014459	Add country support for Malaysia to AP3805i, AP3825e, AP3825e-1, and AP3865e.
wns0014460	Add support for WS-AI-DX10055 antenna to AP3935e

Changes in 10.01.03.0007	
wns0013859	Resolved issue where AP could get stuck in scanning mode until it is rebooted
wns0013942	Corrected ipv6 address parsing when added via the CLI
wns0014009	Resolved 802.1X authentication client connection issues
wns0014075	Fixed controller configuration check routine for overlapping subnets on different interfaces, this use case is not supported
wns0014080	Fixed site mode B@AP multicast filter configuration updates AP properly
wns0014153	Improved handling of Fast Transition state for 802.11r
wns0014185	Fixed duplicate L2 updates when new client associated to AP which caused invalid MAC addresses on the AP switch port

Enhancements in 10.01.02.0038
Hardware
Introduces support for the ExtremeWireless AP3965i/e, a fully featured outdoor 4x4:4 dual radio 802.11ac Wave 2 AP, providing up to 2.5 Gbps over-the-air performance, multi-user MIMO, built-in wired load balancing for high-density and mission critical deployments.
Software
Added support for wireless countermeasures to the AP39XX Series platforms.
Added country support for the Philippines to the AP3825i/e under the ROW domain.
Extended the AP3935/3965 functionality to support higher power request levels via LLDP.
For AP3935 and AP3965, a manual overwrite configuration function through the Controller interface was provided to allow the administrator to overwrite the power mode, setting the AP explicit into full power mode (equivalent to 802.3at operation for full 4x4:4 operation).
For AP3935 and AP3965, the per-radio user capacity was increased to at least 240 devices.



Changes in 10.01.02.0038	
wns0011674	Corrected a problem when the controller was no longer reachable via SMTPv3 if the user set a password with special characters.
wns0012997	Restricted transmission of Ethernet pause frames on the AP3805i.
wns0012007	Bypass filtering functions if no filter rules defined.
wns0013502	Corrected Radius accounting state machine relevant start messages when the interval was set to 0.
wns0013505	Corrected a problem whereby the controller didn't send Siemens-SSID RADIUS value for a fast-failover event.
wns0013712	Addressed a possible exposure to the OpenSSH keyboard-interactive authentication vulnerability (CVE-2015-5600).
wns0013620	Resolved iStat device not staying connected with WPA2-PSK authentication.
wns0013761	Updated the AP3865e power settings to comply with the latest Industry Canada (IC) Regulations. Removed band 1 for all antennas with the exception of the WS-ANT-5DIPN; changed band 1 channels 36-48 power to meet 50mW limit and indoor Only for WS-ANT-5DIPN.

Enhancements in 10.01.01.0129	
Hardware	
Introduces support for the ExtremeWireless AP3935i/e, a fully featured 4x4:4 dual radio 802.11ac Wave2 AP, providing up to 2.5 Gbps over-the-air performance, multi-user MIMO, built-in wired load balancing and transparent PoE failover for high-density and mission critical deployments.	
Added support for new quad and eight-feed MIMO antennas to optimize the RF advantages of 4x4:4 in high-density deployments.	
Software	
Enhanced the discovery mechanism of the management plane on the AP39XX Series enabling secure discovery over SSL of the management service through the public cloud. The on-premise discovery mechanism and secured control channel for on-premise controllers remains unchanged from previous releases.	
Added support for Hotspot 2.0 functionality, enabling transparent mobility between cellular data networks and hotspot Wi-Fi networks. New services include support for 802.11u, enabling pre-authentication network selection.	
Enhancements doubles the maximum user/device capacity of the C5210 wireless appliance from 8,000 to 16,000 users/devices per appliance and a total of 32,000 users in high-availability mode.	
Increased the map size for location tracking and added enhancements to track and report location of un-associated devices.	
Licensing modifications to support moving regulatory enforcement to the AP39xx Series APs, enabling flexibility for global deployments by eliminating controller regulatory restrictions; a single wireless appliance installation can support both FCC and ROW deployments.	
Provide administrative control over guest password generation algorithm to generate simpler and more localized passwords for Guest Login.	
Include Area/Location information elements in 802.1x requests when Area Notification for MBA enabled (wns0012660)	

Enhancements in 10.01.01.0129
Resolved limitation on V2110-Small to provide N-Packet mirroring for Application Visibility integration. N-Packet Mirroring supported on all capacity variants of V2110 (wns0012749)
Validated support for V2110 installations on VMWare ESXi 6.0.
Enhanced Batch Location reporting interface to support definition of header authentication credentials.
Introduced administrative method for configuring the level of security protocol used in inter-controller and controller / NetSight communications.
Enhanced export of AP inventory report to include the BSSID information for configured services per AP.
Added support to automatically bind the inter-controller communications channel to user installed (CA signed) certificate.
Extended information elements of Location Batch Report to include Area, AP SN and Authentication state identifiers.
Enforce definition of AP password on controller install through CLI and GUI install wizards.
Static routing entries can now refer to next hops reachable through B@AC (L3) topologies.
Added option to customize format of CallingStation-ID field in 802.1x requests by allowing binding to format definition of Mac-Based-Authentication (MBA)
Introducing the new ExtremeWireless™ branding.

KNOWN RESTRICTIONS AND LIMITATIONS:

Known Restriction or Limitation	I.D.
<p>The work required to fix wns0022970 is not trivial and needs lot of change and would require re-writing antennas. So workaround is mentioned in the PR in tracker. Steps found for workaround.</p> <ul style="list-style-type: none"> - Navigate to AP - > Aps - Select any “good” AP, with an internal antenna of the same model fo the affected Access Point(ex: AP3915i) - Click on the “configure” button and then “Edit AP” window will open. - Click on the “Copy to Defaults” button. - Click on the close button, to close the “Edit AP” window - Select the affected AP. - Click on the “Delete” button to remove the affected AP(s) from the database of the wireless controller. - Re-register/add the AP(step-5) that you have just deleted from the database to the wireless controller. <p>In the case of not have any existing AP with internal antennas, already added to the system, then you you may have to reset the configuration of the wireless controller to factory defaults and reload an existing backup configuration or if a back configuration is not available then you have to reconfigure the system.</p>	<p>wns0022970</p>
<p>Intel AC8265 client card sometimes fails to authenticate with AP (11r & MFP enabled) This is a Microsoft Windows 10 supplicant (Win Zero) issue. Will be fixed in Windows 10 – 19H1 release.</p>	<p>Info</p>
<p>If using Standard SSID->Hotspot->Enabled, prior to upgrading to 10.51 please ensure that the description fields for language configuration are not left blank in your Service Provider Settings.</p>	<p>wns0021808 -- Info</p>
<p>iPad clients may experience issues receiving IP address via DHCP as a result of ‘Admission Control’ being enabled within a WLAN Service. It is recommended to disable ALL ‘Admission Control’ options if iPad clients are expected to associate to the WLAN.</p>	<p>wns0021217 -- Info</p>
<p>Known Issue for AP3825: Disable MFP if clients are experiencing connectivity issues due to a poor signal (rule of thumb). Only a specific corner case issue was fixed in wns0020142. Different clients are behaving different when MFP is enable.</p>	<p>wns0020142 -- Info</p>
<p>Some wireless clients may experience connectivity issues with MFP and/or FT enabled. (They will not complete the 4-way handshake in order to complete the association process.)</p> <ul style="list-style-type: none"> • Qualcomm Killer Wireless 1535 -- driver Qualcomm Atheros Communication Inc., version 12.0.0.448 • Intel Dual Band Wireless-AC 8265 – driver Intel 19.50.1.5 • Intel Dual Band Wireless-AC 8260 – driver Intel 18.40.2.3 	<p>wns0020429 – Info</p>

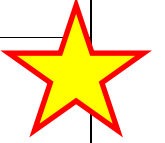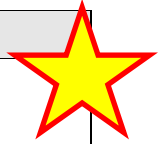

<p>Vulnerability Notice: VN 2018-001 (CVE-2017-5715, CVE-2017-5753 - Spectre) VN 2018-002 (CVE-2017-5754 - Meltdown)</p> <p>ExtremeWireless controllers and Access Points are not vulnerable. User cannot execute externally crafted programs under normal operating conditions.</p>	<p>Info</p>
<p>IoT iBeacon Scan configuration</p> <p>If enabling the iBeacon Scanner function for AP391x models, it's not recommended to configure a Scanner Window (Dwell Time) that is larger than 80% of the configured Scan Interval. Doing so may lead to instability of the scanning function. This is a temporary restriction and will be addressed in an upcoming release.</p>	<p>Info</p>
<p>Vulnerability Notice 2017-005 - KRACK, WPA2 Protocol Flaw (client-side responsibilities)</p> <p>The Software updates released with 10.41.01.0082 protect the infrastructure side (AP) from exploitation. However, wireless clients may still be vulnerable until their drivers are updated. Please contact the client software vendor for driver updates related to addressing these vulnerabilities related WPAv2 key management.</p>	<p>Info</p>
<p>Some Intel Wi-Fi clients fails to obtain an IP address after 'Resume from Sleep' mode.</p> <p>Fixed in latest Intel driver (July 2017). For more information, see: https://downloadmirror.intel.com/26924/eng/ReleaseNotes_WiFi_19_70_0.pdf</p>	<p>Info</p>
<p>Some devices are not connecting to a WPA2-PSK service when Management Frame Protection (MFP) is enabled</p> <p>See KB for more information: https://gtacknowledge.extremenetworks.com/articles/Solution/Certain-devices-not-connecting-to-WPA2-PSK-on-5ghz-radio-when-Management-Frame-Protection-is-enabled</p>	<p>Info</p>
<p>When using the CLI to configure the URL for the Hotspot, the command line only accepts the "https://". Use the GUI page to enter the URL of "http://".</p>	<p>wns0019160 - Info</p>
<p>The camera module for the AP3916ic operates under its own firmware. Camera firmware upgrade is integrated within ExtremeWireless™ firmware images and is managed by the ExtremeWireless™ appliance. If the firmware upgrade of an AP3916ic camera is deemed to have failed (see AP logs), remotely perform an admin reboot the AP (UI or CLI). The rebooting will re-start the camera's firmware upgrade process and the issue will be corrected. Camera firmware upgrade failures are uncommon, but could be experienced during the upgrade of an AP3916ic connected through mesh.</p>	<p>wns0019127 - Info</p>
<p>When the AP is configured on both availability pairs, the AP SSH password must be the same on both controllers. This is to endure that when the AP fails over to the secondary controller, the remote console will not be denied on the secondary controller.</p>	<p>wns0019148 - Info</p>
<p>When the AP is functioning as a WDS/MESH child/repeater, the remote packet capture function is not supported in V10.41.01.80.</p>	<p>wns0019188 - Info</p>

<p>L7 Policy does not block Sky Go on smartphones or tablets.</p> <p>Workaround:</p> <ul style="list-style-type: none"> • Create custom web filter for Sky Go. • Add the following URLs: <ul style="list-style-type: none"> • name = sky_go_1 matching pattern = .sky. • name = sky_go_2 matching pattern = skylivehls.cdn.fastweb. • name = sky_go_3 matching pattern = .skycdn. <p>Note: Periods must be included.</p> <p>See also the KB:</p> <p>https://gtacknowledge.extremenetworks.com/articles/Solution/L7-Policy-does-not-block-Sky-Go-on-smartphones-or-tablets</p>	<p>wns0018022 - Info</p>
<p>If the tagged VLAN ID of a "Bridge Traffic Locally at AP" VNS topology is changed, the associated WLAN Service forwards traffic for both the original and new VLAN ID.</p> <p>Workaround: AP needs to be rebooted after changing VLAN ID.</p>	<p>wns0017485 - Info</p>
<p>After upgrade to V10.31.01, the Locator may not display all the APs properly in an HA configuration. Restart the Locator by disabling and enabling the location engine. This will solve the issue and result is the APs displaying properly.</p>	<p>wns0017681 Fixed in 10.31.03.0012</p>
<p>For 802.11n/2.4 GHz clients LDPC will be disabled by the AP firmware even though the LDPC has been selected from the GUI and the LDPC bit is set in the association response packet sent by the AP. This has no known impact on connectivity and there will be no "L" in the client report's protocol column.</p>	<p>wns0017831 - Info</p>
<p>When the WDS or MESH service is configured on the radio and deployed as either a child or as a parent with active children, the on-demand radio scan should not be performed on the radio under the Channel Inspector Report.</p>	<p>wns0017906 - Info</p>
<p>Even though users typically perceive a popular website or application as a unified destination, the reality is that most modern applications and websites utilize a web of service providers in the background to deliver their presentation layer and specific user experience. Often these websites rely on content that is being sourced from other established service providers such as content delivery networks. Most often, these engagements by the application or browser are interchanges with URLs that bear no resemblance to the application using them. As such, during a particular application interaction, only certain flows may be in reference to the well-known application name whereas others may be referring activity that is not generically associated with well-known service.</p> <p>L7 application filtering works by specifically fingerprinting a flow or set of flows based on its specific fingerprint, such as destination URL or authentication certificates. Some of those flows will be specifically addressed to the parent applications servers (such as Facebook.com) but other flows in the same exchange, relate to exchanges with other non-application specific service providers or content delivery networks (such as akamai.com). Each flow is identified on its own and the DPI is unable to correlate whether they're associated with the same presentation layer (user experience). Furthermore, these associations can vary for such considerations such as access geography or other business partnerships between application and content providers.</p>	<p>wns0017055 - Info</p>

<p>As such, when defining and applying Layer 7 (L7) application or DNS based policy to allow or constrain specific applications (such as Facebook), in order to complete the user experience, user must be aware of the corresponding additional relationships that may need to be referenced by the that policy definition. For example, a definition to allow a typical Facebook experience, the user must craft policy that includes not only the traffic to the main site, but also the peripheral traffic for base content providers. For a North America's web login experience, the typical policy needs to allow:</p> <ul style="list-style-type: none"> • *.fbcdn.net (e.g. static.xx.fbcdn.net,scontent.xx.fbcdn.net,scontent.fsnc1-2.fna.fbcdn.net, ...) • *.facebook.com (www.facebook.com, m.facebook.com, staticxx.facebook.com) • cs.atdmt.com • *.doubleclick.net (googleads.g.doubleclick.net) • *.akamaihd.net (maybe obsolete) • *.facebook.net (maybe obsolete) <p>To determine full list on a per-application basis, customers should assess a network trace for their environment.</p>	
<p>In a High Availability scenario when changing simultaneously two WLAN port assignments for two different AP ports, from the AP configuration page the WLAN assignment will not be synchronized for the second pair, resulting in a configuration mismatch. To prevent this situation, the assignment change must be done one WLAN at the time.</p>	<p>wns0017364 - Info</p>
<p>Old versions of FreeRadius are not working with Windows 8 and 10 clients. This is a FreeRadius limitation. To resolve this issue, a new version of FreeRadius is required to be installed. The problem was verified to be resolved with version 3.0.2 of FreeRadius.</p>	<p>wns0016966 - Info</p>
<p>For application filtering, a hostname based FQDN L7 has been identified as follows: If both a signature based L7 filter rule and a hostname based L7 filter rule match, the hostname based L7 filter rule will take precedence. If a hostname based FQDN entry is defined in "Custom Web Applications", even it's not used by any filter rules, it will still take precedence. Therefore, the corresponding regular L7 application will not match. This problem will be addressed in a future release.</p>	<p>wns0017012 - Info</p>
<p>Modern web pages are constructed using tools, scripts, and links from external sites. For example, loading the "extremenetworks.com" page involves loading from extreme networks domain plus 16 other external domains like (googleapis.com, cdn.optimizely.com, code.jquery.com, fonts.gstatic.com, ...).</p> <p>In order to write filters to allow "extremenetworks.com" page to load and block other pages, one must analyzes the web page contents carefully and add L7 filters to allow all other external domains that the page fetches data from, not just the extremenetowrks.com domain.</p>	<p>wns0017055 - Info</p>
<p>For an IPv6 topology, to ensure clients get DNS entry into their interface configuration, under Topology/multicast configuration IPv6multicast a rule must be added; this could be added in the list of well-known multicast groups.</p>	<p>wns0015806 - Info</p>

<p>For the dpi-sensor to classify the flow properly, it is recommended that a filter rule to block QUIC protocol (UDP port 443) is added.</p>	<p>wns0017040 - Info</p>
<p>For AP3912i the wired ports and the AP3916ic's CAM function are represented as radios. Service assignment is modeled on WLAN service assignment. Client reporting is unified in the same tabular format. Wired clients are differentiated in the client report by Radio=Port# and protocol=802.3</p>	<p>wns0016770 - Info</p>
<p>If Clients on the wired port are deployed on the IPv6 network, all client on the wired ports should be assigned Roles that have same VLAN (default PVID or Contain VLAN).</p>	<p>wns0016501 - Info</p>
<p>It is MANDATORY that before performing the upgrade to release 10.11.xx and 10.21.xx the setting for the "SCSI controller" for a VMware virtual controller (V2110) is set to "Paravirtual". (Note that the default value is "BusLogic Parallel".)</p> <p>See also the KB: https://gtacknowledge.extremenetworks.com/articles/Solution/V2110-large-upgrade-to-v10</p>	<p>wns0015953 – Info wns0016244 – Info</p>
<p>The following cipher-suites have been obsoleted in release 10.01 as compared with the 9.21 release:DES-CBC3-MD5RC2-CBC-MD5DES-CBC-MD5EXP-EDH-RSA-DES-CBC-SHAEXP-EDH-DSS-DES-CBC-SHAEXP-DES-CBC-SHAEXP-RC2-CBC-MD5EXP-RC4-MD5</p> <p>If any of the above cipher-suites was being used to configure the "message-bus-ciphers" under the CLI "secureconnection" context in a 9.21 EWC release, then after upgrading the EWC to the 10.01 release, then the "message-bus-ciphers" is automatically set to "none" which maps to the default "RC4-MD5" cipher-suite setting.</p>	<p>wns0013172 - Info</p>
<p>The client of the Intel AC7260 wireless chipset with the latest drivers 18.32.x or 18.33.x may become un-responsive when client roams outside of Wi-Fi Coverage area and comes back. The Symptom is a Yellow Exclamation mark within the Wi-Fi icon in the task bar. The current work around is to manually refresh the Wi-Fi connection or troubleshoot the Wi-Fi connection.</p> <p>This issue is fixed in Intel drivers 18.33.3.1 or 18.33.3.2 and above.</p>	<p>Info</p>
<p>Rule Based Redirection (RBR) provides users better visibility and control on how and when Captive Portal redirection works. Administrators can now explicitly define where in the Role the redirection will take place. However, if opting to use this function, be aware that the rule order for the REDIRECT action is critical to the proper functionality. The REDIRECT action rules for ports 80, 8080, and 443 must be added below the rules that define allowed access to the intended External Captive Portal server and any other allowed (Walled Garden) destinations. The rule must also be positioned above the 'Deny All' Default action.</p>	<p>wns0014608 - Info</p>
<p>The Deep Packet Inspection mechanism employed for Layer 7/Application rule enforcement requires several frames of a flow in order to make a decisive fingerprint. This operation is therefore incompatible with Rule Based Redirection, because redirection triggers directly off the first frame (SYN) in the flow. Layer 7/Application rules cannot be combined in the same role with redirection operations, whether implicit redirection (traditional redirection triggered from DENY traffic) or explicit REDIRECT rule action. When defining a role to be used in support of HTTP/HTTPS redirection, the role can only contain Layer 2-4 rule sets.</p>	<p>wns0014726 - Info</p>

When configured to 100% Airtime, the Flexible Client Access (Airtime Fairness) feature is limited to 50 simultaneously transmitting clients per radio on AP3900 series models.	wns0015037 - Info
ExtremeWireless Virtual Appliance V2110 MS Hyper-V Performance is affected when Hyper-V controller ports are mapped to virtual ports of their server. We recommend mapping controller ports to physical ports. Clustering Hyper-V is not supported and should not be configured.	Info
When upgrading from V9.21 (or earlier) to V10.01.02, SNMP tools (such as NetSight MIB Tools) will need to rediscover the controller with an updated Engine ID (even if using the same SNMP user & credentials). This is because the prefix used in the Engine ID has been changed from Siemens to Extreme Networks.	wns0013973 – Info
A limitation was found for clients that will not connect in ac-strict radio mode. The list includes Nexus 9, Galaxy S4, iPad Air, Intel7260.	wns0013397– Info
Due to changes to the SNMP agent in V10.01.02, “counter64” type OIDs are no longer supported. To support this type OID, use SNMP V2c or V3.	wns0013536– Info
Some versions of Apple Mac Books might exhibit low throughput performance when Management Frame Protection (PMF) is enabled.	wns0012889– Info
In order to capture NULL and QOS_NULL packets with WireShark, do not set a Capture Filter, and disable "Do not capture own RPCAP traffic" under Remote Settings. In WireShark v1.12.3, select Capture --> Option --> Double Click Interface Row --> Remote Settings.	wns0012862– Info
The Access Point Name field can be up to 23 characters and must start with alpha characters, not numeric.	wns0012722 – Info
When enabling Sites Mode, the Controller’s topology capacity is capped at 128 topologies. Currently, APs are unable to process more than 128 topologies. In site configuration, all topologies get pushed to all APs, which effectively limits the maximum per-controller topologies to 128.	wns0012793 – Info
Countermeasures for honeypot AP threat may be less effective for the iPhone (with version 8.3) client device than other device types.	wns0012678 – Info
We recommend that you do not enable 802.11k along with the Quiet IE option for installations with Ascom i62 phones.	wns0012567– Info
Rogue AP Detection applies only ‘Open” hotspots. Countermeasures can be enforced against other link-protected hotspots if designated as a threat.	wns0012296– Info
Instability issues observed on the network with Intel AC-7260 based clients. Workaround: Update the Intel AC-7260 driver and disable the Throughput Boost setting in the client driver Advanced options. This issue is not present if the client driver is running 18.20.0.9 or above.	wns0011519 – Info
AP38XX supports TKIP with the following restrictions due to new Wi-Fi Alliance certification requirements: Only available for Legacy rates; not supported with 11n nor 11ac rates Mix configuration of AES and TKIP on one radio is not supported; for example, configuring multiple VNS with mixed types of TKIP and AES on one AP radio is not allowed.	wns0011589 – Info

RADIUS attribute-value pair limits the location data size to 251 characters. When the location data size is more than 251 characters, the data is sent to the RADIUS server truncated to 251 characters.	wns0011467– Info
The Location Batch Report file contains two timestamp attributes that are currently in local time. However, the time zone indicator is missing. These fields should be reported as UTC time with the time zone is set to 'Z'.	wns0011008– Info
The Chrome auto-complete function fills in fields incorrectly. Disable password saving and password field auto completion in a Chrome configuration.	wns0010642– Info
APs advertising the SSIDs of administratively disabled WLAN Services are not detected as internal honeypots until the WLAN Service is enabled.	wns0008740 – Info
For "g/n" mode operation of the AP with wireless clients based on Intel 6300N chipset with driver 15.x/14.3.x, we recommended disabling the "11g protection" setting. Set AP/Radio2/Advanced --> 11g Settings / Protection mode --> None.	wns0008979 - Info
When the AP is used in a WDS or Mesh service, the AP name must be under 32 characters.	wns0008035 - Info
On C5210, status on interface without physical transceivers plugged reported Up and Down.	wns0008023 - Info
AP filter stats for unicast packets is 0	wns0018782 Fixed in 10.51.04.0009
<p>Topology groups – Info</p> <p>Topology groups are not supported for Site deployments. Configuration of Services referencing Topology Groups should result in a “incompatible’ policy resolution at the site, but this may not always be the case, and could result in an incorrect topology assignment. We recommend that you do not configure Topology groups if Site deployments are in use.</p>	
<p>Info</p> <p>MacBook Air running SW prior to 10.8.4 can experience random disconnections (mostly noticeable during video streaming). The issue is caused by a bug in the Apple Wi-Fi driver. It is corrected in SW 10.8.4.</p>	
<p>Info</p> <p>The client of the Intel AC7260 wireless chipset with the latest drivers 18.32.x or 18.33.x may become un-responsive when client roams outside of Wi-Fi Coverage area and comes back. The Symptom is a Yellow Exclamation mark within the Wi-Fi icon in the task bar. The current work around is to manually refresh the Wi-Fi connection or troubleshoot the Wi-Fi connection.</p> <p>This issue is fixed in Intel drivers 18.33.3.1 or 18.33.3.2 and above (latest driver is 18.33.6.2)</p>	

How to use Real Capture Tool

- Click Start to start real capture server on the AP. This feature can be enabled for each AP individually. Default capture server timeout is set to 300 seconds and the maximum configurable timeout is 1 hour. While the capture session is active the AP interface operates in promiscuous mode.
- From Wireshark GUI set the capture interface to the selected AP's IP address and select null authentication. Once Wireshark connects to the AP, the AP's interfaces will be listed as available to capture traffic. eth0 is the wired interface, wlan0 is the 5Ghz interface, and wlan1 is the 2.4Ghz interface.
- You have the option to capture bidirectional traffic on eth0, wifi0, and wifi1. The capture on wifi0 and wifi1 will not include internally generated hardware packets by the capturing AP. The capturing AP does not report its own Beacons, Retransmission, Ack, and 11n Block Ack. If this information is needed, then perform the real capture from a close-by second AP. Change the second AP's wireless channel to match the AP that is being troubleshooted. Let the second AP broadcast an SSID to activate the radios, but do not broadcast the same SSID you are troubleshooting, so that you can prevent the clients from connecting to your second capturing AP.

Note: For AP3935/AP3965 some frames generated by the AP's radio, such as Beacons, ACK, RTS/CTS are not captured.

SUPPORTED WEB BROWSERS

For EWC management GUI, the following Web browsers were tested for interoperability:

- MS IE 8.0, IE9, IE10, IE11, Edge
- Firefox 38.0
- Google Chrome 43.0

The Wireless Clients (Captive Portal, AAA):

Browsers	Version	OS
Chrome	46.0.2490.71 dev-m	Windows server 2012
Chrome	47.0.2526.80 m	Windows 7
Chrome	38.0.2125.111m	Windows server 2012
Firefox	41.0.1	Windows server 2012
Firefox	38.0.5	Windows XP
IE 11	11.0.9600.18059	Windows 7
IE 9	9.0.8112.16421	Windows 7
Opera beta	34.0.2036.24	Windows 7
Safari	preinstalled with iOS9.1	iOS9.1

PORT LIST

The following list of ports may need to remain open so that the controllers/APs will function properly on a network that includes protection equipment like a firewall.

ExtremeWireless TCP/UDP Port Assignment Reference

Note

- 1) Required when AP to Controller communication is over unsecured WASSP tunnel

- 2) Always required (used by IKEv2 during AP registration, regardless of WASSP being secured or not)
- 3) Required only for Version 10.11 or older. Version 10.21 or newer use IKEv2 over 4500 for AP registration
- 4) Required only for Version 10.31 or older. Version 10.41 does image upgrade using HTTP over WASSP (secure and unsecured)
- 5) Required only for Version 10.31 or older. Controller Version 10.41 does trace collection using scp over WASSP (secure and unsecured)
- 6) Required for Version 10.31 or older. Controller Version 10.41 does AP remote login using ssh over WASSP (secure and unsecured).

Comp. Source	Comp. Dest	Protocol (TCP/UDP)	Src Port	Dest Port	Service	Remark	Open Firewall Req'd
Ports for AP/Controller Communication							
Controller	Access Point	UDP	Any	13910	WASSP	Management and Data Tunnel between AP and Controller	Yes(1)
Access Point	Controller	UDP	Any	13910	WASSP	Management and Data Tunnel between AP and Controller	Yes(1)
Controller	Access Point	UDP	4500	Any	Secured WASSP	Management Tunnel between AP and Controller	Yes(2)
Access Point	Controller	UDP	Any	4500	Secured WASSP	Management Tunnel between AP and Controller	Yes(2)
Access Point	Controller	UDP	Any	13907	WASSP	AP Registration to Controller	Optional (3)
Access Point	Controller	UDP	Any	67	DHCP Server	If Controller is DHCP Server for AP	Optional
Access Point	Controller	UDP	Any	427	SLP	AP Registration to Controller	Optional
Controller	Access Point	TCP/UDP	Any	69	TFTP	AP image transfer	Yes(4)
Access Point	Controller	TCP/UDP	Any	69	TFTP	AP image transfer	Yes(4)
Controller	Access Point	TCP/UDP	Any	22	SCP	AP traces	Yes(5)
Any	Access Point	TCP	Any	2002, 2003	RCAPD	AP Real Capture (if enabled)	Optional
Any	Access Point	TCP/UDP	Any	22	SSH	Remote AP login (if enabled)	Optional (6)

Ports for Controller Management

Any	Controller	TCP/UDP	Any	22	SSH	Controller CLI access	Yes
Any	Controller	TCP/UDP	Any	5825	HTTPS	Controller GUI access	Yes
Any	Controller	TCP/UDP	Any	161	SNMP	Controller SNMP access	Yes
Any	Controller	TCP/UDP	Any	162	SNMP Trap	Controller SNMP access	Yes
Controller	Any	TCP/UDP	Any	162	SNMP Trap	Controller SNMP access	Yes

Ports for Inter Controller Mobility and Availability

Controller	Controller	UDP	Any	13911	WASSP	Mobility and Availability Tunnel	Yes
Controller	Controller	TCP	Any	427	SLP	SLP Directory	Yes
Controller	Controller	TCP	Any	20506	Langley	Remote Langley Secure	Yes
Controller	Controller	TCP	Any	60606	Mobility	VN MGR	Yes
Controller	Controller	TCP	Any	123	NTP	Availability time sync	Yes
Controller	DHCP Server	UDP	Any	67	SLP	Asking DHCP Server for SLP DA	Yes
DHCP Server	Controller	UDP	Any	68	SLP	Response from DHCP Server for SLP DA request	Yes

Core Back-End Communication

Controller	DNS Server	UDP	Any	53	DNS	If using DNS	Optional
Controller	Syslog Server	UDP	Any	514	Syslog	If Controller logs to external syslog server	Optional
Controller	RADIUS Server	UDP	Any	1812	RADIUS Authentication and Authorization	If using RADIUS AAA	Optional
Controller	RADIUS Server	UDP	Any	1813	RADIUS Accounting	If enabled RADIUS accounting	Optional
Dynamic Authorization Client (typically NAC)	Controller	UDP	Any	3799	Dynamic Authorization Server (DAS)	Request from Dynamic Authorization Client to disconnect a specific client	Optional
Controller	AeroScout Server	UDP	1144	12092	Location-Based	Stanley Healthcare/ AeroScout Location-Based Service	Optional

					Service Proxy (lbs)		
AeroScout Server	Controller	UDP	12092	1144	Location-Based Service Proxy (lbs)	AeroScout Location-Based Service	Optional

IETF STANDARDS MIB SUPPORT:

RFC No.	Title	Groups Supported
Draft version of 802.11	IEEE802dot11-MIB	
1213	RFC1213-MIB	Most of the objects supported
1573	IF-MIB	ifTable and interface scalar supported
1907	SNMPv2-MIB	System scalars supported
1493	BRIDGE-MIB	EWC supports relevant subset of the MIB
2674	P-BRIDGE-MIB	EWC supports relevant subset of the MIB
2674	Q-BRIDGE-MIB	EWC supports relevant subset of the MIB

EXTREME NETWORKS PRIVATE ENTERPRISE MIB SUPPORT

Extreme Networks Private Enterprise MIBs are available in ASN.1 format from the Extreme Networks website at: <https://extremeportal.force.com/> . Indexed MIB documentation is also available.

Proprietary MIBs

Title	Description
enterasys-configuration-management-mib.txt	Used to perform configuration backup and restore
ENTERASYS-CLASS-OF-SERVICE-MIB	Used for configuration/monitoring CoS and rate control
ENTERASYS-POLICY-PROFILE-MIB	Used for configuration/monitoring policy and rules assignments
ENTERASYS-RADIUS-AUTH-CLIENT-MIB	Used for configuration of RADIUS Authentication servers
ENTERASYS-RADIUS-ACCT-CLIENT-EXT-MIB	Used for configuration of RADIUS Accounting servers
ENTERASYS-IEEE8023-LAG-MIB-EXT-MIB	Used for configuration/monitoring LAG port

Standard MIBs

Title	Description
IEEE802dot11-MIB	Standard MIB for wireless devices
RFC1213-MIB.my	Standard MIB for system information
IF-MIB	Interface MIB
SNMPv2-MIB	Standard MIB for system information
BRIDGE-MIB	VLAN configuration information that pertains to EWC
P-BRIDGE-MIB	VLAN configuration information that pertains to EWC
Q-BRIDGE-MIB	VLAN configuration information that pertains to EWC
IEEE8023-LAG-MIB	LAG configuration information. Set is permitted for LAG L2 port configuration only.

Siemens Proprietary MIB

Title	Description
HIPATH-WIRELESS-HWC-MIB.my	Configuration and statistics related to EWC and associated objects
HIPATH-WIRELESS-PRODUCTS-MIB.my	Defines product classes
HIPATH-WIRELESS-DOT11-EXTNS-MIB.my	Extension to IEEE802dot11-MIB that complements standard MIB
HIPATH-WIRELESS-SMI.my	Root for Chantry/Siemens MIB

802.11AC AND 802.11N CLIENTS

The following 802.11ac and 802.11n clients are known to work with V10.41 software release:

Windows 10

Device	Model	Driver	Radio
Intel	AC-7260	18.33.6.2	a/b/g/n/ac
Microsoft Lumia	950 xl dual sim	10.0.10586.11	a/b/g/n/ac
Microsoft Lumia	830	10.0.15063.251	a/b/g/n/ac

List of New Mobile Devices Tested

Model	OS	Driver Version	OP EN	WE P	WP A/P SK	WPA 2/PS K	OKC	11r	11k	11ac strict	MU-MIMO	PMF
iPhone 8	iOS 11.0.1		Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	No	Yes
Samsung Galaxy S8 Edge			Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes
Macbook Pro	macOS Sierra(10.12.6)		Yes	Yes	Yes	Yes	n/a	n/a	Not Supported	Yes	No	Yes
Microsoft Surface Book	Windows 10	15.68.9046.79	Yes	Yes	Yes	Yes	Yes	n/a	n/a	Yes	No	Yes
Microsoft Surface Pro	Windows 10	15.68.9114.29	Yes	Yes	Yes	Yes	Yes	Yes	n/a	Yes	No	Yes

11ac MU-MIMO

Device	Model	Driver	1x Support	Radio	11ac Strict	MU-MIMO
Google Nexus	Nexus 5x	Android 6.0	Yes	abgn+ac	Yes	2x2 MU-MIMO
Microsoft Lumia	Lumia 950	Windows 10 Mobile	Yes	abgn+ac	No	2x2 MU-MIMO
Microsoft Lumia	Lumia 950XL	Windows 10 Mobile	Yes	abgn+ac	No	2x2 MU-MIMO
Dell Alienware	Dell Alienware with Killer Wireless- 1535	Windows 10	Yes	abgn+ac	No	2x2 MU-MIMO
Linksys	USB AC600		Yes	abgn+ac	No	1x1 MU-MIMO
Acer PC	Acer Aspire E5 with Qualcomm Atheros QCA9377	Windows 10	Yes	abgn+ac	No	1x1 MU-MIMO
Acer PC	Acer Aspire E15 with Qualcomm Atheros QCA9377	Windows 10	Yes	abgn+ac	No	1x1 MU-MIMO

Due to limited availability of the real clients, most of the feature testing was done with IxVeriWave tool.

Device	Model	OS	1x Support	Radio	11ac Strict	MU-MIMO
Google Nexus	Nexus 5x	Android 6.0	yes	a/b/g/n/ac	yes	2x2 Mu-MIMO

The following clients passed the 11ac strict mode test.

Client	Driver Version	Test Case	Build	Result
AC 1200 D-Link	1027.4.630.2015	11ac Strict mode		Pass
Broadcom 802.11 ac	6.30.223.102	11ac Strict mode		Pass
AirPort Extreme (0x14E4, 0x117)	Broadcom BCM43xx 1.0 (6.30.223.74.22)	11ac Strict mode		Pass
Cisco AE6000	AE6000_v5.0.7.0_Driver_Win7	11ac Strict mode		Pass
iPhone 6 - iOS 9.1	Modem firmware 2.23.03	11ac Strict mode		Pass
ASUS PCE-68ac	6.30.223.75	11ac Strict mode		Pass
MacBook Air	Broadcom BCM43xx 1.0 (6.30.223.154.65)	11ac Strict mode		Pass
iPhone 6 - iOS 9.1	Modem firmware 4.32.00	11ac Strict mode		Pass
Nexus 5X	Kernel Version 3.10.73-g60cf314	11ac Strict mode		Pass

Other 11ac and 11n devices:

Device	Model	OS	Radio
Apple	A1396	iPad OS	11abgn
Apple	iPad	IOS 7.1.2	
Apple	iPad (4th generation)	iOS9.1	a/b/g/n
Apple	iPad 3	iOS 8.4.1	a/b/g/n
Apple	iPad Air 2	IOS9.1	a/b/g/n
Apple	iPad Mini	iOS 8.4.1	
Apple	iPhone 5	iOS 9.1	a/b/g/n/
Apple	iPhone 5	iOS	11abgn
Apple	iPhone 5 S	IOS 6.1.4	a/b/g/n
Apple	iPhone 6	iOS 9.1	a/b/g/n/ac
Apple	iPhone 6 GSM	iOS8.4.1	a/b/g/n/ac
Ascom	902202		

Asus	2 in 1	Windows 8.1	abgn
Blackberry	Bold 9000 Smartphone	Blackberry OS 4.6.0.282	
Chromebook	503C32-K01	Chrome OS	11abgn
Chromebook	Asus C200	Chrome 46.0.2490.82	abgn
Galaxy S4	Galaxy S4	Android	
Google Nexus	Nexus 5x	Android 6.0	a/b/g/n/ac
Laptop PC	Intel AC-7260	Win10 (all builds)	11 abgnac
Nexus 9	Nexus 9	Android	a/b/g/n/ac
Nokia Lumia 830		Win8.1 Win 10	802.11abgnac
Polycom Spectralink	8440		
Samsung	Galaxy Note4	Android v5.0.1	a/b/g/n/ac
Surface 3 Pro		Win 10 (all builds)	Marvel Avastar 802.11 ac
Surface 4 Pro		Win 10	Marvel Avastar 802.11 ac

RADIUS SERVERS AND SUPPLICANTS

RADIUS Servers used during testing

Vendor	Model OS	Version
FreeRADIUS45	1.1.6	FreeRADIUS
FreeRADIUS21 IAS	1.0.1	FreeRADIUS
	5.2.3790.3959	Microsoft Server 2003 IAS
SBR50	6.1.6	SBR Enterprise edition
NPS	6.0.6002.18005	Microsoft Server 2008 NPS

802.1x Supplicants Supported

Vendor	Model OS	Version
Juniper Networks® / Funk	Odyssey client	Version 5.10.14353.0
		Version 5.00.12709.0
		Version 4.60.49335.0

Vendor	Model OS	Version
Microsoft®	Wireless Zero Configuration	Version Windows XP-4K-891859-Beta1
	Wireless Network Connection Configuration	Version Microsoft Window Server 2003, Enterprise Edition R2 SP2
	Wi-Fi Protected Access 2 (WPA2)/Wireless Provisioning Services Information Element (WPS IE) update for Windows XP with Service Pack 2	Version WindowsXP-KB893357-v2-x86-ENU.exe
Intel®	Intel PRO Set/Wireless	Version 13.0.0.x (with Windows® Intel® driver version 13.0.0.x)
Microsoft® Wireless Zero	Windows 7, 8, 8.1 Pro, 10 Pro Windows Phone 8.1, Windows Mobile 10	provided with Windows®

LAN SWITCHES

Vendor	Model OS	Version	Tested with
Avaya	VSP-4850GTS-PWR	(6.0.1.1_B003) (PRIVATE) HW Base: ERS 4850	Fabric Attach
Avaya	VSP-4850GTS-PWR	((6.1.0.0_B030) (PRIVATE) HW Base: VSP 4850	Fabric Attach
Avaya	Ethernet Routing Switch 3626GTS	+ HW:01 FW:6.0.0.3 SW:v6.0.0.007 BN:07	Fabric Attach
Cisco	Catalyst 3550	12.1(19) EA1c	AP 802.1x
Extreme	G3	01.00.02.0001	For PoE
	G3	06.11.01.0040	
	C20N1	Version 12.1(19) EA1c	No PoE
	B3G124-48P	06.61.03.0004	for AP 802.1x, PoE
	B3	01.02.01.0004	10480068225P
	C5	06.42.06.0008	11511205225K
	B3G124-48P	06.61.03.0004	for AP 802.1x, POE
	X460-24P	12.5.4.5	for AP 802.1x, POE
	B3	06.61.08.0013	Lab switch - sn 10480062225P

	B3	06.61.08.0013	Veriwave switch - sn 10480075225P
	X-460-G2		802.3at interoperability with AP3935
Extreme	Summit 300-24	7.6e.4.4	
	Summit 300-24	System Serial Number: 800138-00-03 0443G-01236 CP: 04	for AP 802.1x, POE
	Summit 300-48	7.6e1.4	AP 802.1x, PoE
	Summit 300-48	7.6e1.4	
	Summit 300	Software Version 7.4e.2.6	Lab switch
H3C	H3C S5600 26C	Bootrom Version is 405	for PoE
HP	ProCurve 4104GL	#G.07.22	Lab switch

CERTIFICATION AUTHORITY

Server Vendor	Model OS	Version
Microsoft CA	Windows Server 2003 Enterprise Edition	5.2.3790.1830
Microsoft CA	Windows Server 2008 Enterprise Edition	6.0
OpenSSL	Linux	0.9.8e

RADIUS ATTRIBUTES SUPPORT

RADIUS Authentication and Authorization Attributes

Attribute	RFC Source
Called-Station-Id	RFC 2865, RFC 3580
Calling-Station-Id	RFC 2865, RFC 3580
Class	RFC 2865
EAP-Message	RFC 3579
Event-Timestamp	RFC 2869
Filter-Id	RFC 2865, RFC 3580
Framed-IPv6-Pool	RFC 3162
Framed-MTU	RFC 2865, RFC 3580
Framed-Pool	RFC 2869
Idle-Timeout	RFC 2865, RFC 3580

Attribute	RFC Source
Message-Authenticator	RFC 3579
NAS-Identifier	RFC 2865, RFC 3580
NAS-IP-Address	RFC 2865, RFC 3580
NAS-IPv6-Address	RFC 3162
NAS-Port	RFC 2865, RFC 3580
NAS-Port-Id	RFC 2865, RFC 3580
NAS-Port-Type	RFC 2865, RFC 3580
Password-Retry	RFC 2869
Service-Type	RFC 2865, RFC 3580
Session-Timeout	RFC 2865
State	RFC 2865
Termination-Action	RFC 2865, RFC 3580
Tunnel Attributes	RFC 2867, RFC 2868, RFC 3580
User-Name	RFC 2865, RFC 3580
Vendor-Specific	RFC 2865

RADIUS Accounting Attributes

Attribute	RFC Source
Acct-Authentic	RFC 2866
Acct-Delay-Time	RFC 2866
Acct-Input-Octets	RFC 2866
Acct-Input-Packets	RFC 2866
Acct-Interim-Interval	RFC 2869
Acct-Output-Octets	RFC 2866
Acct-Output-Packets	RFC 2866
Acct-Session-Id	RFC 2866
Acct-Session-Time	RFC 2866
Acct-Status-Type	RFC 2866
Acct-Terminate-Cause	RFC 2866

GLOBAL SUPPORT:

By Phone: +1 800-998-2408 (toll-free in U.S. and Canada)

For the toll-free support number in your country:
<https://extremeportal.force.com/>

By Email: support@extremenetworks.com

By Web: <https://extremeportal.force.com/>

For information regarding the latest software available, recent release note revisions, or if you require additional assistance, please visit the Extreme Networks Support website.

Extreme Networks and the Extreme Networks logo are trademarks or registered trademarks of Extreme Networks, Inc. in the United States and/or other countries. All other names (including any product names) mentioned in this document are the property of their respective owners and may be trademarks or registered trademarks of their respective companies/owners. Extreme Networks IPS includes software whose copyright is licensed from MySQL AB.

For additional information on Extreme Networks trademarks, please see: www.extremenetworks.com/company/legal/trademarks/