Extreme networks

ExtremeCloud IQ (New) v25.14.0-331 Component update 25.14.1-3

Release Notes

New Features, Limitations, and Known Issues

9041241-02 Rev AA
October 2026

Copyright © 2026 Extreme Networks, Inc. All rights reserved.

Legal Notice

Extreme Networks, Inc. reserves the right to make changes in specifications and other information contained in this document and its website without prior notice. The reader should in all cases consult representatives of Extreme Networks to determine whether any such changes have been made.

The hardware, firmware, software or any specifications described or referred to in this document are subject to change without notice.

Trademarks

Extreme Networks and the Extreme Networks logo are trademarks or registered trademarks of Extreme Networks, Inc. in the United States and/or other countries.

All other names (including any product names) mentioned in this document are the property of their respective owners and may be trademarks or registered trademarks of their respective companies/owners.

For additional information on Extreme Networks trademarks, see: https://www.extremenetworks.com/about-extreme-networks/company/legal/trademarks

Open Source Declarations

Some software files have been licensed under certain open source or third-party licenses. End-user license agreements and open source declarations can be found at: https://www.extremenetworks.com/support/policies/open-source-declaration/

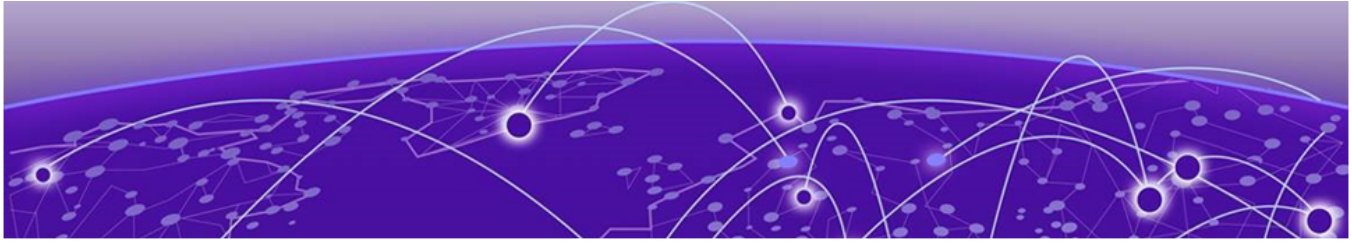


Table of Contents


Abstract iv
Help and Support v
Subscribe to Product Announcements v

General Release Information 7
Current Release: 25.14.0-331 Component update 25.14.1-3 7
Release: 25.14.0-331 (Patch 1) 7
Release: 25.14.0-331 (Patch 1) Addressed Issues 7
Release: 25.14.0-331 7
ExtremeCloud IQ (New) Public IP Address Blocks 8
Supported IQ Engine Software 9
Browser Support and Display Settings 9
Desktop Browsers 9
Display Settings 9

Previous Release 10
New Features 10
Addressed Issues 12


Known Issues 17

Device Support Information 22
Universal Compute Platform 22
Access Points 22
Universal Hardware 23
IQ Engine (Cloud Native) 24
Switches 24
Universal Hardware 25
ExtremeXOS 44
VOSS 48
ExtremeCloud IQ Site Engine 49

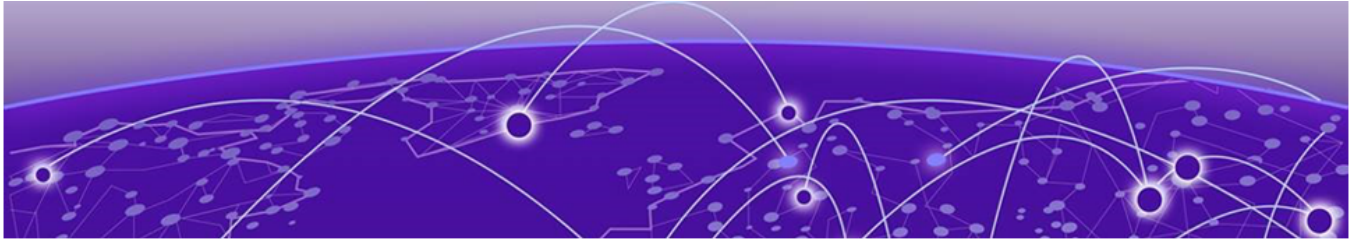

Abstract

This release notes document for ExtremeCloud IQ (New) v25.14.0-331 Component update 25.14.1-3 (October 2026) provides technical guidance on platform enhancements, supported software and hardware, resolved defects, known issues, and deployment requirements for cloud-managed wired and wireless network environments. This release resolved an issue causing sporadic latency and slow page-rendering when navigating the Dashboard, Devices, Clients, and Sites views. The notes summarize fixes addressing onboarding failures, CAPWAP connectivity, client visibility, NAC integration, certificate management, VLAN and SSID configuration, firmware upgrade workflows, API deployment health, dashboard accuracy, and Device360 reporting. Known issues include client-history visibility limitations, SSO session persistence concerns, telemetry and dashboard discrepancies, firmware upgrade exceptions, configuration audit constraints, visualization inaccuracies, and scaling limitations in large deployments. The document specifies browser requirements, supported operating systems including IQ Engine 10.9.2, Switch Engine 33.6, and Fabric Engine/VOSS 9.4.1, compatibility matrices for access points, switches, and Site Engine integrations, and operational considerations for troubleshooting, interoperability, firmware management, and enterprise-scale network administration.

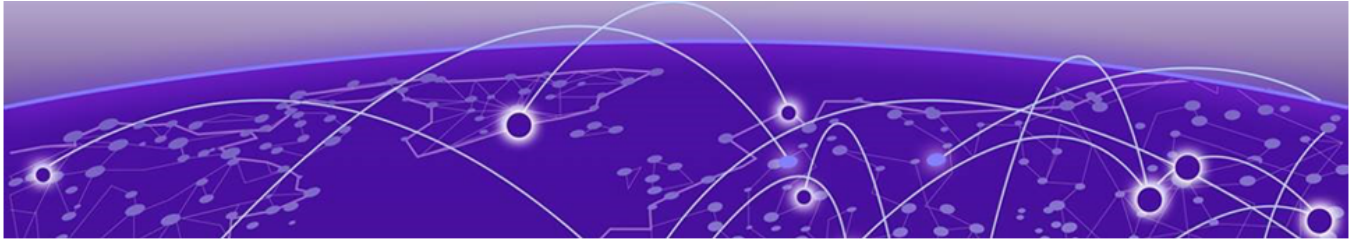

Help and Support

If you require assistance, contact Extreme Networks using one of the following methods:

Extreme Portal

Search the GTAC (Global Technical Assistance Center) knowledge base; manage support cases and service contracts; download software; and obtain product licensing, training, and certifications.

The Hub

A forum for Extreme Networks customers to connect with one another, answer questions, and share ideas and feedback. This community is monitored by Extreme Networks employees, but is not intended to replace specific guidance from GTAC.

Call GTAC

For immediate support: (800) 998 2408 (toll-free in U.S. and Canada) or 1 (408) 579 2800. For the support phone number in your country, visit www.extremenetworks.com/support/contact.

Before contacting Extreme Networks for technical support, have the following information ready:

- Your Extreme Networks service contract number, or serial numbers for all involved Extreme Networks products
- A description of the failure
- A description of any actions already taken to resolve the problem
- A description of your network environment (such as layout, cable type, other relevant environmental information)
- Network load at the time of trouble (if known)
- The device history (for example, if you have returned the device before, or if this is a recurring problem)
- Any related RMA (Return Material Authorization) numbers


Subscribe to Product Announcements

You can subscribe to email notifications for product and software release announcements, Field Notices, and Vulnerability Notices.

1. Go to The Hub.
2. In the list of categories, expand the **Product Announcements** list.
3. Select a product for which you would like to receive notifications.

4. Select **Subscribe**.
5. To select additional products, return to the **Product Announcements** list and repeat steps 3 and 4.

You can modify your product selections or unsubscribe at any time.

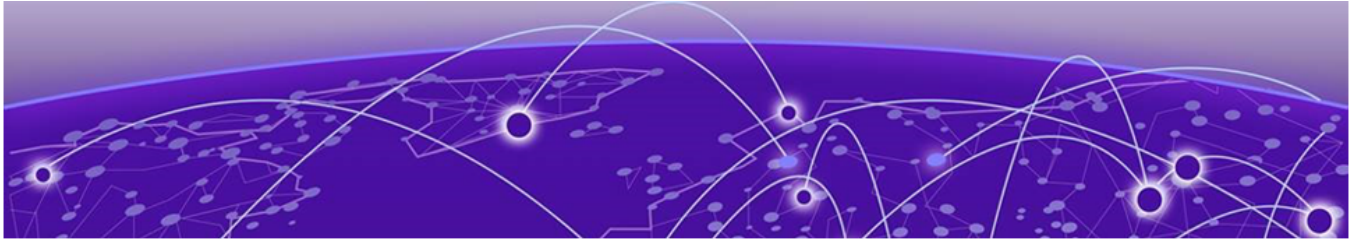

General Release Information

Browser Support and Display Settings on page 9

Current Release: 25.14.0-331 Component update 25.14.1-3

October 2026

This release resolved an issue causing sporadic latency and slow page-rendering when navigating the **Dashboard**, **Devices**, **Clients**, and **Sites** views.

Related Links

- Known Issues on page 17
- Device Support Information on page 22

Release: 25.14.0-331 (Patch 1)

October 2026

This patch release addresses database performance issues, improves login service stability and capacity, and includes updated OpenAPI documentation.

Related Links

- Known Issues on page 17
- Device Support Information on page 22

Release: 25.14.0-331 (Patch 1) Addressed Issues

Issue ID	Description
XCP-29053	Updated the Asset Management OpenAPI specification and Developer Portal documentation for the POST /devices endpoint to include previously undocumented response fields: `delete_allowed` and `xiq_se_server_id`. The schema and documentation now fully reflect the active API response models for cloud-managed and ExtremeCloud IQ Site Engine-managed devices.

Release: 25.14.0-331

September 2026

Related Links

- Known Issues on page 17
- Device Support Information on page 22

ExtremeCloud IQ (New) Public IP Address Blocks

Data Center	IP Block	Addresses and Ports
Global Data Center (GDC)	44.234.22.92/30 18.194.95.0/28 34.253.190.192/26 3.234.248.0/27	
Australia (AUS)	13.210.3.192/28 18.98.198.80/28	Firewall Address and Port Information
Azure, Canada Central (ACA)	20.151.64.48/28	Firewall Address and Port Information
Azure, US East (AVA)	52.226.89.112/28	Firewall Address and Port Information
Brazil (BR)	18.228.70.16/28	Firewall Address and Port Information
Germany (FRA)	3.67.81.96/27 18.194.95.0/28	Firewall Address and Port Information
India (IN)	13.232.67.8/29 3.6.70.64/29	Firewall Address and Port Information
Ireland (IE)	34.253.190.192/26	Firewall Address and Port Information
Japan (JP)	18.176.203.112/29 13.231.6.232/29 57.181.58.0/28	Firewall Address and Port Information
Netherlands (NL-GCP)	34.91.82.64/27	Firewall Address and Port Information
Singapore (SG-GCP)	34.87.158.80/28	Firewall Address and Port Information
Spain (ES)	18.101.49.128/27	Firewall Address and Port Information
Sweden (SE)	13.48.186.224/29 13.48.4.184/29 13.48.4.240/28	Firewall Address and Port Information
Switzerland (ACH)	51.107.1.192/28	Firewall Address and Port Information
United Arab Emirates (UAE)	3.28.159.128/28	Firewall Address and Port Information
United Kingdom (UK-AGB)	51.143.233.80/28	Firewall Address and Port Information
US East (VA)	34.202.197.0/26 44.192.245.0/26 3.234.248.0/27	Firewall Address and Port Information

Data Center	IP Block	Addresses and Ports
US East 2 (VA2)	34.202.197.0/26 44.192.245.0/26 3.234.248.0/27	Firewall Address and Port Information
US-Iowa (IA-GCP)	34.67.130.64/27	Firewall Address and Port Information
US Ohio (OH)	3.145.235.64/26	Firewall Address and Port Information

Supported IQ Engine Software

See the IQ Engine Release Notes for information about IQ Engine version 10.9.2.

Browser Support and Display Settings

Note
ExtremeCloud IQ (New) does not support 32-bit browsers.

Desktop Browsers


ExtremeCloud IQ (New) supports the latest 64-bit versions of the following desktop browsers:

- Chrome
- Edge
- Firefox
- Opera
- Safari

Microsoft Internet Explorer is not supported.

Display Settings

ExtremeCloud IQ (New) supports display resolutions of 1280 x 1024 or higher.

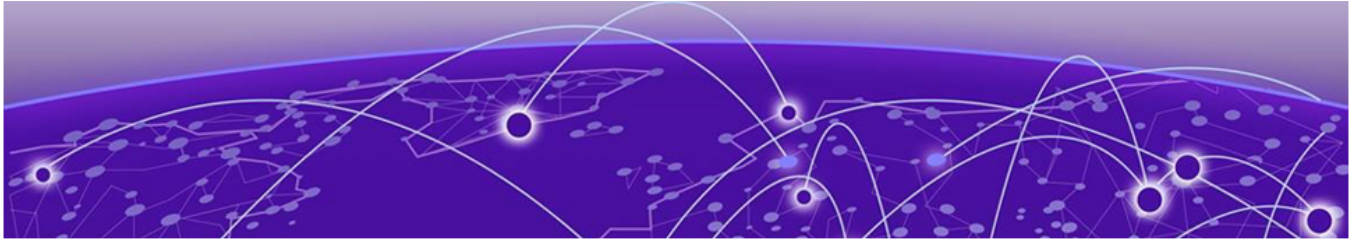

Previous Release

New Features on page 10
Addressed Issues on page 12

This section lists the new features, addressed issues, and known issues for the previous release.

New Features

Table 1 on page 11 lists the new features introduced in ExtremeCloud IQ (New) release 25.14.0-331.

For more information about ExtremeCloud IQ (New) features, see the ExtremeCloud IQ (New) v25.14.0 User Guide.

Device OS Support

This release supports the following device operating systems.

- Switch Engine/EXOS:
  - IQAgent Version
    - Switch Engine/EXOS release < 31.7: upgrade to IQAgent version 0.9.32
    - Switch Engine/EXOS release >= 31.7 < 33.2 upgrade to IQAgent version 0.9.44
    - Switch Engine/EXOS release >= 33.2 upgrade to IQAgent version 1.9.44
  - 33.7.1.6-patch1-11 Latest Supported GA Patch

    Onboard, Monitor, Config, Image Mgmt, and Global Download Support
  - 33.6.1.14 Latest Supported GA Image

    Onboard, Monitor, Config, Image Mgmt, and Global Download Support
  - 32.7.4.15 Previous Supported GA Patch

    Onboard, Monitor, Config, Image Mgmt, and Global Download Support
  - 31.7.4.2-patch1-7 Previous Supported GA Image

    Onboard, Monitor, Config, Image Mgmt, and Global Download Support
- Fabric Engine/VOSS:
  - 0.9.41 IQAgent Support
  - 9.4.1.0 Latest Supported GA Image

    Onboard, Monitor, Config, Image Mgmt, and Global Download Support
  - 9.3.4.0 Previous Supported GA Patch

Onboard, Monitor, Config, Image Mgmt, and Global Download Support

- 8.10.9.0 Previous Supported GA Image

  Onboard, Monitor, Config, Image Mgmt, and Global Download Support

- IQ Engine **Support:**
  - IQ Engine release 10.9.2

New Hardware Support

ExtremeCloud IQ (New) contains no new hardware in this release.

Table 1: New Features in release 25.14.0-331

Feature ID	Feature	Description
NVO-11822	Enhanced Visibility and Support for Partially Connected Devices	Improves detection and reporting of specific error categories for devices that fail to connect to the Network Visualization and Orchestration backend during onboarding.
NVO-16304	Visualization and Navigation Usability Enhancements	Renames **Restore Settings** to **Restore Saved User Settings** in all views, adjusts the **Burst** view when it extends beyond the screen, and scrolls the **Quick Location Navigator** to the selected item when it opens.
WS-4526, XCP-21442	Centralized Task Center for Scheduled and Historical Operations	Adds the **Task Center**, where users view historical and scheduled tasks such as firmware upgrades, configuration backups, and backup restores, along with their status and results.
XCP-10751	Multi-Select and Bulk Deletion for KDDR Logs	Adds multiselect and **Select All** support for deleting Kernel Diagnostic Data Recorder (KDDR) logs in ExtremeCloud IQ.
XCP-18078	Custom Firmware Upload	Firmware upload is now supported in Inventory. ExtremeCloud IQ (New) reads the firmware version, blocks corrupt or unsupported files, and determines device compatibility before performing the upgrade. The upgrade is fully logged in the history and audit logs. Captured data includes who performed the upload and the outcome for each device.
XCP-27334	Fabric Engine/ VOSS Version 9.3.4 Support	Adds support for onboarding, monitoring, configuring, and downloading images for Fabric Engine/VOSS version 9.3.4 on the 7830, 7720, 7520, 5720, 5520, 5420, 5320, and applicable 4220 Universal Switches, and on the VSP7400 and VSP4900.

Addressed Issues

Table 2 lists Addressed Issues in ExtremeCloud IQ (New) release 25.14.0-331.

Table 2: Addressed Issues in release 25.14.0-331

Issue ID	Description
CFDs	
CFD-14649	Addressed the issue where a delta configuration push failed with a rate-limit multicast error for an aggregated interface, and prevented further delta updates on the affected access point.
CFD-17067	Addressed the issue where NAC Profile and NAC Details did not populate for most clients in **Client 360**, even though ExtremeControl reported the corresponding end-system details.
CFD-17082	Addressed the issue where an inactive wireless device showed as a wired device on the connected switch port instead of retaining its last known access point association.
CFD-17244	Addressed the issue where certificate bundles created under **Common Objects** > **Certificate Management** for OpenRoaming were not persisted or validated correctly.
CFD-17501	Addressed the issue where an access point showed as offline in ExtremeCloud IQ while its CAPWAP client status indicated a secure connection to the CAPWAP server.
CFD-17704	Addressed the issue where an AP4020 running IQ Engine 10.8.5.4 intermittently lost its CAPWAP connection.
CFD-17878	Addressed the issue where new AP3000 access points failed to onboard because they did not receive a country code, CAPWAP server IP address, or Hive Manager primary or backup name.
CFD-17996	Addressed the issue where access points showed as online but were unreachable during a bulk configuration push.
CFD-18029	Addressed the issue where an eduroam SSID could not be deleted under Extreme Platform ONE™ Security after the eduroam integration was performed.
CFD-18081	Addressed the issue where acknowledging alerts on a second page failed when the alerts page was set to display 500 alerts.
CFD-18102	Addressed the issue where the **Resource Center** icon did not reopen the **Resource Center** overlay after the overlay was closed.
CFD-18103	Addressed the issue where toggling **Additional Columns** on and off in the **Network Devices** default view reset the customized column order.
CFD-18109	Addressed the issue where IP range classification rules in network policies could not extend beyond a single /24 subnet.
CFD-18110	Addressed the issue where running the Show IKE SA diagnostic under **Utilities** > **Diagnostic** did not complete.
CFD-18123	Addressed the issue where the default last-24-hour time range in the **Users** view did not advance to include the current time.

Table 2: Addressed Issues in release 25.14.0-331 (continued)

Issue ID	Description
CFD-18180	Addressed the issue where uploading a captive web portal (CWP) file under SSIDs returned a file named `TRUE` instead of the uploaded file.
CFD-18186	Addressed the issue where Cloud PPSK users could not authenticate for up to a few hours after creation.
CFD-18214	Addressed the issue where clicking a diagnostic widget in the Object Inspector reloaded the entire web application instead of opening the corresponding detail view, and in some cases required the user to log in again.
CFD-18221	Addressed the issue where setting a port type to Trunk in a device template omitted the VLAN configuration, so all trunk ports used the default VLAN and could not be customized during port type configuration.
CFD-18226	Addressed the issue where clicking the client count in the **Client Health** widget (from a managed access point's Object Inspector) opened the Clients view with an unsupported hostname filter and returned no results.
CFD-18229	Addressed the issue where clients connected to an access point were not displayed under **Monitoring** > **Clients** in ExtremeCloud IQ (New).
CFD-18233	Addressed the issue where exporting the `kat_encryption_audit_log` table failed with an internal error.
CFD-18271	Addressed the issue where saving an open SSID with an ExtremeGuest captive portal and a custom, non-default user profile reverted the profile to the default guest profile (VLAN 1).
CFD-18296	Addressed the issue where the Discovered section of **Network Devices** > **Device Status** entered an endless refresh loop when sorted by any column other than serial number.
CFD-18309	Addressed the issue where a timed-out account deletion prevented a customer from using the associated email address to register a new account.
CFD-18330	Addressed the issue where a duplicate portal account for a customer email address prevented the customer from being added as an administrator.
Account Management	
XCP-24592	Addressed the issue where switching to an account with a Pilot license opened ExtremeCloud IQ (New) instead of ExtremeCloud IQ (Classic) as the default landing page.
XCP-26459	Addressed the issue where a newly added external user did not appear in the External Users list and returned an HTTP 400 error.
XIQ-52932	Addressed an issue where IDM gateway post-authentication logging timeouts caused valid Cloud PPSK authentication requests to fail with an Access-Reject.
API	

Table 2: Addressed Issues in release 25.14.0-331 (continued)

Issue ID	Description
XCP-26361	Addressed the issue where the `cs-metaflow-telemetry-server` and `cs-metaflow-metrics-telemetry-server` deployments remained in a degraded state.
XCP-26979	Addressed the issue where the `cs-event-mvtx-highpriority` and `cs-metric-mvtx-highpriority` applications remained in a degraded health state after deployment.
Device Management	
XCP-23557	Addressed the issue where the **Access Management External Users** page failed to load with a validation error when the page size was set to 500.
XCP-24254	Addressed the issue where the user interface did not show the configuration delta and audit logs for a device in the deployment dialog.
XCP-27441	Addressed the issue where an intermittent "Device Not Found" error displayed when a user selected the **Restore** action.
XIQ-52258	Addressed the issue where an AP5022S6D configured for dual 6 GHz operating mode (6H/5/6L) included channels 97 through 125 in the 6H band for the Peru, Kazakhstan, Dominican Republic, and Brazil country codes.
XIQ-52259	Addressed the issue where the AP3020 applied an incorrect transmit power to the WiFi1 interface for the Italy country code.
XIQ-52263	Addressed the issue where SSID configuration on an AP3020 failed when the security mode was set to WPA with TKIP.
Logs	
XIQ-52219	Addressed the issue where Supplemental CLI commands remained listed in the **Delta Configuration Audit** view after a **Complete Update** successfully applied them.
Onboarding	
XCP-25738	Addressed the issue where onboarding a Switch Engine/EXOS or Fabric Engine/VOSS device with an access point serial number did not display a validation message and the onboarding API returned an HTTP 500 error.
Roles	
XCP-24402	Addressed the issue where an SSH session launched from Visualization for a user with the Observer role, then timed out immediately.
XCP-26977	Addressed the issue where creating an internal or external user with the BizOps or Guest Management role displayed a validation error.
XCP-26998	Addressed the issue where **Task Center** data did not load for users with the NetSecOps or Observer role.
XCP-27090	Addressed the issue where the **Task Center** menu displayed for the Guest Management role.

Table 2: Addressed Issues in release 25.14.0-331 (continued)

Issue ID	Description
XIQ-51101	Addressed the issue where NetSecOps and BizOps external users are unable to delete devices from the **Network Devices** page. The deletion initiation notification appears, but the deletion does not complete.
Upgrading	
XCP-14211	Addressed the issue where the **Firmware Version** dropdown is not visible during a firmware upgrade when multiple APs are selected and the last device in the list is reviewed on high-resolution displays.
XCP-25227	Addressed the issue where the `cs-perfmonitor-ingestion` consumer group developed a lag after the an upgrade.
User Interface	
WS-4770	Addressed the issue where several login page fields, including the forgot-password link, SSO login button, login-via-Extreme-portal link, and registration link, did not load in the mobile view.
WS-4795, WS-4796, WS-4797, WS-4798	Addressed the issues where the **Visualize**, **Dashboard**, **Alerts**, and **Network Device** pages displayed user interface issues in the mobile view.
WS-4799	Addressed the issue where users could not easily navigate back to a page after opening the 9-dot menu or profile icon in the mobile view.
WS-4800	Addressed the issue where forms on the **Profile** page did not use the full available space in the mobile view.
XCP-23080	Addressed the issue when both an LLDP entry and an FDB entry exist on the same switch port, only the LLDP MAC address is displayed as a wired client. The FDB MAC address should also be identified as a wired client.
XCP-23110	Addressed the issue where the **Device Health** page widget marks a device as having a CPU issue based on per-core utilization while the grid displays a non-issue average CPU value, creating a mismatch between the widget and the grid.
XCP-23841	Addressed the issue where the **Client Health** summary widget intermittently was out of sync with the data grid.
XCP-23919	Addressed the issue where the **Resource Utilization** widget did not display in the D360 overview widget section.
XCP-24032	Addressed the issue where CPU utilization on the **Device Health** page did not update for the backup slot in a stack device.
XCP-24232	Addressed the issue where the **Sites** page took an extended time to load, expand, and collapse a site group containing a large number of sites.
XCP-24592	Addressed the issue where switching to an account with a pilot license opened ExtremeCloud IQ (New) instead of ExtremeCloud IQ (Classic) as the default landing page.
XCP-24911	Addressed the issue where total throughput (Rx and Tx PPS) did not update with correct data on the **Wired Usage and Capacity** page.

Table 2: Addressed Issues in release 25.14.0-331 (continued)

Issue ID	Description
XCP-24944	Addressed the issue where the Usage Capacity grid port congestion filter did not include stack devices.
XCP-25112	Addressed the issue where **Alerts** page filters were not applied correctly when navigating from the **Dashboard Alert** widget.
XCP-25796	Addressed the issue where the **Image Scale** page rejected a floor width or height under 1000 meters with a message stating the value could not exceed 1000 meters, preventing the image from being saved.
XCP-25928	Addressed the issue where, after selecting sites for an Identity Provider (IDP) in the Attribute Mapping section, the site count displays zero instead of reflecting the number of sites selected. The selected sites are saved correctly upon saving. The count does not update in real time to show the correct number of sites chosen.
XCP-26932	Addressed the issue where Scope displayed the wrong hostname for a device when only one device was present.
XCP-26967	Addressed the issue where timeline details did not display correctly by default on the **Task Center** summary page.
XCP-27326	Addressed the issue where the **Client Health** page displayed a "Something went wrong" error and no client health data.
XIQ-49859	Addressed the issue where the 6 GHz channel for an AP5060 configured for low-power mode displayed on Maps as 6GHz SP instead of 6GHz LP.
XIQ-52260	Addressed the issue where the serial number overlapped an adjacent column on the **Network Devices** page after a device was managed or unmanaged.
XIQ-52350	Addressed the issue where an access point appeared twice on the **Usage & Capacity** view of the **Network Devices** page.
XIQ-52395	Addressed the issue where the **Device Status** view for AFC wireless devices showed empty widgets for a selected site.
Visualize	
NVO-15493	Addressed the issue where changing ports on a 7830 switch with an 8DE VIM from auto-sense to fabric trunk applied STP settings inconsistently across the ports.

Known Issues

Table 3 lists the Known Issues in ExtremeCloud IQ (New) release 25.14.0-331 Component update 25.14.1-3.

Table 3: Known Issues in release 25.14.0-331 Component update 25.14.1-3

Issue ID	Description
CFD	
CFD-18080	In the current release, the **Clients** view displays only actively connected clients by default. As a result, clients are removed from the main **Clients** list shortly after they disconnect. Previously connected clients can still be viewed by applying the Disconnected filter. This behavior is a known limitation and is functioning as designed. A future release is planned to introduce enhanced historical client visibility and remove the current restriction that limits the default view to connected clients only.
Alerts	
XCP-24533	The **Alert** widget on the **Dashboard** displays alert counts (Info/Warning/Critical) that do not match the counts shown on the global **Alerts** page for the same 24-hour window.
API	
XCP-23971, XCP-24089	On the **Device360 Port Stats** and **Clients** pages, graphs and UI widgets (including the Port Stats graph, Port Description grid, Port Stats Summary, Link PoE, and Usage/Utilization widgets) pull data from the legacy monitoring APIs instead of from the PerfMonitor APIs.
XCP-26696, XCP-26702, XCP-26712	The `cs-metastore-event-ingestion`, `xcloudiq-license-scheduler`, CAS, and CNS applications are deployed with a single replica and without a configured health check.
Device Management	
XCP-5227	Incorrect `Managed_by value` for locally managed devices.
XCP-22265	Export and import of VIQ, backup and restore of VIQ does not work properly if the Third-Party Management Engine (TPME) or ExtremeCloud IQ Site Engine is present.
XIQ-19320	Wi-Fi interface transmission power values may not update correctly on the **Managed Device** page after bulk edit operations.
XIQ-19368	User interface overrides Supplemental CLI option incorrectly pushes Supplemental CLI configuration instead of UI configuration for multicast rate limit settings.
XIQ-19498	Changing transmission type for eth0 interface on AP5010 incorrectly generates delta CLI for speed configuration.

Table 3: Known Issues in release 25.14.0-331 Component update 25.14.1-3 (continued)

Issue ID	Description
XIQ-19509	Configuring eth0 interface with minimum speed and half duplex transmission type causes AP to go offline.
XIQ-21339	When aggregation is enabled with a rate-limit configuration in ExtremeCloud IQ, configuration fails without an error message displayed.
XIQ-33498	An issue exists where client mode and backhaul mesh link options need to be disabled on AP5050U/D 6GHz FCC configurations to ensure proper regulatory compliance.
XIQ-34724	An issue exists where delta configuration push fails for AP5020 Wifi0 with dual 5G mode when 5G-Low channels are not supported in some countries.
XIQ-36259	Importing an Ekahau planner file does not import all walls.
XIQ-46182	An issue exists where the EXOS and Switch Engine 31.7.4.2-patch1-7 cannot be onboarded, monitored, or configured through drag-and-drop image management for all EXOS and Switch Engine supported SKUs.
XIQ-51481	Firmware upgrade for AP4060 series access points is not available. The access points do not appear in the **Upgrade Firmware** selection, and the upgrade does not complete when initiated from the device 3-dot menu.
XIQ-51853	The **Configuration Audit** view does not display the individual configuration changes, such as SSID, VLAN attributes, DNS server, NTP profile, and QoS settings, that a Network Policy applies after it is assigned to an access point.
XIQ-51982	When Wifi0 on an AP3020W is configured for 6 GHz radio in client mode, the required radio profile commands for the 6 GHz configuration are not generated.
XIQ-52706	Resetting a VIQ can result in unrecoverable data loss if the backup used for restoration is incomplete or the restore operation fails. The current Backup and Restore capability does not yet include all data. Verify that all required data has been exported before initiating a Reset VIQ operation.
XIQ-47371	Multiple logs are generated for both single and bulk device deletions.
Onboarding	
WS-3579	Notifications are sometimes split into two messages during certain user actions such as onboarding or device deletion operations.
Roles	
XCP-10308	**Manage** or **Unmanage** actions are not performed for the NetSecOps role.
SSO	
XCP-8507	The login button does not activate for certain SSO-enabled user login instances.
XCP-22975	When logging out of an SSO account and logging back in with a different SSO user, the system may incorrectly display the previous user's account information. This occurs because session data from the prior login is not fully cleared on logout. **Workaround:** Fully close the browser (all tabs and windows) after logging out of the SSO account before logging in with the new user.

Table 3: Known Issues in release 25.14.0-331 Component update 25.14.1-3 (continued)

Issue ID	Description
Troubleshooting	
XIQ-48210	Downloading the AFC Geolocation report produces a corrupt file that is not in the expected CSV format, making it unusable for troubleshooting.
Upgrading	
	Starting in 25.14.0, firmware upgrades use the new V2 API (DLCS) and upgrade activity is tracked in **Task Center** rather than the **Firmware History** page. Existing entries from 25.13.0 and earlier remain visible in **Firmware History**, but any new upgrade initiated in 25.14.0 or later will appear only in **Task Center**. The **Reschedule**, **Cancel**, and **Retry** actions are no longer available in **Firmware History**. Support for these actions in **Task Center** is targeted for a future release.
XCP-12063, XCP-12064, XCP-16651	An audit log is not generated for a scheduled a firmware upgrade, when firmware upgrade successfully completes, or when a firmware upgrade fails.
XCP-13051	While a firmware upgrade is in progress for a device in Extreme Platform ONE Networking it is deleted in ExtremeCloud IQ.
XCP-17804	Following an upgrade, certain data schemas may fail to register due to compatibility conflicts with previously stored schema versions. This can prevent some telemetry and client event data from being processed correctly until the issue is resolved.
XCP-21253	Upgrading to build 25.13.0-23 may fail due to a failed Liquibase database migration job.
XCP-25556	When a custom-uploaded firmware image is assigned the same version number as an existing default (system) firmware image for the same product type, a firmware upgrade using the custom image applies the default image instead. As a result, the device does not receive the intended custom firmware.
User Interface	
WS-4801	Clicking the **Help** icon in the mobile view does not open the **Resource Center**.
XCP-4999	Currently, when filtering on a switch stack, when a search matches any child device, the entire stack is displayed instead of individual devices.
XCP-5065	**Search** and **Filter** does not filter the appliance cluster.
XCP-19002	Fabric Attach links display as operationally down in the visualization even when they are operationally up. This issue affects Switch Engine downstream and SMLT Cluster upstream configurations that use Fabric Attach without authentication.
XCP-20134	The filter chip for the Extreme Platform ONE Networking selection in the Application Access column filter in **Access Management** is not displayed, preventing confirmation that the filter has been applied.
XCP-22364	Devices managed by ExtremeCloud IQ Site Engine appear in the **Device Health** and **CPU and Usage** tabs in the Extreme Platform ONE Networking **New Wired** section.

Table 3: Known Issues in release 25.14.0-331 Component update 25.14.1-3 (continued)

Issue ID	Description
XCP-22682	Management port statistics are not displayed on the **Usage and Capacity** page for Switch Engine/EXOS devices that have all standard ports disabled.
XCP-22746	The **Total Client** count on the **Usage and Capacity** page returns 0 for wired devices, even when client entries exist for those devices.
XCP-23112	When a filter is applied on the **Device Health** page, other columns such as **CPU Usage%**, **Memory Usage%**, and **PSU Usage%** display N/A. This behavior applies to all **Device Health** issue filters.
XCP-23139	Extreme Platform ONE Networking displays N/A for all metrics in the second row for a Switch Engine/EXOS switch in the **Device Health** and **Usage and Capacity** pages when multiple Switch Engine/EXOS switches are onboarded.
XCP-23406	The Total Queue Congestion Packets value for stack devices in the **Usage and Capacity Wired** page is lower than the actual value because the data collector excludes statistics from ports in a down (Ready) state.
XCP-23436	The Total Throughput columns (RxPktsPerSec and TxPktsPerSec) in the **Usage and Capacity Wired** device grid intermittently display zero even when traffic is actively flowing.
XCP-23450	A duplicate device row appears on the **Usage and Capacity** page.
XCP-23565	In scaled environments with 24,000 wired clients, only approximately 18,345 clients are displayed in the **Client Health** page; all clients are visible in ExtremeCloud IQ (Classic).
XCP-23900	The **Device Status** widget on the **Dashboard** shows an incorrect offline device count for wired devices.
XCP-23901	The **Device Status** widget on the **Dashboard** shows an incorrect total managed device count for wired devices.
XCP-23997	The **Device Health** widget does not display on the **Device360** overview page for stack devices.
XCP-24182	When no client issues are detected, the **Client Health** page displays '0 data found' instead of a 'No Issues' confirmation indicator.
XCP-24477	When navigating to the **Assets** page with an invalid `x.tab` parameter, the application defaults to the **All** tab correctly but does not remove the invalid parameter from the URL.
XCP-24524	The site ID is missing from the sites with issues grid response.
XCP-24537	The **Discovered** tab in the Assets/Inventory page uses 'unknown' as the URL parameter value instead of 'discovered', creating a mismatch between the user interface label and the URL parameter.
XCP-24557	The **Usage and Capacity** widget on the **Dashboard** does not include issue counts for stack devices. The widget shows 0 for sites where a stack device has congestion issues.
XCP-27843	Clarified CPU and Memory utilization support in Performance Monitoring: CPU and memory statistics are supported on newer device platforms; legacy CAPWAP devices (such as AP4000 and AP410C) do not report these metrics to Performance Monitoring and may display a value of 0%.

Table 3: Known Issues in release 25.14.0-331 Component update 25.14.1-3 (continued)

Issue ID	Description
XIQ-42050, XIQ-42051	Issues exist with FIPS enabled filters. The **Manage Application** page displays all applications instead of filtering to show only FIPS-enabled applications, and the **Manage Summary** widget shows inaccurate data for **Top Application Groups**, **Top Usage**, and **Total Application Usage** metrics.
XIQ-46203	On the **Monitoring** > **Clients** > **Users** tab, the Source value displays Other instead of Others.
XIQ-48218	Selecting **Configure** from **Network Devices** displays **Third Party Management** instead of **Configuration Profile**.
XIQ-49488	The Client Density heatmap displays an inaccurate client count that does not match the count shown on the client inventory page.
XIQ-52081	When navigating to the **Clients** page from the **Client Health** widget on the Dashboard, switching between the Wired and Wireless tabs may cause continuous page flickering and rapid URL alternation. This issue occurs only when the **Clients** page is accessed through the Dashboard widget; accessing the **Clients** page directly is not affected. **Workaround:** Navigate to the **Clients** page directly from the menu rather than through the **Client Health** widget on the Dashboard, or refresh the page if flickering occurs.
XIQ-52087	The **Roaming Issues** filter on the **Clients** > **Wireless** widget returns clients with no roaming issues instead of clients that have roaming issues.
Visualize	
NVO-15610	Disconnected TPME SNMP-discovered devices cannot be deleted when the devices are onboarded in another virtual IQ (VIQ).
NVO-15660	A Link Aggregation Group (LAG) configured between an EXOS/Switch Engine switch and an access point intermittently loses its LAG visualization on the network canvas and displays as a single link. The LAG configuration is correctly shown on both the EXOS/Switch Engine device and the AP, but the visualization canvas fails to consistently represent the aggregated link bundle.
NVO-17342	In the Physical Layer view, access points do not display in red when a connected port is disabled; instead, the access points disappear from the topology.
NVO-17928	Multiple XAPI calls via Swagger return HTTP 400 response codes, including calls to the dashboard/usage-capacity and dashboard/wired/device-health/temperature-issues endpoints.
NVO-18099	The CPU and memory utilization graphs for the Standby and Backup slots of a stack device display as 0. The API returns 0 for CPU and memory data when queried with a member slot serial number, while primary slot data displays correctly.
NVO-18389	The cloud physical link for an SD-WAN device is not removed when the device is deleted, causing an incorrect Internet hub icon to remain in the topology.

Device Support Information

Universal Compute Platform on page 22
Access Points on page 22
Switches on page 24
ExtremeCloud IQ Site Engine on page 49

This section lists the devices that ExtremeCloud IQ supports and includes the latest version of the software that each device supports.

Note
Site-Engine managed devices that are connected to ExtremeCloud IQ are Unsupported in ExtremeCloud IQ (New).

Note
ExtremeCloud IQ supports onboarding only for homogeneous stacks. Stacks consisting of different models (mixed mode, mixed platforms) are not supported. Those stacks can be managed by ExtremeCloud IQ Site Engine.

Universal Compute Platform

Table 4: Required Firmware Versions for Universal Compute Platform

Device Model	Latest Supported Release	Comments
ExtremeCloud Edge (UCP)	10.13.01	Supported hardware models: 1130C 2130C 3150C 3160C 4120C

Access Points

Access Point information is provided in the following sections:

- Universal Hardware on page 23
- IQ Engine (Cloud Native) on page 24

Universal Hardware

Device Model	Latest Supported Release	Recommended Sustaining Release	Recommended Minimum Release
AP302W	IQ Engine 10.9.2 WiNG OS 7.9.6.1 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP305C	IQ Engine 10.9.2 WiNG OS 7.9.6.1 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP305C-1	IQ Engine 10.9.2 WiNG OS 7.9.6.1 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP305CX	IQ Engine 10.9.2 WiNG OS 7.9.6.1 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP3000	IQ Engine 10.9.2 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP3000X	IQ Engine 10.9.2 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP3020/W/X	IQ Engine 10.9.2 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.5
AP4000	IQ Engine 10.9.2 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP4000-1	IQ Engine 10.9.2 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP4020/X/FX	IQ Engine 10.9.2 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.4
AP4060	IQ Engine 10.9.2 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.4
AP410C	IQ Engine 10.9.2 WiNG OS 7.9.6.1 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP410C-1	IQ Engine 10.9.2 WiNG OS 7.9.6.1 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP460C	IQ Engine 10.9.2 WiNG OS 7.9.6.1 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP460S6C	IQ Engine 10.9.2 WiNG OS 7.9.6.1 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2

Device Model	Latest Supported Release	Recommended Sustaining Release	Recommended Minimum Release
AP460S12C	IQ Engine 10.9.2 WiNG OS 7.9.6.1 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP5010	IQ Engine 10.9.2 WiNG OS 7.9.6.1 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP5020	IQ Engine 10.9.2 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP5022/FX/S6D	IQ Engine 10.9.2 AP 10.20.1	N/A	N/A
AP5050U/D	IQ Engine 10.9.2 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2
AP5060U/D	IQ Engine 10.9.2 AP 10.20.1	N/A	N/A
AP510C/CX	IQ Engine 10.9.2 AP 10.20.1	IQ Engine 10.8.5f (10.8.5.6)	IQ Engine 10.8.2

IQ Engine (Cloud Native)

Device Model	Latest Supported Release	Comments
AP650	IQ Engine 10.9.2	Platform support introduced with IQ Engine 10.0.1. End of Life Information
AP650X	IQ Engine 10.9.2	Platform support introduced with IQ Engine 10.0.1. End of Life Information
Atom AP30	IQ Engine 10.6.1a	Platform support introduced with IQ Engine 8.3.2. End of Life Information

Switches

Switch information is provided in the following sections:

- Universal Hardware on page 25
- ExtremeXOS on page 44
- VOSS on page 48

For the latest release notes for Fabric Engine and Switch Engine , see the Extreme Networks Documentation Site.

Universal Hardware

Device Model	Latest Supported Release	Standalone Support	Stack Support
4120-24MW-4Y	Switch Engine 33.6	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 200Gb stacking through two built-in QSFP28 ports **Note:** Can only stack with other 4120 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.
4120-48MW-4Y	Switch Engine 33.6	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 200Gb stacking through two built-in QSFP28 ports **Note:** Can only stack with other 4120 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
4120-Series-Stack	Switch Engine 33.6	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 200Gb stacking through two built-in QSFP28 ports **Note:** Can only stack with other 4120 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.
4220-12P-4X	Switch Engine 33.6 Fabric Engine 9.4	**Switch Engine**: • Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Fabric Engine**: Monitor **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 40Gb stacking through two built-in SFP+ uplink ports **Note:** Can only stack with other 4220 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
4220-12T-4X	Switch Engine 33.6 Fabric Engine 9.4	**Switch Engine**: • Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Fabric Engine**: Monitor **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 40Gb stacking through two built-in SFP+ uplink ports **Note:** Can only stack with other 4220 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.
4220-24P-4X	Switch Engine 33.6 Fabric Engine 9.4	**Switch Engine**: • Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Fabric Engine**: Monitor **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 40Gb stacking through two built-in SFP+ uplink ports **Note:** Can only stack with other 4220 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
4220-24T-4X	Switch Engine 33.6 Fabric Engine 9.4	**Switch Engine**: • Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Fabric Engine**: Device-level Configuration **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 40Gb stacking through two built-in SFP+ uplink ports **Note:** Can only stack with other 4220 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.
4220-48P-4X	Switch Engine 33.6	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 40Gb stacking through two built-in SFP+ uplink ports **Note:** Can only stack with other 4220 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
4220-48T-4X	Switch Engine 33.6	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 40Gb stacking through two built-in SFP+ uplink ports **Note:** Can only stack with other 4220 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.
4220-4MW-20P-4X	Switch Engine 33.6 Fabric Engine 9.4	**Switch Engine**: • Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Fabric Engine**: Device-level Configuration **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 40Gb stacking through two built-in SFP+ uplink ports **Note:** Can only stack with other 4220 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
4220-4MW-8P-4X	Switch Engine 33.6 Fabric Engine 9.4	**Switch Engine**: • Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Fabric Engine**: Device-level Configuration **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 40Gb stacking through two built-in SFP+ uplink ports **Note:** Can only stack with other 4220 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.
4220-8MW-40P-4X	Switch Engine 33.6	**Switch Engine**: • Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Fabric Engine**: Device-level Configuration **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 40Gb stacking through two built-in SFP+ uplink ports **Note:** Can only stack with other 4220 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
4220-8X	Switch Engine 33.6 Fabric Engine 9.4	**Switch Engine**: • Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Fabric Engine**: Device-level Configuration **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 40Gb stacking through two built-in SFP+ uplink ports **Note:** Can only stack with other 4220 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.
4220-Series-Stack	Switch Engine 33.6	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • 40Gb stacking through two built-in SFP+ uplink ports **Note:** Can only stack with other 4220 devices. Cross stacking between 4120 and 4220 is not supported. Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
5120-24X-4Y	Switch Engine 33.6	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • Ability to toggle universal ports from stacking-support enabled to stacking-support disabled • Two QSFP28 uplink ports that can operate at 1x100G, 4x10G, or 4x25G **Note:** Can only stack with other 5120 devices.Cross stacking between 4000 and 5000 is not supported.
5120-24XT-4Y	Switch Engine 33.6	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • Ability to toggle universal ports from stacking-support enabled to stacking-support disabled • Two QSFP28 uplink ports that can operate at 1x100G, 4x10G, or 4x25G **Note:** Can only stack with other 5120 devices.Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
5120-44X-4Y-2C	Switch Engine 33.6	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • Ability to toggle universal ports from stacking-support enabled to stacking-support disabled • Two QSFP28 uplink ports that can operate at 1x100G, 4x10G, or 4x25G **Note:** Can only stack with other 5120 devices.Cross stacking between 4000 and 5000 is not supported.
5120-Series-Stack	Switch Engine 33.6	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Pilot license required to configure advanced features.	• Onboard • Monitor • Template- and device-level configuration • SSH Proxy* • Up to 8 unit stacking • Ability to toggle universal ports from stacking-support enabled to stacking-support disabled • Two QSFP28 uplink ports that can operate at 1x100G, 4x10G, or 4x25G **Note:** Can only stack with other 5120 devices.Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
5320-16P-4XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5320-16P-4XE-DC	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5320-24T-8XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5320-24P-8XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
5320-48T-8XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5320-48P-8XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5420F-24T-4XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5420F-24P-4XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
5420F-24S-4XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5420F-48T-4XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5420F-48P-4XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5420F-48P-4XL	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy

Device Model	Latest Supported Release	Standalone Support	Stack Support
5420F-8W-16P-4XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5420F-16W-32P-4XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5420F-16MW-32P-4XE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5420M-24T-4YE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
5420M-24W-4YE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5420M-48T-4YE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5420M-48W-4YE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5420M-16MW-32P-4YE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
5520-24W	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5520-24T	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5520-24T-ACDC	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5520-24X-ACDC	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
5520-48W	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5520-48T	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5520-48T-ACDC	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5520-12MW-36W	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
5520-48SE	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5520-48SE-ACDC	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	• Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5520-24X	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5720-24MW	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
5720-48MW	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5720-24MXW	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
5720-48MXW	Switch Engine 33.6 Fabric Engine 9.4	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Note:** Fabric Engine only supports device-level configuration.	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
7520-48Y	Switch Engine 33.6 Fabric Engine 9.4	**Switch Engine:** • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Fabric Engine**: Device-level Configuration	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.

Device Model	Latest Supported Release	Standalone Support	Stack Support
7520-48YE	Switch Engine 33.6 Fabric Engine 9.4	**Switch Engine:** • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Fabric Engine**: Device-level Configuration	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
7520-48XT	Switch Engine 33.6 Fabric Engine 9.4	**Switch Engine:** • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Fabric Engine**: Device-level Configuration	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.
7720-32c	Switch Engine 33.6 Fabric Engine 9.4	**Switch Engine:** • Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI* **Fabric Engine**: Device-level Configuration	**Switch Engine**: • Monitor • Template- and device-level configuration • SSH Proxy **Note:** Cross stacking between 4000 and 5000 is not supported.

Note
* SSH Proxy and Supplemental CLI can be used for configuring additional parameters not currently available within template or device-level configurations.

ExtremeXOS

Device Model	Latest Supported Release	Standalone Support	Stack Support
X435-8P-2T-W	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	N/A
X435-24T-4S	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	N/A
X435-24P-4S	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	N/A
X435-8T-4S	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	N/A
X435-8P-4S	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	N/A
X440-G2-12p-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*
X440-G2-12t-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*

Device Model	Latest Supported Release	Standalone Support	Stack Support
X440-G2-24p-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*
X440-G2-24t-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*
X440-G2-48p-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*
X440-G2-48t-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*
X450-G2-24p-GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X450-G2-24p-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X450-G2-48p-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor

Device Model	Latest Supported Release	Standalone Support	Stack Support
X460-G2-16mp-32p-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • S	Monitor
X460-G2-24p-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X460-G2-24p-GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • S	Monitor
X460-G2-24p-24hp-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X460-G2-24t-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X460-G2-24t-GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X460-G2-24t-24ht-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X460-G2-24x-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor

Device Model	Latest Supported Release	Standalone Support	Stack Support
X460-G2-48p-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X460-G2-48t-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X460-G2-48t-GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X460-G2-48x-10GE4	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X465-24W	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X465-48W	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X465-24MU	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor

Device Model	Latest Supported Release	Standalone Support	Stack Support
X465-48P	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor
X465-24MU-24W	ExtremeXOS 33.6	• Monitor • Template- and device-level configuration • SSH Proxy* • Supplemental CLI*	Monitor

Note
***** SSH Proxy and Supplemental CLI can be used for configuring additional parameters not currently available within template or device-level configurations.

VOSS

Device Model	Latest Supported Release	Standalone Support	Stack Support
VSP7432CQ	VOSS 9.4.0.0	• Monitor • Device-level configuration • SSH Proxy* • Supplemental CLI*	Not supported
VSP7400-48Y	VOSS 9.4.0.0	• Monitor • Device-level configuration • SSH Proxy* • Supplemental CLI*	Not supported
VSP4900-48P	VOSS 9.4.0.0	• Monitor • Device-level configuration • SSH Proxy* • Supplemental CLI*	Not supported
VSP4900-24XE	VOSS 9.4.0.0	• Monitor • Device-level configuration • SSH Proxy* • Supplemental CLI*	Not supported

Device Model	Latest Supported Release	Standalone Support	Stack Support
VSP4900-24S	VOSS 9.4.0.0	• Monitor • Device-level configuration • SSH Proxy* • Supplemental CLI*	Not supported
VSP4900-12MXU-12XE	VOSS 9.4.0.0	• Monitor • Device-level configuration • SSH Proxy* • Supplemental CLI*	Not supported

Note
* SSH Proxy and Supplemental CLI can be used for configuring additional parameters not currently available within template or device-level configurations.

ExtremeCloud IQ Site Engine

ExtremeCloud IQ Site Engine Version	Supported Features
25.8.12	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions
25.8.13	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions

ExtremeCloud IQ Site Engine Version	Supported Features
25.11.10	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions
25.11.11	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions
25.11.12	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions
26.02.10	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions

ExtremeCloud IQ Site Engine Version	Supported Features
26.02.11	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions
26.02.12	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions
26.02.13	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions
26.06.10	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions

ExtremeCloud IQ Site Engine Version	Supported Features
26.06.11	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions
26.08.10	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions
26.08.11	• License allocation • Device Assignment to the ExtremeCloud IQ (New) • Device Statistics • Port Statistics • Unmanage/Manage device • Device Group to CCG mapping • Stack members • NAC details update for wireless end-systems • Wired end-systems reported to ExtremeCloud IQ (New) • Detect and report orphaned devices • Compatible with ExtremeCloud IQ (New) subscriptions